

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTH QUARTER Corner of Section 15, Township 141, Range 29, 5th P.M.

STATE OF MINNESOTA, County of CASS


At the corner location shown on the sketch:

- On 7/15/80 found a bent over GLO iron pipe monument with marked brass
DATE
cap with the lower 24" straight in the ground.
- left monument as found, lowered monument, removed monument (explain)
- On 7/15/80 placed a 2½" x 36" galvanized iron pipe with marked brass
DATE
cap up 0/6' above ground in place of found monument.

MONUMENT MARKED:

T141N R29W
 ¼ S10
 S15
 1980
 RLS. No. 12684

SKETCH OF REFERENCE TIES

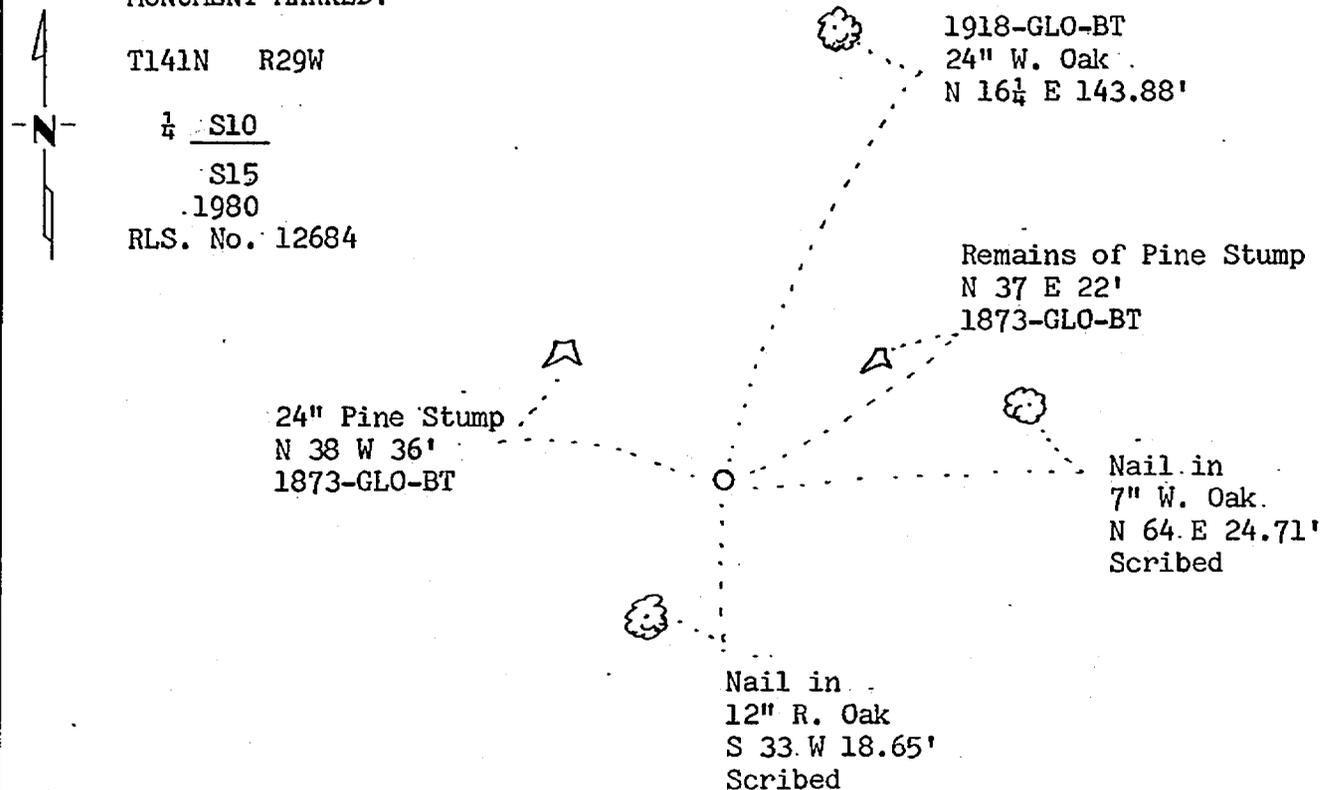

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page.

260992

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Nancy H. Stevenson 12-29-81
SIGNATURE DATE

Registration No. 12684

Land Surveyor, Professional Engineer

County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER

County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 9:30 A.M. on the 31 day of Dec. A.D., 1981

County Recorder Beverly Hardin

By MS, Deputy

DOCUMENT NO. 260992

Statement of Evidence:

- 1873 U.S. General Land Office survey set wood post for this corner and marked the following bearing trees: 20" W. Pine N 37 E 33 links and 15" W. Pine N 38 W 55 links.
- 1918 U.S. General Land Office dependent resurvey reestablished this corner from the remains of the original bearing trees: 28" W. Pine stump marked BT N 37 E 33 links and 24" W. Pine stump marked BT N 38 W 55 links. An iron pipe with a marked brass cap was set to mark the corner. The following bearing trees were marked: 14" W. Oak N 16-15 E 218 links and 6" Poplar S 40-15 E 71 links.
- 1980 USFS technician Bill Olson found GLO brass cap monument bent over. The lower 24" of the pipe was straight in the ground. Also found was the 2 original GLO bearing tree stumps and the 1918 W. Oak bearing tree. Two new bearing trees were marked and are shown on this certificate. Steel sign posts were set 4.0' east and west of the corner. No evidence of the Poplar BT was found. The damaged monument was replaced with a 2½" x 36" USFS monument.
- 1981 County Surveyor's Records in the Recorder's Office were checked and no resurvey information was found on this corner.
- 1981 On Dec. 22, I visited the corner and found a marked USFS brass cap monument. The stump of the 1873 NW bearing tree was evident. Remains of the 1873 NE bearing tree stump was found. The 1918 Oak bearing tree was alive and had a visible overgrown scar. From review of the corner, accepted the new monument as marking the original corner position.