

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


EAST QUARTER Corner of Section 30, Township 142, Range 30, 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On 1/6/81 found a GLO brass cap monument as set in 1917 from
DATE
original bearing trees.
 - left monument as found, lowered monument, removed monument (explain)
- On placed a
DATE

SKETCH OF REFERENCE TIES

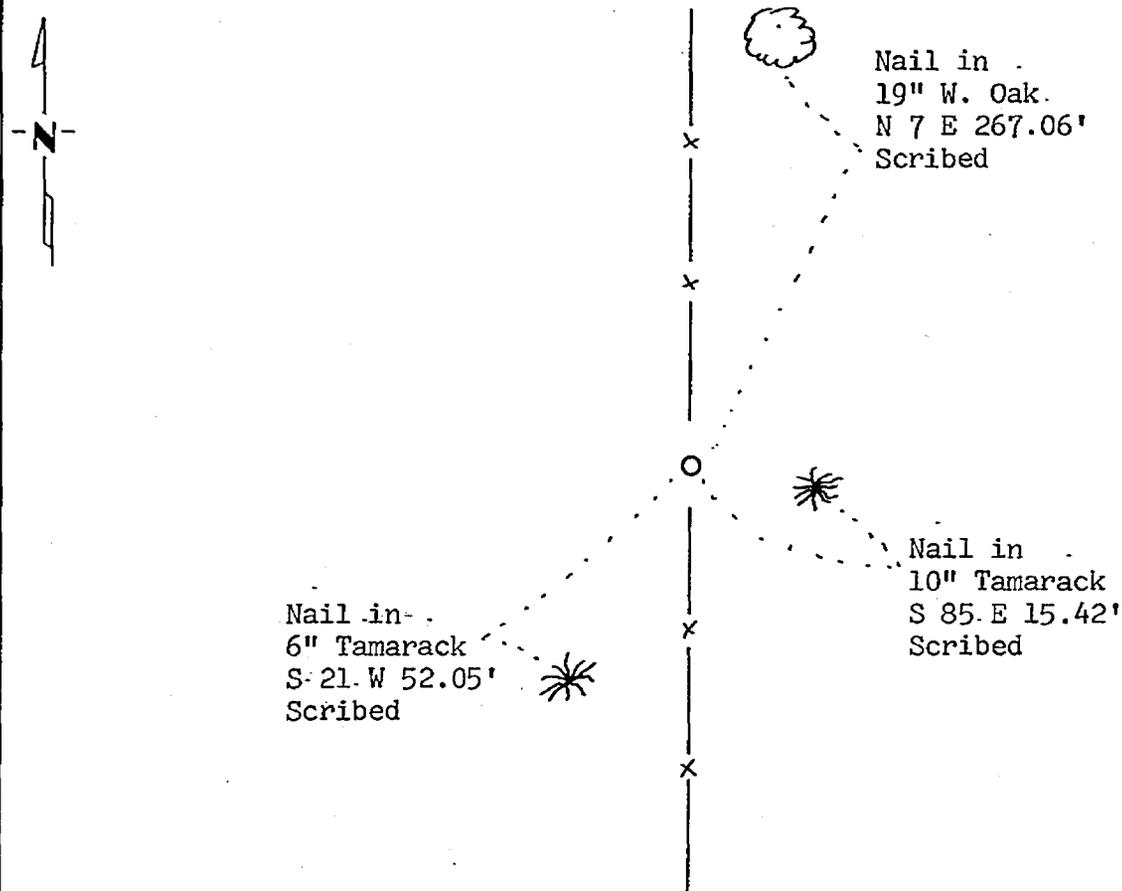

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Ray H. Stevenson 9-13-82
SIGNATURE DATE

Registration No. 12684

- Land Surveyor, Professional Engineer
- County Surveyor, County Engineer

264931
 OFFICE OF THE COUNTY RECORDER
 County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 9:20 A.M. on the 14 day of Sept. A.D., 1982

County Recorder Dorothy Hendricks

By MS, Deputy

DOCUMENT NO. 264931

Statement of Evidence:

- 1873 U.S. General Land Office survey set wood post for this corner and marked the following bearing trees: 8" Tamarack S 49 E 54 links and 5" Tamarack S 74 W 44 links.
- 1917 U.S. General Land Office dependent resurvey reestablished this corner from the original bearing trees found as follows: 6" Tam. S 74 W 44 links and 8" Tam. (dead & fallen) S 49 E 54 links. An iron pipe with a marked brass cap was set to mark the corner. The following bearing trees were marked: 6" Tamarack N 49½ E 42 links and 6" Tam. S 55 W 14 links.
- 1981 U.S. Forest Service technician W. Olson found the corner monumented with a GLO brass cap monument in good condition up 0.4' under north-south fence line. The following bearing trees were found: None. Three new bearing trees were marked and are shown on this certificate. Steel sign posts were set 4.0' north and 4.0' west of the corner.
- 1982 County Surveyor's Records in the Recorder's Office were checked and no resurvey information was found on this corner.
- 1982 On Sept. 9 I visited the corner and found items as per the 1981 USFS reports. Also found badly rotted 6" Tamarack stump S 55 W 9.2' with two small scribe marks still visible. I accepted the monument as marking the perpetuated position of the original corner based on the evidence of one 1917 bearing tree. No positive evidence found of the other 1917 bearing tree or the two original bearing trees.