

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTH QUARTER Corner of Section 13, Township 145, Range 29, 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On 12/29/80 found a 2" iron pipe with a marked 3" brass cap.
DATE
- left monument as found, lowered monument, removed monument (explain)
- On _____ placed a _____
DATE

SKETCH OF REFERENCE TIES


MONUMENT MARKED:

T145N R29W

$\frac{1}{4}$ $\frac{S\ 12}{S\ 13}$

1967

RLS No. 6807

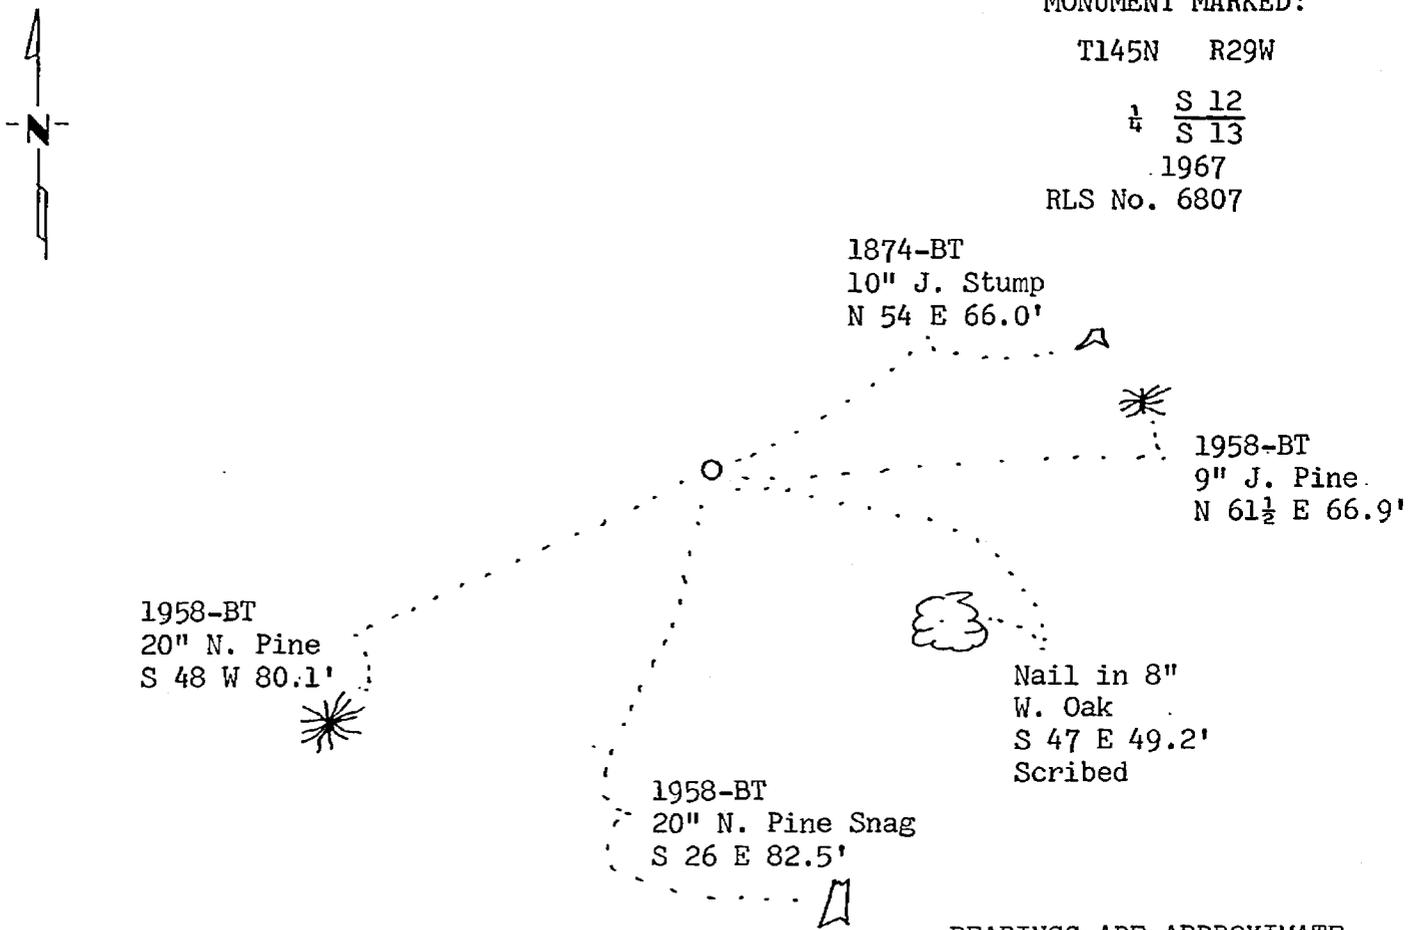

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Sam H. Stevenson
SIGNATURE

8-9-82
DATE

Registration No. 12604

- Land Surveyor, Professional Engineer
- County Surveyor, County Engineer

264972
 OFFICE OF THE COUNTY RECORDER

County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 10:32 A. on the 14 day of Sept. A.D., 19 82

County Recorder Beulah Hendrick

By MS, Deputy

DOCUMENT NO. 264972

Statement of Evidence:

- 1874 U.S. General Land Office survey set wood post for this corner and marked the following bearing trees: 6" Bl. Pine N 54 E 100 links and 4" Bl. Pine S 85 E 142 links.
- 1958 Peter J. Meyer, RLS No. 3628, shows a 2" x 60" galvanized iron pipe with a 3" marked bronze cap was set for the corner from evidence of one bearing tree found: 10" J. Pine stump, partly decayed, with scribing "BT" visible. Three new bearing trees are given: 13" R. Pine S 48 W 80.1', 16" R. Pine S 26 E 82.5', and 4" J. Pine N 61½ E 66.9'. This information is given on a corner certificate filed in the Cass County Recorder's Office on March 22, 1960.
- 1967 U.S. Forest Service technician J. Ekstrom found the corner had been torn out by dozer. He set a new 2" x 60" galvanized iron pipe with a 3" marked brass cap from the original stump and the three bearing trees listed in 1958.
- 1980 U.S. Forest Service technician J. Schoonover found the USFS monument in place in good condition up 2'. The bearing trees were found as described in 1958 with the Pine to the SE now a snag. One new bearing tree was marked and is shown on this certificate.
- 1982 County Surveyor's Records in the Surveyor's Office were checked and no resurvey information was found on this corner.
- 1982 On Sept. 2, I visited the corner and found items as per the 1980 USFS report. I accepted the monument as marking the perpetuated position of the original corner based on the remains of one original bearing tree and the 1958 certificate.