



A000608519

OFFICE OF THE COUNTY RECORDER
CASS COUNTY, MINNESOTA
CERTIFIED, FILED, AND/OR
RECORDED ON

12/26/2014 12:47:27 PM

AS DOC #: A000608519

PAGES: 2

REC FEES: 0.00

KATHRYN M. NORBY
CASS COUNTY RECORDER

BY SR Dep TX#: 120163

Page 1 of 2 A000608519

Twp 142 Rge 27 Index No. A.0-04.0

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


East Sixteenth corner of Section 6, Township 142 N., Range 27 W., 5th P.M.
State of Minnesota, County of Cass

At the corner location shown on the sketch:

On 19 June 2009 found a 1 inch outside diameter iron pipe with GLO brass cap,
top bent.

left monument as found lowered monument removed monument (explain)

On 19 June 2009 placed a straightened GLO monument at recovered location.

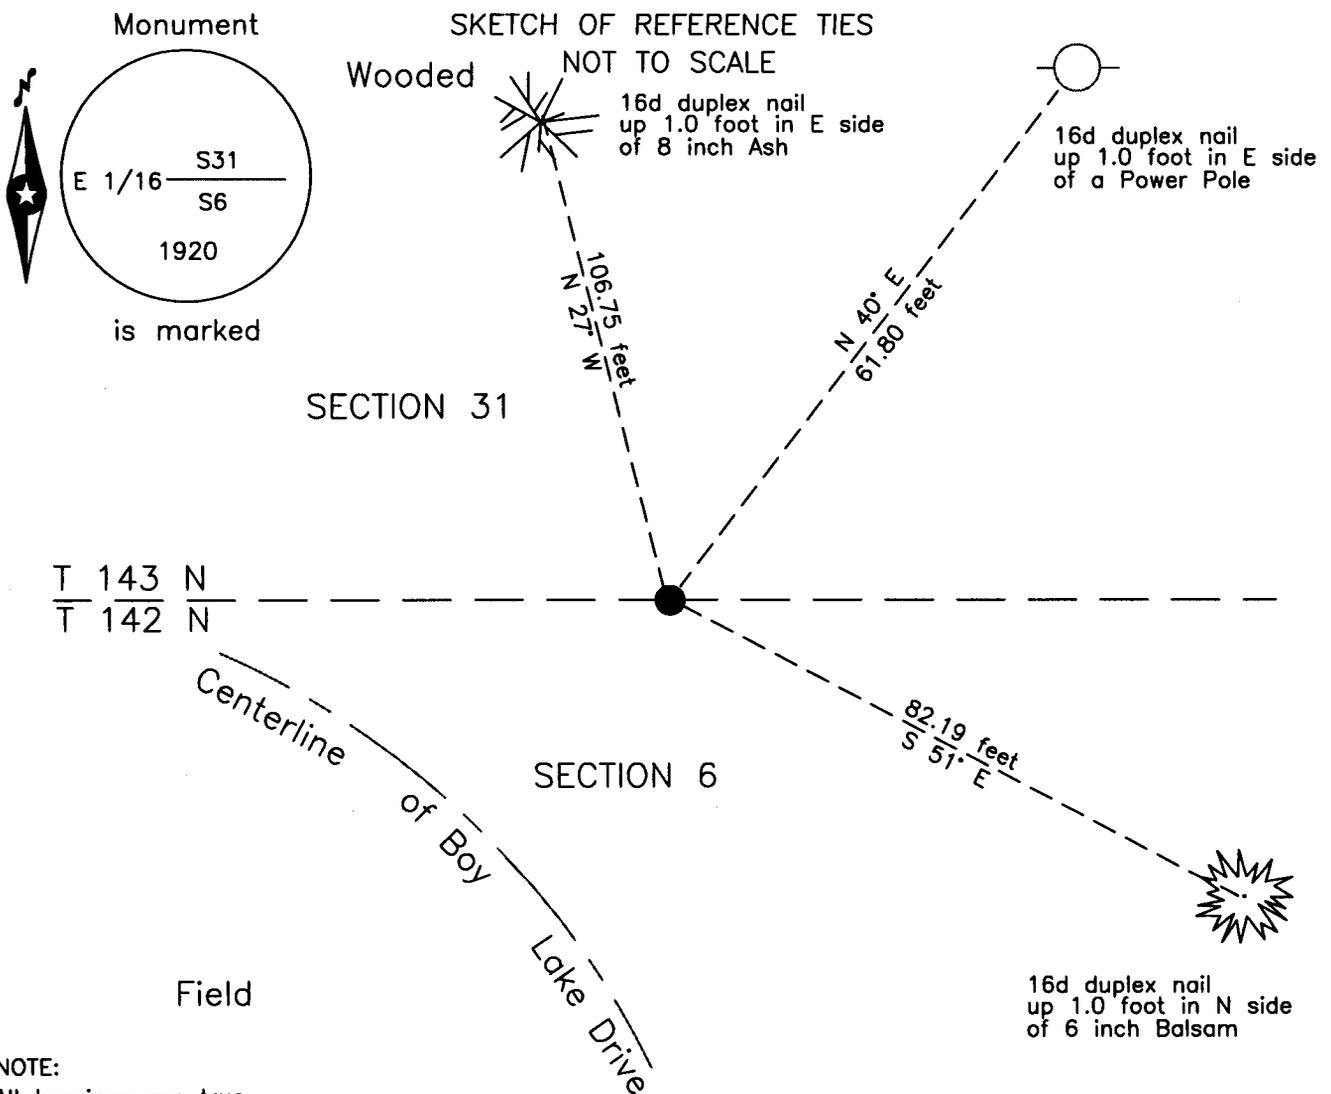

NOTE:
All bearings are true

Statement of evidence relative to this corner location is on the back of this page.

I hereby certify that this survey, plan or report was prepared by me or under my direct supervision and that I am a duly Licensed Land Surveyor under the laws of the State of Minnesota.

Terry L. Freeman, Cass County Surveyor
Date 12/24/14 MN License No. 21367



Index No. A.0-04.0

Statement of Evidence

East One Sixteenth corner Section 6, Township 142 North, Range 27 West, 5th Principal Meridian.

- 1920 E.G. Harrington, U.S. Cadastral Engineer, assisted by D.B. Clement, U.S. Surveyor, GLO, Reestablishment of a portion of the Exteriors and Subdivisional Lines Township 142 North, Range 27 West, on file with the Minnesota Historical Society in St. Paul, Minnesota, copies are filed with the CCHD/SO, states "Set an iron post, 3 ft. long, 1 ins. diam., 26 ins. in the ground, for the E. 1/16 sec. cor. with brass cap". Lists the following witnesses:
 10" Cedar S 78° E 241 links(178.86 feet) 10" Cedar S 72 1/2° W 322 links (212.52 feet)

- May 1970 C. Krause, technician, United States Department of Agriculture Forest Service (USFS), T 143N R 27 W Book 2, page 54, on file in the USFS Cass Lake Office, states Chained to this location from ¼ cor to the W. Found iron post, cap damaged, placed steel sign post near corner to protect until monumented.

- June 1970 C. Krause, technician, USFS, T 143N R 27 W Book 2, page 54, on file in the USFS Cass Lake Office, states Found iron post bent, cap damaged, I believe this corner may have been moved, there are no bearing trees left. Witnessed as follows:
 4" Cedar Post South (No distance)

- June 2009 B. Hippen, technician, records of the CCHD/SO, found 1 inch outside diameter iron pipe, bent, with GLO brass cap, bottom 1 foot of pipe is straight and vertical. Straighten pipe and reset, able to push in to ground by hand, now up 0.2 foot, 12 feet, more or less, South and 10 feet, more or less, West of centerline PI of Boy Lake Drive. This monument is near to midway and on line between the northeast and north quarter corners of section 6. Witnesses as follows:
 8" Ash N 27° W 106.75 feet Power Pole N 40° E 61.80 feet
 6" Balsam S 51° E 82.19 feet

- Dec. 2014 B. Hippen, technician, records of the CCHD/SO, found the brass cap monument and 2009 witnesses in good condition. The monument, recovered and established references for the position are shown on the face of this document.

Analysis of the recovered record data, field evidence and survey measurements, indicates that the monument recovered by CCHD/SO in 2009 is the accepted location of this corner.

County Coordinates (Cass County North)

Northing 227520.07

Easting 518551.85