


T. 141 R. 26 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
NE 11 Corner common to sections 1, 2, 11, 12

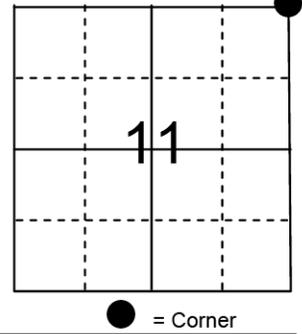

EXISTING SURVEYS

Original Government Survey

Year surveyed 1871  
Original monument Post

Original Evidence Found

Year of search \_\_\_\_\_ by \_\_\_\_\_  
Monument found \_\_\_\_\_

Bearing Trees

Species	Elm	Spruce	Aspen	Tamarack
Diameter	10"	8"	8"	7"
Bearing	N 78° E	S 73° E	N 34° W	S 37° W
Distance	31 links	27 links	47 links	40 links

Original Bearing Trees Found

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed Circ 1910 By Soo Line Railroad  
Location filed: Railroad map  
Monument: Corner position  
Indicate a distance of 2750' from the subject corner easterly to the south quarter corner of Section 1.

Evidence of Subsequent Corner Restoration

Year of search 11/1913 By J.M. Greene, Surveyor  
Location filed: Plat of WESTERN ADD. TO REMER, #35766  
Monument: The west line of said plat is dependent on the subject corner.

Bearing Trees, Reference Objects

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Bearing Trees, Reference Objects

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 10/1915 By J.M. Greene, Surveyor  
Location filed: Plat of ELTRICH ADD. TO REMER, #42200  
Monument: This plat in the NE 1/4 of NW 1/4 of S.12 dependent on cor.

Evidence of Subsequent Corner Restoration Found

Year of search 1984 By G. Stevenson, LS 12684  
Location filed: Worksheet of his subdivision of Section 1  
Monument: Indicates 1-3/4" iron pipe shows distances northerly and easterly to quarter corners.

Circa 1915, H. Colwell, assistant under G. Ralph, Engineer, survey of State Rural Highway #83, Survey Record #255, Book B, pages 86 & 87 and Curo Book 82, page 50, gives stationing for 1/4 & S. cor. to S. yield dist. of 2656' and 5300'.

6/1997, R.A. Mustonen, LS 11946  
Certificate of Survey in Section 2, #5536  
Indicates monuments set N. and S. of S. 1/16 cor. S. 1 and 2.  
10/1998, CCHD/SO  
#1998.007

Circa 1932, MN/DOT  
Hwy. #6 right-of-way/alignment map  
Corner at Int of Rds N, S. & E, shows location E. of new CL.

Found 1" pin, 3.3', W. of centerline Hwy. #6, on centerline of Warren Lane.

Circa 1934, MN/DOT  
Hwy #6 map 30-9, on web site as Doc. #1946364  
Shows the Hwy. centerline moving to W. approximately 40'.

5/2000, M.E. Stefan, LS 12261  
Certificate of Survey in Section 1, #873  
Indicates a bearing which is dependent on the subject corner.

9/1973, D. Rieke. LS 5094  
Plat of MYERS, Doc. #212388.  
Corner indicated being set 48.86' Ely of centerline of Hwy. #6.

5/2002, M.E. Stefan, LS 12261  
Certificate of Location  
Corner is obliterated – no monument located....placed a 1 1/2" x 24" Iron pipe driven flush with the surface of blacktop driveway.

1980, MN/DOT  
Survey crew working in Section 2, notes indicates a monument found at corner. Distances between corners indicate that the corner found may be similar to cor. used for plat of MYERS.

5/2006, J. Leas, LS 42619  
Certificate of Survey in Section 2, #3137  
Indicates the subject corner as recovered.

Subsequent Corner Restoration

Evidence of Subsequent Corner Restoration Found

Year surveyed 2006-09 By J. Leas, LS 42619

Year of search \_\_\_\_\_ By \_\_\_\_\_

Location filed: Unrecorded Certificate of Location

Location filed: \_\_\_\_\_

Monument:

Monument:

Working with CCHD/SO to review all previous work on file, also met with Milo Stephan to discuss this corner. Mr. Stephan discovered a computational error with his position and agreed that the correct location should be 4' W. KLD field crews recovered all existing monuments in Plat of ELTRICH ADD. TO REMER, and agreed with Mr. Stephan's corrected position. This position is also 2664.9' E. of N. 1/4 corner of Section 11, which matches the County Ditch Survey Distance.

12/2009, J. Leas, LS 42619

Unrecorded Certificate of Location of Government Corner Set 1/2" iron pipe for corner, 40.8' E. of centerline Hwy #6 and 4.38' W. of 1.5" pipe and witnessed as follows.

16" N. Pine, North, 67.07' 40d spike, up 1.0', X. side

12" Burr Oak, N 81° E, 22.57' 40d spike, up 1.0', X. side feet

14" W. Pine, S 51° E, 50.414' 0d spike, up 1.0', X. side feet

5/2018, CCHD/SO


#2017.030

Found 7/8" ODIP, capped RLS 42619, flush, in Warren Lane, all 2009 witnesses are in good condition.

Index No. E R I

CASS COUNTY LAND CORNER RECORD

T. 141 R. 26 M. 5TH Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
NE 11 Corner common to sections 12, 11, 12

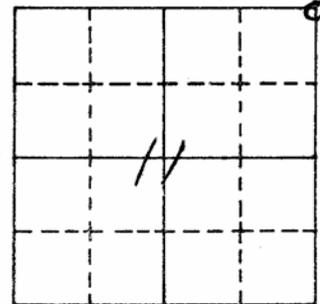

EXISTING SURVEYS

Original Government Survey

Year surveyed 1871  
Original monument POST

Original Evidence Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
Monument found \_\_\_\_\_

	Bearing Trees			
Species	<u>ELM</u>	<u>SPRUCE</u>	<u>ASPEN</u>	<u>TAM.</u>
Diameter	<u>10"</u>	<u>8"</u>	<u>8"</u>	<u>7"</u>
Bearing	<u>N78E</u>	<u>S73E</u>	<u>N34W</u>	<u>S37W</u>
Distance	<u>31 LKS</u>	<u>27 LKS</u>	<u>47 LKS</u>	<u>40 LKS</u>

Original Bearing Trees Found

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

O = Corner

Subsequent Corner Restoration

Year surveyed 1915? By \_\_\_\_\_  
Location filed Microfilm - roll 115 BK82 P. 26, 50  
Monument Sec. cov. notes S.R.H. #83  
.16' one way?

Evidence of Subsequent Corner Restoration

Year of search 1998 By CCSO  
Fd. in place 1" pin 3.3' West of E st. Hwy 6  
and E Warren St. to the East. Pin is 25' South  
of driveway to the west.

Bearing Trees, Reference Objects

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Bearing Trees, Reference Objects

<u>W. Pine</u>	<u>R. Pine</u>	<u>R. Pine</u>	<u>W. Pine</u>
<u>10"</u>	<u>12"</u>	<u>10"</u>	<u>12"</u>
<u>N 49° W</u>	<u>N 29° E</u>	<u>S 65° E</u>	<u>N 87° W</u>
<u>70.61'</u>	<u>76.38'</u>	<u>72.62'</u>	<u>42.18'</u>
<u>MN/DOT SRP</u>			<u>MN/DOT SRP</u>

Subsequent Corner Restoration E-21

Evidence of Subsequent Corner Restoration Found

Year surveyed \_\_\_\_\_ By \_\_\_\_\_  
Location filed \_\_\_\_\_  
Monument \_\_\_\_\_

Year of search \_\_\_\_\_ By \_\_\_\_\_  
PLAT - MYERS  
DELBERT RIEKE 1973

June 2003 M. Stefan #12261  
cert. of Sur. shows mon. found

Remonumentation certificate prepared \_\_\_\_\_ By \_\_\_\_\_  
Filed at \_\_\_\_\_ Date \_\_\_\_\_