

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 36, Township 135 N, Range 30 W, 5th P.M.

STATE OF MINNESOTA, County of Cass


At the corner location shown on the sketch:

- On _____ found a _____
- DATE
- left monument as found, lowered monument, removed monument (explain)
- On 6-30-97 Placed a PK and DNR Disc in deck of wooden bridge
- DATE

SKETCH OF REFERENCE TIES



Note: Corner is 2.2' w. of E. edge bridge. 7.5' E. of E. Bridge. 21.4' north of S. end bridge. 7' S. of E. River & bridge

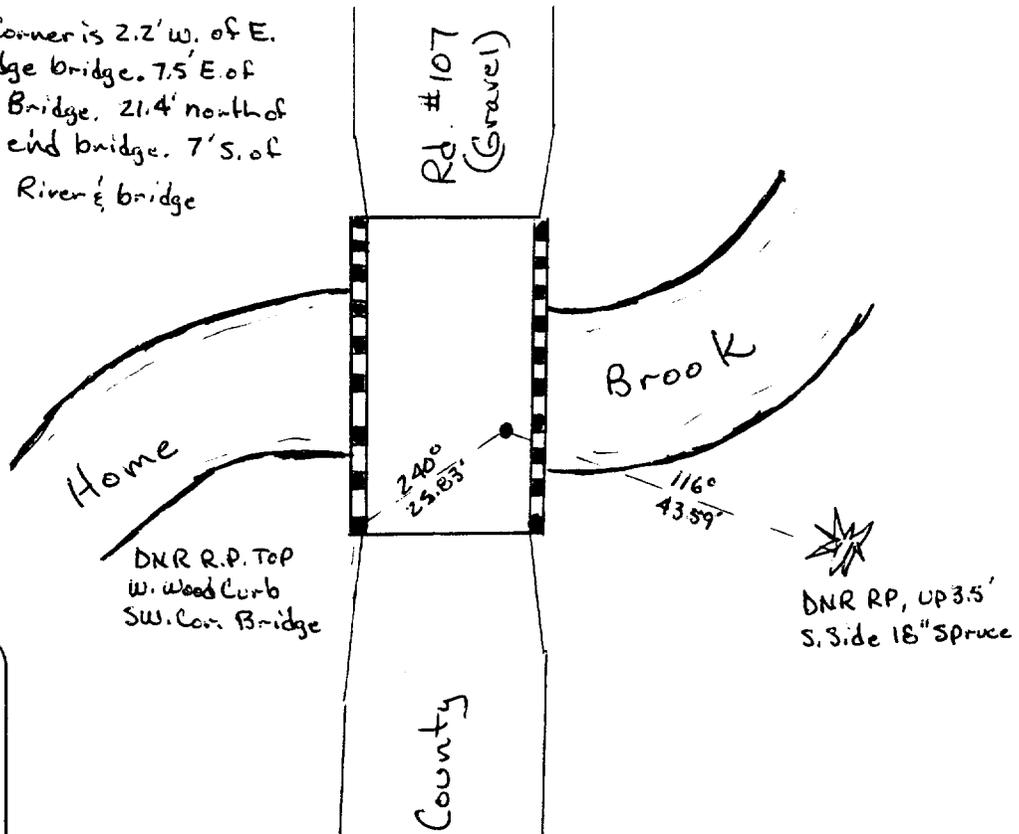

NAD 1983
Cass County
Coordinates
N 214,842.12
E. 518,762.85

Azimuths taken with Compass

Statement of evidence relative to this corner location is on back of page.

DATE 10/21/97
FILE FOM01856

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

John D. Walker 5/3/99
SIGNATURE DATE

License Number 16098

- Land Surveyor, Professional Engineer
- County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER 412420
County of Cass

I hereby certify that this document was filed in the Co. recorders office at 10:20 A.M. on the 5th day of May, A.D., 1999

County Recorder Claudine Kaylor
By K.F., Deputy

DOCUMENT NO. 412420

Northeast Corner Section 36, Township 135 North, Range 30 West

The Department of Natural Resources, Bureau of Engineering contacted the following offices for information regarding this corner:

MN Secretary of State
 Cass County Surveyor
 Cass County Highway Engineer
 Central Minnesota Surveying of Brainerd
 Widseth, Smith and Nolting of Brainerd
 Landecker and Associates of Pequot Lakes

1858 The U.S. General Land Office field notes, on file in the Secretary of State's Office, show this corner to be marked with a post, 0.10 chains(6.6') south of the south bank of a creek and the following bearing trees are marked:

Elm 8" S 40° W 35 links (23.10')
 Elm 8" S 26°E 10 links (6.60')
 Elm 12" N 1/2° E 219 links (144.54')

1990's Landecker and Associates used the lost position between southeast corner section 36 and the northeast corner section 25 for this corner for surveys in section 30 and 31. They did extensive traverse work in these sections and talked with local landowners before concluding this corner lost. They talked with Ray Anderson and Dean Anderson, whom both come up with the same position they did.

1997 The DNR survey crew searched for evidence of this corner. There is a bridge over Home Brook in the area of the corner. Occupation was located along the section lines north and south of this corner. No conclusion could be reached from the occupation lines. The crew talked to Mr. Holsapple, about 80 years old, who has lived in the area all of his life. He remembers seeing a CCC post at this corner and later seeing an iron pipe at the corner. He said it was taken out when the new bridge went in. He said the iron was at the south end of the bridge and on the south side of the river. He said the fences in section 36 don't mean much and they were just put in where the landowners thought they should go. The new bridge was built above where the old bridge was. Parts of the concrete for the old bridge is still in place under the new one, but it is difficult to tell where the south edge of the old bridge was. The corner was reviewed with Landecker and Associates and Terry Freeman, the county surveyor. There are no old road records to state where the road is in relationship to the corner and the corner has been accepted as lost in previous surveys therefor the corner was accepted as lost. A PK nail was set in the bridge to mark the corner.

For more information on this corner please contact MN DNR, Bureau of Engineering, Survey Section, 500 Lafayette Road, St. Paul, MN 55155-4029.