


T. 142 R. 28 M. 5th Coordinates: X _____ Y _____
NE 1/4 1 Corner common to sections 1 and 36-143-28

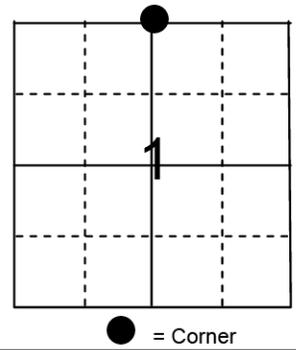

EXISTING SURVEYS

Original Government Survey	Original Evidence Found
Year surveyed <u>1873</u>	Year of search _____ by _____
Original monument <u>Post</u>	Monument found _____

Bearing Trees	
Species	<u>Poplar</u> <u>Poplar</u>
Diameter	<u>4"</u> <u>10"</u>
Bearing	<u>S 9° W</u> <u>N 25° W</u>
Distance	<u>7 links</u> <u>16 links</u>

Original Bearing Trees Found	
Species	_____
Diameter	_____
Bearing	_____
Distance	_____

Subsequent Corner Restoration

Year surveyed 6/1916 By H.F. Baldwin, Deputy Surveyor
 Location filed: Survey Record #288, Book B, page 22 and Curo
 Monument: Set Iron Monument
 Curo Book 77, page 23, set at lost position.

Evidence of Subsequent Corner Restoration

Year of search 8/1919 By E.B. Horst, LS 376
 Location filed: Survey Record #435, Book C, page 342
 Monument: Found Iron Monument
 21004.7 I.M. 1/4 S. cor. secs 1-142-28. Wagon trail leaves right
 of way N.

Bearing Trees, Reference Objects	
Species	<u>Spruce</u>
Diameter	<u>8"</u>
Bearing	<u>N 26° E</u>
Distance	<u>44.00'</u>

Bearing Trees, Reference Objects	
Species	_____
Diameter	_____
Bearing	_____
Distance	_____

Subsequent Corner Restoration

Year surveyed 6/1928 By E.G. Harrington, U.S. Cad. Eng.
 Location filed: Minnesota Historical Society 1/4 S 36
 Monument: 1"x 36" iron pipe with brass cap S 1
 The field notes of a portion of the work executed 1920
 by Harrington were lost. Iron set at proportionate distance,
 level with ground, local iron post, set flush, is found alongside
 brass cap, Harrington bearing trees likely destroyed during Rd.
 construct. I take new witnesses as follows.
10" Elm, S 18° E, 66 links (43.56')
12" Elm, N 14° 15' W, 130 links (85.80')

7/1993, C. Krause and R. Main, technicians, USFS
USFS, Book 1, page 2 T143N R28W
 No evidence of GLO or County irons. From 1/4 S36
 evidence of both GLO Elm's set a 2" x 24" iron S1
 pipe with brass cap 10" below road, 2.0' S. of T142N
 centerline Co. Rd. #172" and witnessed. 1993
6" W. Oak, N 26° W, 104.75' USFS
8" W. Oak, S 03° W, 39.99'
10" W. Oak, S 31° W, 55.46'
Steel Sign Post, South, 30.75'

3/2001, CCHD/SO
#2000.031
 Found USFS brass capped iron pipe, down 0.4', 3'+, - S. of
 centerline Co. Rd. #172, USFS 1993 witnesses all good.

Evidence of Subsequent Corner Restoration Found


Year of search 8/2009 By CCHD/SO
 Location filed: #2009.025
 Monument: Found USFS brass capped iron pipe
 down 1.0', 3'+, -, S. of centerline of Co. Rd. #172, the 1993
 USFS witnesses all good.

8/2019, CCHD/SO
#2009.025
 Found mag nail, 3'+, -, S. of centerline Co. Rd. #172, USFS
 1993 witnesses all good.

Index No. A23

CASS COUNTY LAND CORNER RECORD

T. 142 R. 28 M. 5TH Coordinates: X _____ Y _____
N 1/4 Corner common to sections 1 AND 36-143-28

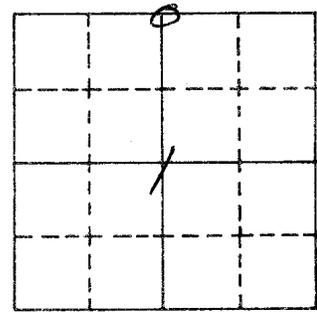

O = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1873
Original monument POST

Original Evidence Found

Year of search _____ By _____
Monument found _____

Species	Bearing	Trees
<u>POPULAR</u>	<u>POPULAR</u>	
<u>4"</u>	<u>10"</u>	
<u>S9W</u>	<u>N25W</u>	
<u>7LKS</u>	<u>16LKS</u>	

Original Bearing Trees Found

Species	Diameter	Bearing	Distance
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1916 By JOHN CURT
Location filed COUNTY SURVEY RECORD BOOK "B" P. 220-242
Monument SET STAKE PROPORTIONALLY SET IRON
1919, E.B. HORST, COUNTY BOOK "I" P. 342 FND J.M.
1916 - also on micro film - roll 115 BK 77 P. 23
P. 41 set J.M.

Evidence of Subsequent Corner Restoration

Year of search 1920, 1928 By GLO
IN 1928 - FND HARRINGTON'S 1x36" I.P.W. BRASS
CAP SET IN 1920 1/4 536
ALSO ANOTHER I.P. NEXT TO 51
BRASS CAP SET FLUSH 1920

Bearing Trees, Reference Objects

Species	Diameter	Bearing	Distance
<u>SPRUCE</u>	<u>8"</u>	<u>N26E</u>	<u>44.00'</u>
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

Bearing Trees, Reference Objects

ELM	ELM
<u>10"</u>	<u>12"</u>
<u>S18E</u>	<u>N14-15W</u>
<u>66 LKS</u>	<u>130 LKS</u>

A-23

Subsequent Corner Restoration

Year surveyed 1993 By _____
Location filed _____
Monument BRASS CAP I.P.

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____

1920 GLO Elm S22°E, 43.56' (Snag)
5" W. Oak N26°W, 104.75' 60d spk
8" W. Oak S31°W, 55.46' 60d spk
8" W. Oak S3°W, 39.99' 60d spk.
Sign Post South, (survey man sign)

3/2001 CCSO crew found Brass cap,
down 0.4', 3'± S. of & CR# 172.
1993 witnesses good.

Remonumentation certificate prepared _____ By _____
Filed at _____ Date _____