


T. 142 R. 28 M. 5th Coordinates: X _____ Y _____
CN 1/16 Corner common to sections 25

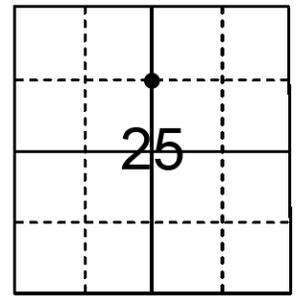

EXISTING SURVEYS

Original Government Survey

Year surveyed 8/1919
Original monument 1"x 36" I.P. w/Brass cap
E.G. Harrington, U.S. GLO

N 1/16 ^C | S25
 C
1919

Original Evidence Found

Year of search 1919 by Horst
Monument found GLO Brass Cap
Survey Rec. #435, Bk C, pg 344

● = Corner

Bearing Trees

Species Poplar Norway Pine
Diameter 6" 12"
Bearing S 73°15' E S 25° W
Distance 52 links 70 links

Original Bearing Trees Found

Species _____
Diameter _____
Bearing _____
Distance _____

Subsequent Corner Restoration

Year surveyed 8/1919 By E.B. Horst, LS 376, Deputy
Location filed: Survey Record #435, Book C, pg. 344 and Ditch
Monument: U.S. I.M.
Ditch Shelf 5, Book 34, pages 9 and 32, states At Sta. 58008.0
fall 4.70 ft. N. of C.N. 1/16 Sec. 25. Set over cor. L. 0°47' E.
on N 1/16 line.

Bearing Trees, Reference Objects

Species _____
Diameter _____
Bearing _____
Distance _____

Evidence of Subsequent Corner Restoration

Year of search 8/1966 By R.F. Schneider, LS 5740
Location filed: Certificate of Survey and notes for Harker
Monument: Indicates iron pipe monument

Bearing Trees, Reference Objects

Species _____
Diameter _____
Bearing _____
Distance _____

Subsequent Corner Restoration

Year surveyed 10/1982 By G.H. Stevenson, LS 12684
Location filed: Survey for Drennen
Monument: Indicates an iron pipe Mon.

9/1985, C. Krause, USFS
Field Book 1, page 46
Measured with distance wheel from NW 1/16 1362.2' E. along
centerline Co. Rd. Found FSLP on 5" Balsam stub 6' high, 39'
S. of rd. Rd. has been cut 4' to 8' deep and iron was probably
taken out by construction years ago. Found rotted and burned
out stump hole on top of bank that may have been GLO Pine,
no stump remains above ground.

7/1995, T.L. Freeman, LS 21367
Revised 1966 Schneider Certificate of Survey for Harker,
Indicates an iron pipe monument.

9/2000, T.L. Freeman, LS 21367
Certificate of Survey for Kube
Indicates GLO brass cap monument found at corner.

6/2018, CCHD/SO,
#2018.016
Found 20d spike, down 0.5', 4'+/-, S. of centerline Co. Rd.
#128, in the search area of this corner.

Evidence of Subsequent Corner Restoration Found

Year of search 9/2020 By CCHD/SO
Location filed: #2018.016
Monument: Set 1/2" rebar with plastic cap marked RLS 21367
at the position determined from recovered 1966 survey
monuments, down 0.5', 4', +/-, S. of new centerline Co. Rd.
#128 and witnessed as follows.
8" White Pine, N 22° W, 74.73' duplex nail, up 1.0', E. side
9" Red Oak, S 21 W, 42.96' duplex nail, up 1.0', W. side
7/8" Iron Pipe, South, 33.06' RLS 21367

