

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

I hereby certify that this survey, plan, or report was prepared by me or under my direct supervision and that I am a duly Licensed Land Surveyor under the laws of the State of Minnesota.

Alvin J. Luedtke
 Date: 2/12/03 License No: 17008

OFFICE OF THE COUNTY RECORDER
 County of CASS

I hereby certify that this document was filed in the Office of the County Recorder at 9:30 o'clock A.M. on the 14th day of Feb., 2003 A.D.

County Recorder Kathryn M. Nerby
 By: John B. Maeder, Deputy
 DOCUMENT NO. 462473


EAST QUARTER Corner of Section 29, Township 136, Range 29, 5th P.M.
 On _____ found a _____
 left monument as found, lowered monument, removed monument (explain)
 On Jan. 16, 2003 placed a 1/2" PIPE WITH PLASTIC CAP STAMPED "17008" AT GROUND SURFACE

decl: 5' E (ASSUMED)

SKETCH OF REFERENCE TIES

Not to Scale

Abstract Document
 #462473

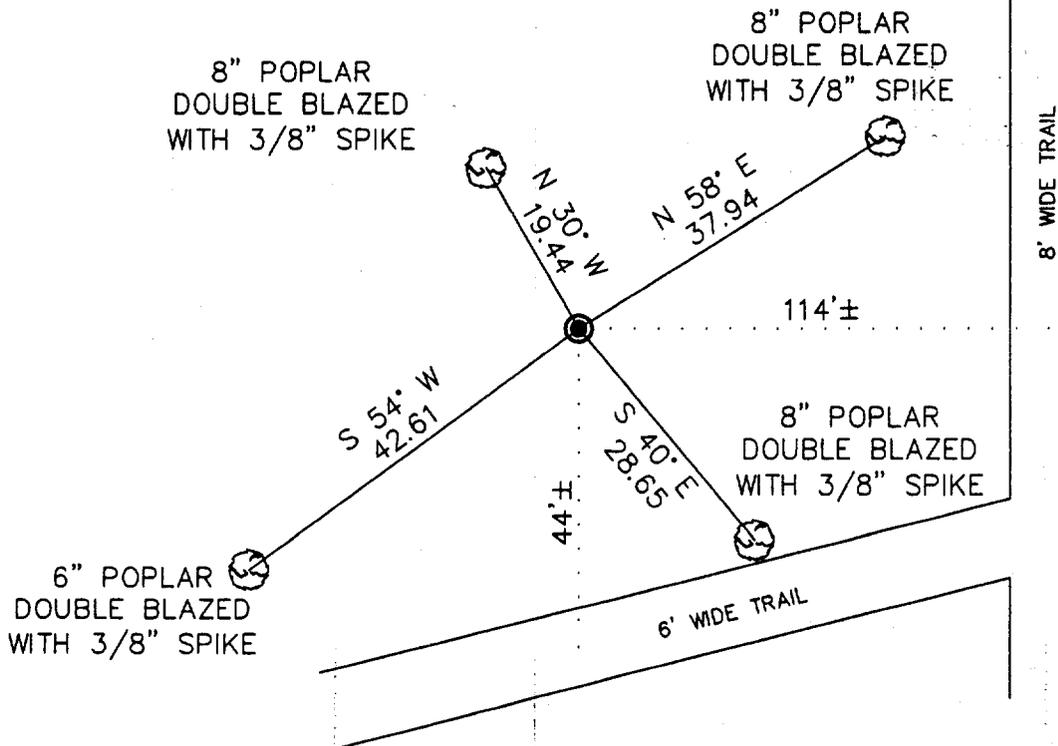

NOTE: DISTANCES SHOWN AS MEASURED TO SPIKE IN FACE OF TREE.

East Quarter corner, Section 29, Township 136 North,
Range 29 West, Cass County, Minnesota.

- 1870 Walker, Allen and Putnam originally established this corner position while subdividing Township 136 North, Range 29 West. A wood post was set to mark the corner with the following witnesses: A 10" N. Pine, North 43 degrees West, 27 links; a 12" N. Pine, North 43 degrees East, 39 links.
- 1980 A Landecker & Associates, Inc. survey crew searched for and could not find evidence of original corner position. The corner was determined lost and was reset by single proportion between the Northeast and Southeast corners of section 29. A 1" pipe was set along with the following witnesses: A 7" J. Pine, North, 7.50 feet; a 14" Poplar, Southeast, 23.61 feet; a 12" Poplar, West, 21.08 feet; a 10" Poplar, Southwest, 17.54 feet.
- 2003 A Landecker & Associates, Inc. survey crew could not find iron pipe nor witnesses from 1980 survey. Area appeared to have been cleared. A 1/2" pipe with plastic cap stamped "17008" was set again by single proportion between the Northeast and Southwest corners of Section 29. Four witnesses were established as shown.
- NOTE Landecker and Associates, Inc. and other surveyors have used the existing corners of Section 29 with confidence for over 20 years while performing a variety of surveys.