

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

A000581299
OFFICE OF COUNTY RECORDER
CASS COUNTY MINNESOTA
CERTIFIED, FILED, AND/OR
RECORDED ON
06/12/2012 11:25:37 AM
AS DOC #: A000581299
PAGES: 2 REC FEES: 0.00
KATHRYN M. NORBY
COUNTY RECORDER

037295
 Tx: 4029798

Business corner to Meander corner(#32) **Corner of Section** 34
Township 145 N, **Range** 26 W, **5th P.M.**
 STATE OF MINNESOTA, COUNTY OF CASS.

On _____, found a(n): _____
DATE


- left monument as found
- removed monument (explain)
- lowered monument
- raised monument

On 3-30-2011, set a(n): 2 1/2" x 3"
DATE
 Aluminum Capped Pipe (magnet in cap) flush with the ground.

(reserved for recording data)

See "Statement of Evidence" for further details (on back)

GPS I.D.: _____ Co. Proj. No.: _____

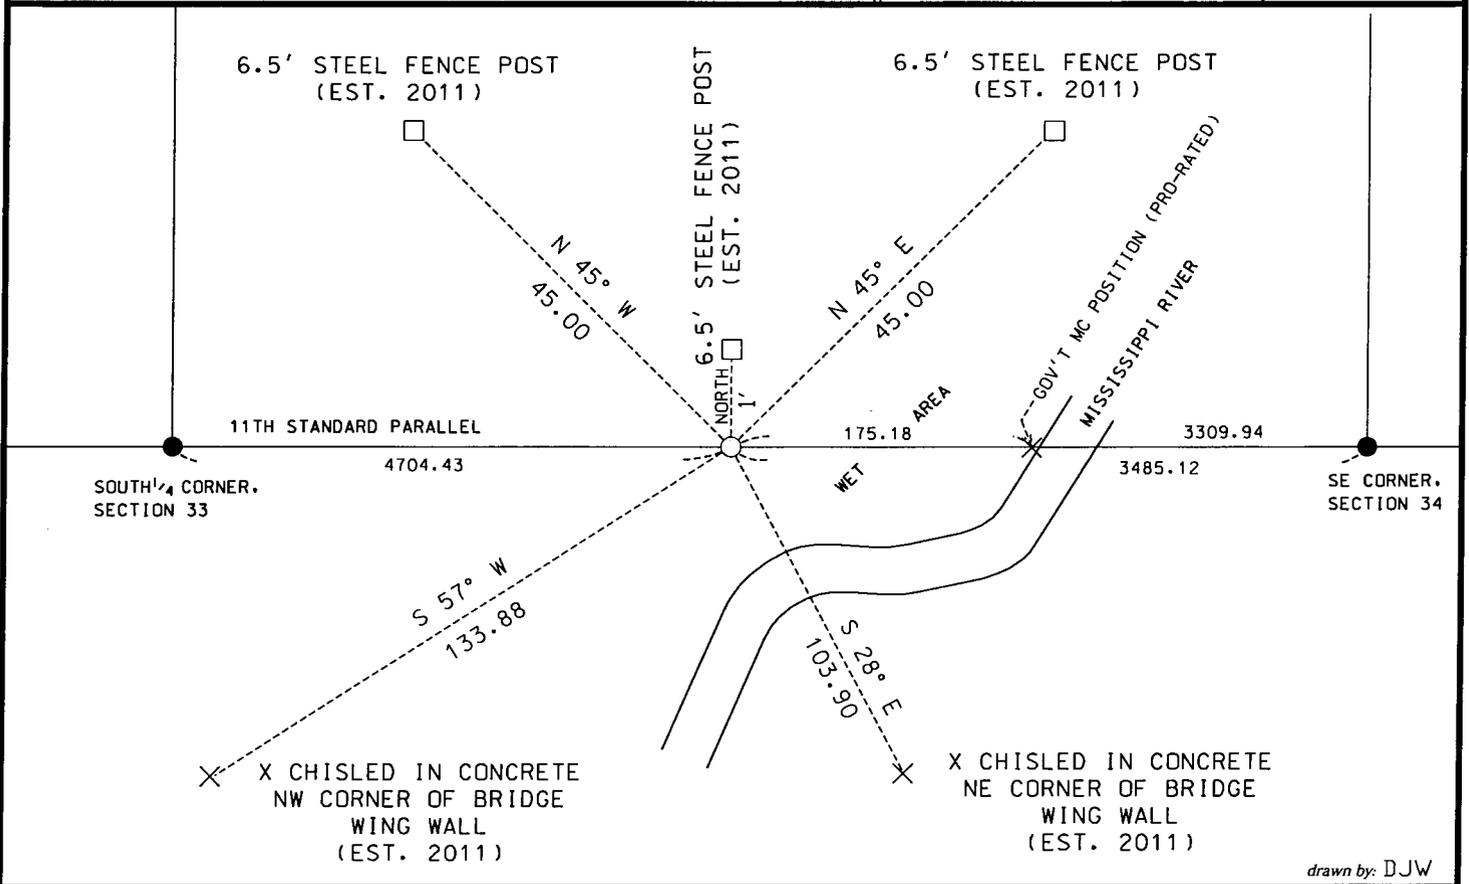

drawn by: DJW

"SKETCH OF REFERENCE TIES"

(not to scale - bearings are magnetic)

Ties are measured to center of monument unless otherwise noted.

UNITS = Metric English

NAD 83 Latitude (N):	<u>47°19'30.24283"</u>
Longitude (W):	<u>93°57'33.90519"</u>
CCNZC 83 Northing:	<u>290311.85</u>
Easting:	<u>563804.34</u>
NAD 83 S.P. Northing:	<u>1176115.15</u>
(Central) Easting:	<u>2696738.79</u>

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Dennis J. Warner
signature

Printed Name: Dennis J. Warner

5/10/2012
date

License No. 42656

County Surveyor Land Surveyor

STATEMENT OF EVIDENCE: Witness corner to the Meander corner (#32), west bank of Mississippi River, south line of Section 34, T145N, R26 West of the 5th Principal Meridian.

1871 The meander corner was not established by Geo. R. Stuntz, Deputy Surveyor, in the township boundary survey. His notes indicate a distance of 48.50 chains (3201 feet) to the right bank of the Mississippi River but does not indicate setting a post.

1876 Benj. C. Baldwin, resurveyed the south line of the township and set a post for the MC on the west side of the Mississippi.

1900 U.S. Army Corps of Engineers map of Pokegama Reservoir indicates this corner to be a known corner.

Unknown Minnesota Highway Department Right of Way Map, S.P. 1102 does not indicate the corner in place.

2011 Personnel from Short Elliott Hendrickson searched for the corner but it was not recovered. A monument was placed on the west bank of the Mississippi River between the southeast corner of Section 34 and the South Quarter corner of Section 33. Witnesses were made as shown on the face of this certificate. An analysis of the record information and field evidence supports this monument as the best evidence of the corner position.