

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 13

Township 141 N, Range 27 W, 5th P.M.

STATE OF MINNESOTA, COUNTY OF CASS.

A000581323
OFFICE OF COUNTY RECORDER
CASS COUNTY MINNESOTA
CERTIFIED, FILED, AND/OR
RECORDED ON
06/12/2012 11:26:01 AM
AS DOC #: A000581323
PAGES: 3 REC FEES: 0.00
KATHRYN M. NORBY
COUNTY RECORDER

(reserved for recording data)


On 12-12-2011, found a(n): 3' Brass capped concrete cylinder 6" below frozen swamp.

- left monument as found lowered monument
 removed monument (explain) raised monument

On _____, set a(n): _____

See "Statement of Evidence" for further details (on back)

GPS I.D.: _____ Co. Proj. No.: _____

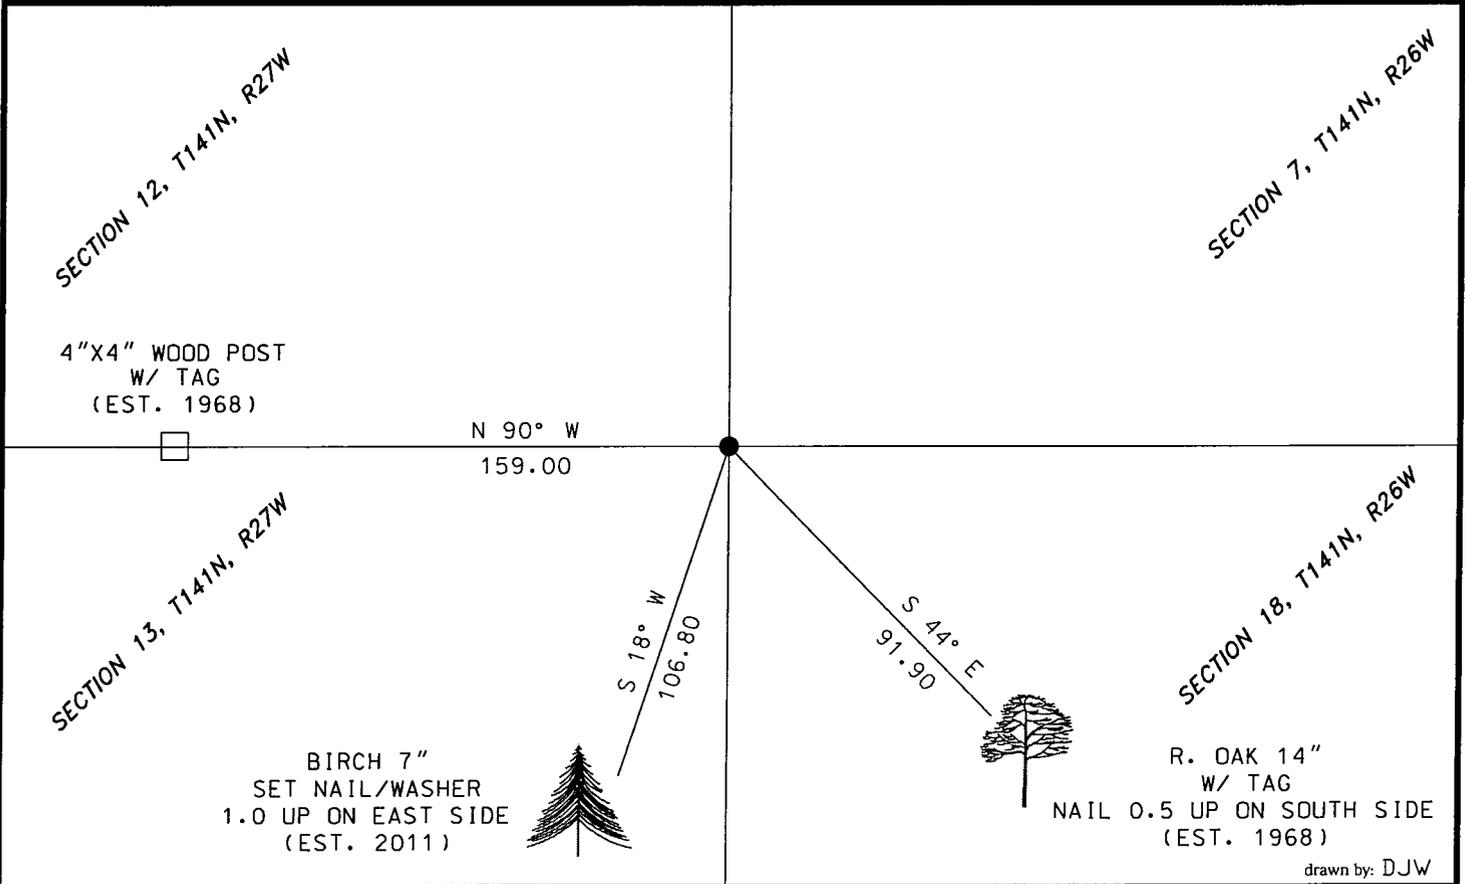

drawn by: DJW

"SKETCH OF REFERENCE TIES"

(not to scale - bearings are magnetic)

Ties are measured to center of monument unless otherwise noted.

UNITS = Metric English

NAD 83 Latitude (N): 47°02'08.19191"
 Longitude (W): 94°01'45.43521"
 CCNZC 83/96 Northing: 184677.784
 Easting: 546727.955
 NAD 83 S.P. Northing: 1070477.783
 Central Zone Easting: 2679703.549

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Dennis J. Warner
 signature

5/10/2012
 date

License No. 42656

Printed Name: Dennis J. Warner

County Surveyor Land Surveyor

STATEMENT OF EVIDENCE: Northeast corner of Section 13, T141N, R27 West of the 5th Principal Meridian.

1871 This corner was established by Walker, Allen & Putnam, Deputy Surveyors, in the township boundary survey. Their notes indicate a post was placed at the corner and established witnesses as follows:

| | | | | |
|-------|-----|------|----------|--------------|
| Elm | 16" | S05W | 28 links | (18.48 feet) |
| Birch | 14" | N70E | 51 links | (33.66 feet) |
| Fir | 8" | N18W | 32 links | (21.12 feet) |

1936 CC notes, on file with the US Forest Service Office in Cass Lake, 141-27, Book 2, page 21, found wood post in poor condition, 26" high. Placed a FSLP on a 18" Basswood S51E 66 feet. States corner in small pothole at end of road.

1967 James Ekstrom, notes, on file with the US Forest Service Office in Cass Lake, 141-27, Book 2, page 21, states found at this location a burned off scribed post at ground level and a 1" diameter pipe along side. Cut out line runs north. Also states he found a 20" scribed Basswood S51E 66 feet.

1968 Okerman, license number 6807, notes, on file with the US Forest Service Office in Cass Lake, 141-27, Book 2, page 21, states set a 6" diameter, 5' long cylindrical concrete monument capped with a 3" brass tablet and stamped. Witnessed as follows:

| | | | | |
|-----------|-----|------|------------|------------|
| Red Oak | 10" | S44E | 91.9 feet | scribed BT |
| White Oak | 7" | S24W | 72.45 feet | scribed BT |
| White Oak | 9" | N45E | 92.3 feet | scribed BT |
| White Oak | 4" | N16W | 47.3 feet | scribed BT |

1987 CK & TF, notes, on file with the US Forest Service Office in Cass Lake, 141-27, Book 3, page 19, state "found 6" concrete monument 4" below water in grass marsh, standing upright in place. Place 2 6' galvanized steel sign posts alongside monument and 2 8' steel sign posts alongside to stabilize monument in wet marsh." Notes witnesses as follows:

| | | | | |
|----------|-----|------|------------|--|
| Basswood | 18" | S51E | 66.0 feet | is now a tipout & lying on ground & rotting. |
| R. Oak | 13" | S44E | 91.7 feet | in good condition |
| W. Oak | 7" | S24W | 72.45 feet | now a windfall, chewed off by beaver |
| W. Oak | 10" | N45E | 92.25 feet | struck by lightning |
| W. Oak | 4" | N16W | 47.25 feet | now 4"x 8' stub/dead, top cut off with tag |

STATEMENT OF EVIDENCE: Northeast corner of Section 13, T141N, R27 West of the 5th Principal Meridian.

1987 Continued. Also states the following. "Place 8' steel sign posts NE & NW and 8' aluminum sign posts SE & SW, drove these sign posts in to bottom till solid which left about 14" above water and grass, we will place another 8' sign post on these posts and overlap and bolt these posts together. There are no suitable trees standing in area as around this pothole everything has been cut off recently. Place 8' fiberglass sign posts due north 4.1' and south 3.6' with warning sticker." Added witnesses as follows:

| | | | |
|----------|------|-----------|-------------------|
| 6.5' SFP | N45E | 9.80 feet | with 54-9 FS sign |
| 6.5' SFP | N45W | 9.68 feet | with 54-9 FS sign |
| 6.5' SFP | S45E | 9.48 feet | with 54-9 FS sign |
| 6.5' SFP | W45W | 8.55 feet | with 54-9 FS sign |

2001 R. Main, notes, on file with the US Forest Service Office in Cass Lake, 141-27, Book 3, page 19, states pond now flooded by beaver, need chest waders to get to corner. Found 4x4 wood post by Okerman on east side of old Remer Tower Road, corner is east 159 feet from post. Remer Tower Road FR 2103 was rebuilt in early 1980's and is now east of this corner +/- 200 feet.

2012 Personnel from Short Elliott Hendrickson found the 1968 monument. Witnesses were found and made as shown on the face of this certificate. An analysis of the record information and field evidence supports this monument as the best evidence of the original corner position.