



A000667561

OFFICE OF THE COUNTY RECORDER  
CASS COUNTY, MINNESOTA  
CERTIFIED, FILED, AND/OR  
RECORDED ON

12/22/2020 12:48:04 PM

AS DOC #: A000667561

PAGES: 2

REC FEES: 0.00

KATHRYN M. NORBY  
CASS COUNTY RECORDER

BY SF Dep TX#: 167739

Twp 142 Rge 28 Index No. R.0-21.0

### CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


Northeast corner of Section 26, Township 142 N., Range 28 W., 5th P.M.  
State of Minnesota, County of Cass

At the corner location shown on the sketch:

On 14 June 2018 found a 2.5 inch USFS brass capped monument, top bent,  
down 0.2 foot, 3 feet± east of centerline County Road #157.

left monument as found     lowered monument     removed monument (explain)

On 3 Sept 2020 placed a 2.5 inch USFS brass capped monument, down 0.5 foot,  
3 feet± east of centerline County Road #157.

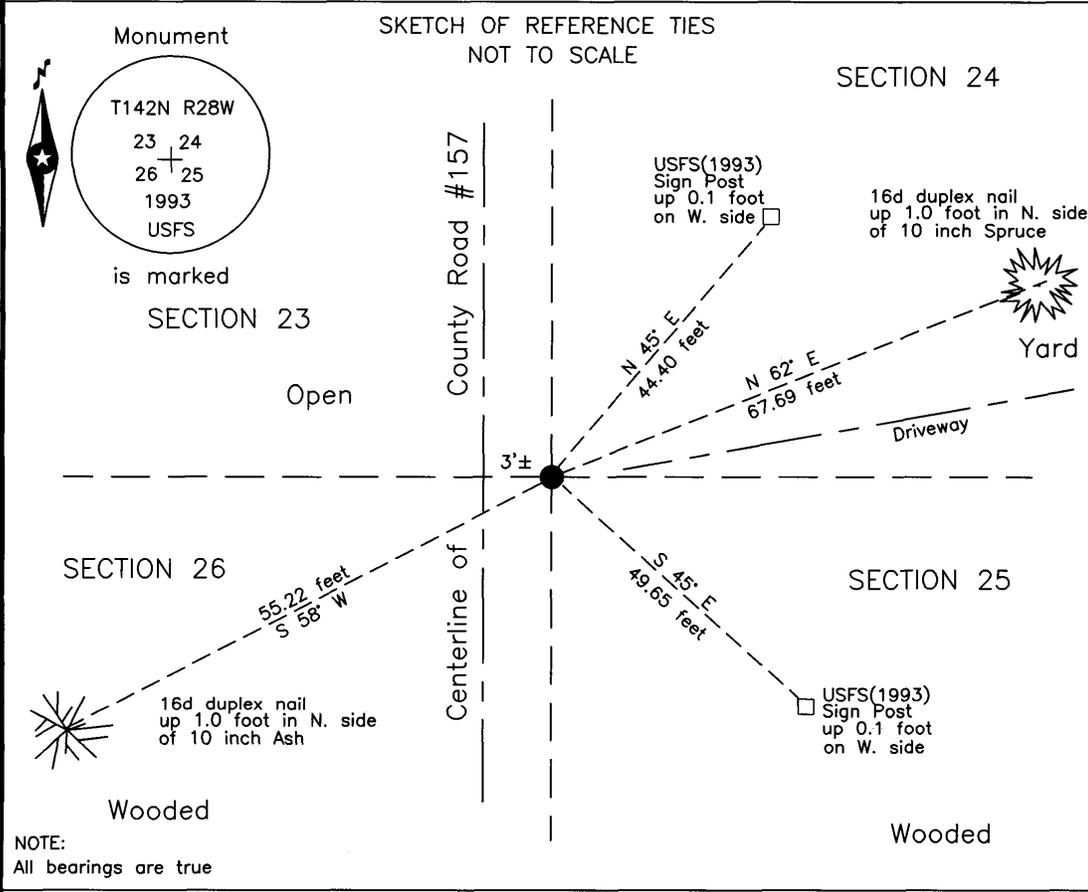

Statement of evidence relative to this corner location is on the back of this page.

I hereby certify that this survey, plan or report was prepared by me or under my direct supervision and that I am a duly Licensed Land Surveyor under the laws of the State of Minnesota.

*Terry L. Freeman*  
Terry L. Freeman, Cass County Surveyor

Date 12/22/20 MN License No. 21367



**Index No. R.0-21.0**

Statement of Evidence

**Northeast corner of Section 26, Township 142 North, Range 28 West, 5th Principal Meridian.**

Feb. P.H. Conger, General Land Office (GLO) Deputy Surveyor, in the notes of the subdivision of Township 142 North, 1874 Range 28 West, set a post for the original corner and referenced it as follows:  
6" Dry Cedar N 89° W 30 links (19.80 feet) 8" Dry Cedar N 50° E 27 links (17.82 feet)  
The above records are on file with the Minnesota Historical Society, St. Paul, Minnesota, copies are filed with the Cass County Highway Department, Surveyor's Office (CCHD/SO).

July E.B. Horst, LS 376, Deputy County Surveyor, Survey Record #371, Book B, page 602 and Curo Book 151, 1917 pages 17 and 19, on file in the CCHD/SO, lists GLO witnesses and states "we find a stake set by Clark but it must be off as there is no cedar near. We look all P.M. for cor." Later states "We look balance of day for B.T.s to cor. of sec's 23-24-25-26. But find nothing."

Aug. E.G. Harrington, U.S. Cadastral Engineer GLO, Dependent Resurvey of the North Boundary and Subdivisional 1919 Lines Township 142 North, Range 28 West, on file with the Minnesota Historical Society, St. Paul, Minnesota, copies are filed with the CCHD/SO, state "The point for the original cor. of secs. 23, 24, 25, and 26, which point is reestablished from the stumps of the original bearing trees. Set an iron post, 3 ft. long, 2 ins. Diam., 26 ins in the ground, for cor." The bearing trees are listed as follows:  
10" Cedar stump(GLO) N 89° W 30 links (19.80 feet) 8" Cedar stump(GLO) N 50° E 27 links (17.82 feet)  
8" Spruce N 60°15' E 55 links (36.30 feet) 8" Tamarack S 18°30' E 2 links ( 1.32 feet)  
6" Tamarack S 43° W 19 links (12.54 feet) 8" Tamarack N 2°30' W 9 links ( 5.94 feet)

Aug. E.B. Horst, LS 376, Deputy County Surveyor, Survey Record #435, Book C, page 344 and Ditch Shelf 5, Book 37 1919 page 7, on file in the CCHD/SO, states "At Sta. 53927.0 R. 0°29' U.S. I.M. sec. cor. 23-24-25-26."

Sept. C. Krause, technician, United States Department of Agriculture Forest Service(USFS), T 142N R 28 W, Book 1, 1985 page 37, on file in the USFS Cass Lake Office, states Found. 2 inch iron cap missing, top of iron bent south base in place.

Oct. R. Main, technician, USFS, T 142N R 28 W, Book 1, page 37, on file in the USFS Cass Lake Office, states 1993 "Fd. 2 1/2" Cass County iron pipe 2.2' long along side GLO 2" iron 1.4' long both monuments go to same location. Top of GLO iron & cap have been broken off, County monument is badly bent south. We removed both monuments and set USFS iron to replace section corner, placed magnetic pellet 3.7' below road." Set 2"x 24" iron pipe, USFS brass cap monument, down 12 inches, 4 feet east of centerline of County Road #157 and witnessed as follows:  
15" Tamarack S 31° W 90.90 feet Steel Sign Post N 45° E 44.55 feet  
Steel Sign Post S 45° E 49.95 feet

June B. Hippen, technician, records of the CCHD/SO, prior to reconstruction of County Road #157, found USFS 2018 monument, flush, 3 feet, more or less, east of centerline of County Road #157, brass cap torn off, top bent, monument tipped, locate at base of monument, remove monument and witnessed as follows:  
Steel Sign Post(1993) S 45° E 49.65 feet Steel Sign Post(1993) N 45° E 44.40 feet  
10" Ash S 58° W 55.22 feet 10" Spruce N 62° E 67.69 feet

Sept. B. Hippen, technician, records of the CCHD/SO, straighten USFS pipe and reattach brass cap, reset from 2020 witnesses, down 0.5 foot, 3 feet, more or less, east of centerline of County Road #157.

The monument, recovered and established references for the position are shown on the face of this document.

**Analysis of the recovered record data, field evidence and survey measurements, indicates that the monument recovered by the CCHD/SO in 2018 is the correct perpetuation of this corner.**

**County Coordinates (Cass County North)**  
**Northing 206985.76**  
**Easting 508818.90**