



A000668750

OFFICE OF THE COUNTY RECORDER
CASS COUNTY, MINNESOTA
CERTIFIED, FILED, AND/OR
RECORDED ON

1/28/2021 10:33:31 AM

AS DOC #: A000668750

PAGES: 2

REC FEES: 0.00

KATHRYN M. NORBY
CASS COUNTY RECORDER

BY SF Dep TX#: 168663


CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

East 1/4 Corner of Section 33, Township 145 N, Range 31 W, 5th P.M.
County of Cass, State of Minnesota

At the corner location shown on the sketch :

- On 06/25/2020 found 2-1/2" diameter iron pipe, 10" below pavement surface with 1/2" rebar inside pipe.
- left monument as found lowered monument removed monument (explain)
- On _____ set _____

SKETCH OF REFERENCE TIES (NOT TO SCALE)

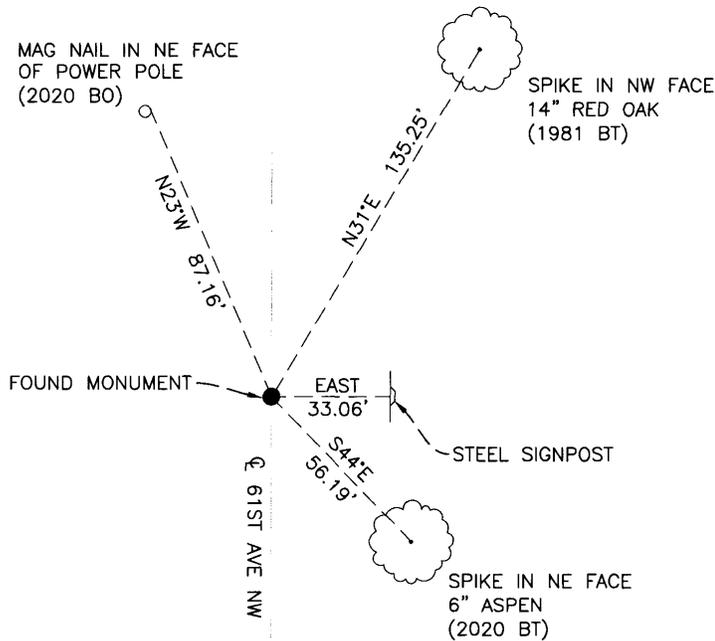

Note:
Distances shown are horizontal
Bearings shown are geodetic

Sheet 1 of 2

Statement of evidence relative to this corner location is on the back of this page

I hereby certify that this survey, plan, or report was prepared by me or under my direct supervision and that I am a duly Licensed Land Surveyor under the laws of the state of Minnesota.

Aaron J. Skattum
Aaron J. Skattum
MN License No. 54139

12-14-2020
Date

Corner Index No. X.0-13.0
GCDB ID No. 400140

Cass County Coordinates
North Zone, NAD83(2011)
N: 292,386.175
E: 402,928.308



Corner Index No. X.0-13.0

STATEMENT OF EVIDENCE

East 1/4 Corner of Sec. 33, T.145N., R.31W., 5th P.M., Cass County, MN

- 1875 B.C. Baldwin US General Land Office, originally established this corner while surveying the subdivision lines of this township, and set wood post to mark the corner position with the following witnesses:

Red oak	8"	S77.5°W	28 links (18.48')
Ironwood	4"	S86°E	20 links (13.20')

Information on file at the MN Historical Society, St. Paul, MN. Copies filed with the Cass County Highway Department/Surveyor's Office (CCHD/SO).

- 1913 J. Curo, Cass County Surveyor, in Survey Record #237 (Book "A", Page 611, CCHD/SO Records) found evidence of the original GLO survey and set a 2-1/2" iron pipe, 48" long with cap, and noted the following witnesses:

Red oak	8"	S77.5°W	18.48'	1875 BT, found standing, plainly marked
Ironwood	4"	S86°E	13.20'	1875 BT, found roots of tree
Elm	10"	S43°49'W	63.73	New BT, nail in base
White pine	30"	N86°14'E	89.26'	New BT, nail in base

Information on file at CCHD/SO

- 1933 J.A. Gjelhaug, US Forest Service (Form 874-9, USFS Records) found a monument of unspecified type "in road", and noted the following bearing trees:

Red oak	16"	S77.5°W	18.48'	Noted as old government BT
Red oak	4"	N29°W	35.64'	Marked new BT

USFS records cited herein are on file at the Chippewa National Forest Supervisor's Office.

- 1981 C. Krause & G. Brama, US Forest Service, (Corner Book 1, page 15, USFS Records) found the iron pipe with the cap in place, 6" below road surface centerline, with old fence line running east of corner. They noted the following witnesses:

Red oak	8"	S77.5°W	18.48'	1875 BT, not found, in road clearing
Ironwood	4"	S86°E	13.20'	1875 BT, not found, in road clearing
Elm	10"	S43°49'W	63.73	1913 BT, not found, in power line clearing
White pine	30"	N86°14'E	89.26'	1913 BT, now well rotted, cut off stump
Red oak	11"	N65°E	69.60'	New BT
Red oak	10"	N31°E	135.25'	New BT
White oak	10"	S50°E	112.05'	New BT

- 2020 A. Skattum US Forest Service, (Corner Book 1, page 14, USFS Records) found the iron pipe with cap in good condition, 7" below gravel road surface, and noted the following witnesses:

Red oak	11"	N65°E	69.60'	1981 BT, now a fallen, rotten log
Red oak	14"	N31°E	135.25'	1981 BT, found live in good condition
White oak	10"	S50°E	112.05'	1981 BT, no evidence found
Aspen	10"	S44°E	56.19'	New BT
Steel signpost	East		33.06'	New signpost set
Mag nail in NE face of power pole		N23°W	87.16'	(New B0)