

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTHEAST Corner of Section 15, Township 141, Range 29, 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On 7/10/80 found a 1" GLO iron pipe monument bent over in west wheel
DATE
track of trail.
- left monument as found, lowered monument, removed monument (explain)
- On 7/10/80 placed a 2 1/2" x 24" galvanized iron pipe with marked brass cap
DATE
down 0.8' in trail in place of found monument.

SKETCH OF REFERENCE TIES

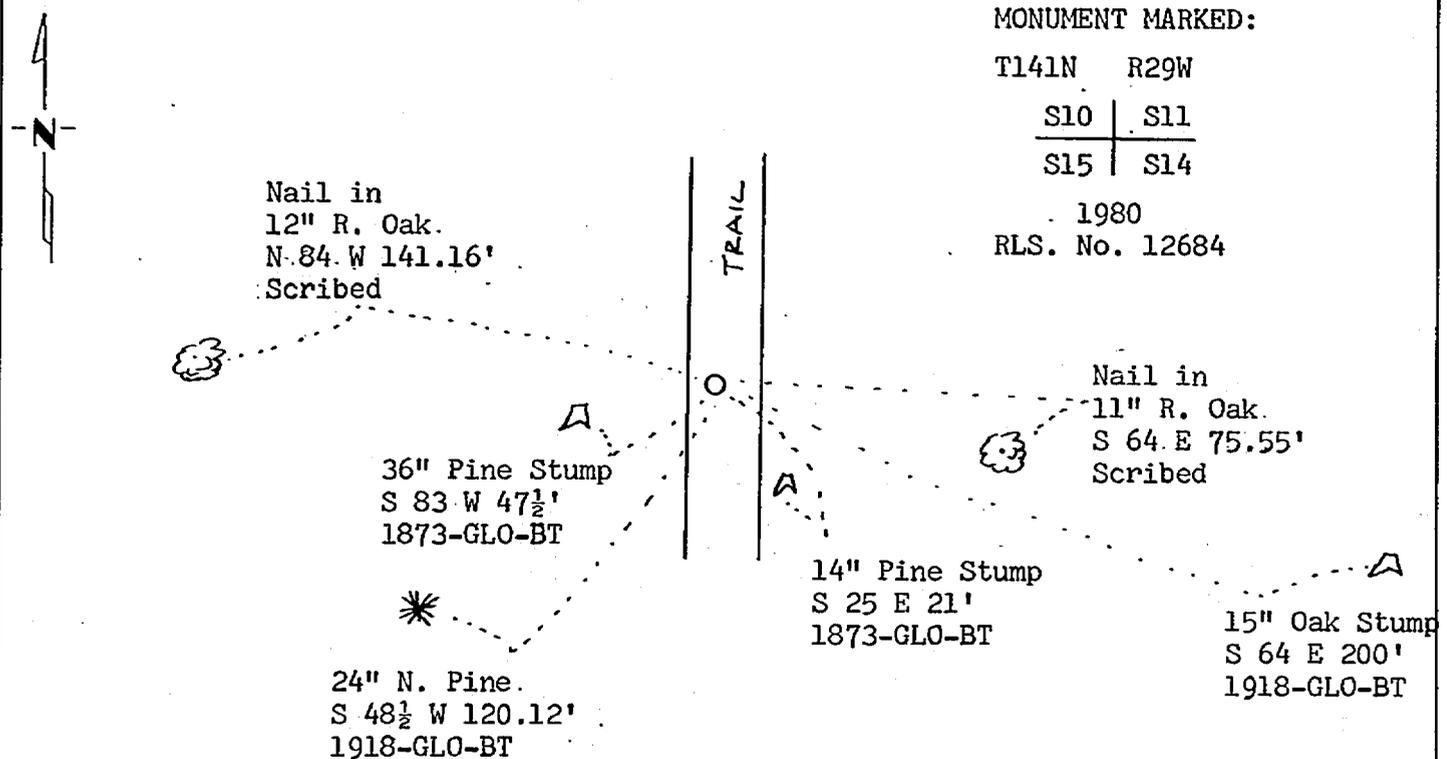

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page.

260993

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Nancy H. Atkinson
SIGNATURE

12-29-81
DATE

Registration No. 12684

- Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER

County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 9:31 A.M. on the 31 day of Dec. A.D., 1981

County Recorder Beneath Hendricks

By M S, Deputy

DOCUMENT NO. 260993

Statement of Evidence:

- 1873 U.S. General Land Office survey set wood post for this corner and marked the following bearing trees: 24" W. Pine N 15 W 30 links, 10" W. Pine S 83 W 72 links.
- 1918 U.S. General Land Office dependent resurvey reestablished this corner from the stumps of the original bearing trees. An iron pipe with a marked brass cap was set to mark the corner. The following bearing trees were marked: 8" W. Oak N 61 E 258 links, 8" W. Oak S 64 E 304 links, 10" N. Pine N 30-30 W 160 links, and 10" N. Pine S 48-30 W 182 links.
- 1969 USFS technician L. Witthoef found the GLO monument bent over and could not read the cap. The stump of one 1873 bearing tree and 2 of the 1918 bearing trees were found.
- 1980 USFS technician W. Olson found the 1" GLO iron pipe in place in west wheel tract of North-South road. The brass cap had been sheered off. Stumps of the 1873 bearing trees were found as follows: 14" x 4' high W. Pine stump S 25 E 21' with scribing plain and remains of pine stump S 83° W 47.5'. The 14" W. Pine stump had been moved approximately 3' from its original location and wired to a tree. It was replaced in its original location and wired to 2 wooden stakes. One of the 1918 bearing trees was found alive and one stump was found as follows: 24" N. Pine S 48½ W 120.12' with blaze grown over and 15" W. Oak stump S 64 E 200.0' with scribe marks plain. The bent pipe was replaced with a 2½" x 24" galvanized iron pipe with a marked 3" brass cap set down 0.8' in trail. Two new bearing trees were marked and are shown on this certificate. In July, I reviewed the evidence of this corner with W. Olson and agreed with his findings and that the new monument marks the perpetuated position of the original corner.
- 1981 County Surveyor's Records in the Recorder's Office were checked and no resurvey information was found on this corner.