

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


EAST QUARTER Corner of Section 26, Township 143, Range 28, 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On 8/24/82 found a 2 1/2" capped galvanized iron pipe as set in 1916
DATE
 by County Surveyor.
- left monument as found, lowered monument, removed monument (explain)
- On _____ placed a _____
DATE

SKETCH OF REFERENCE TIES

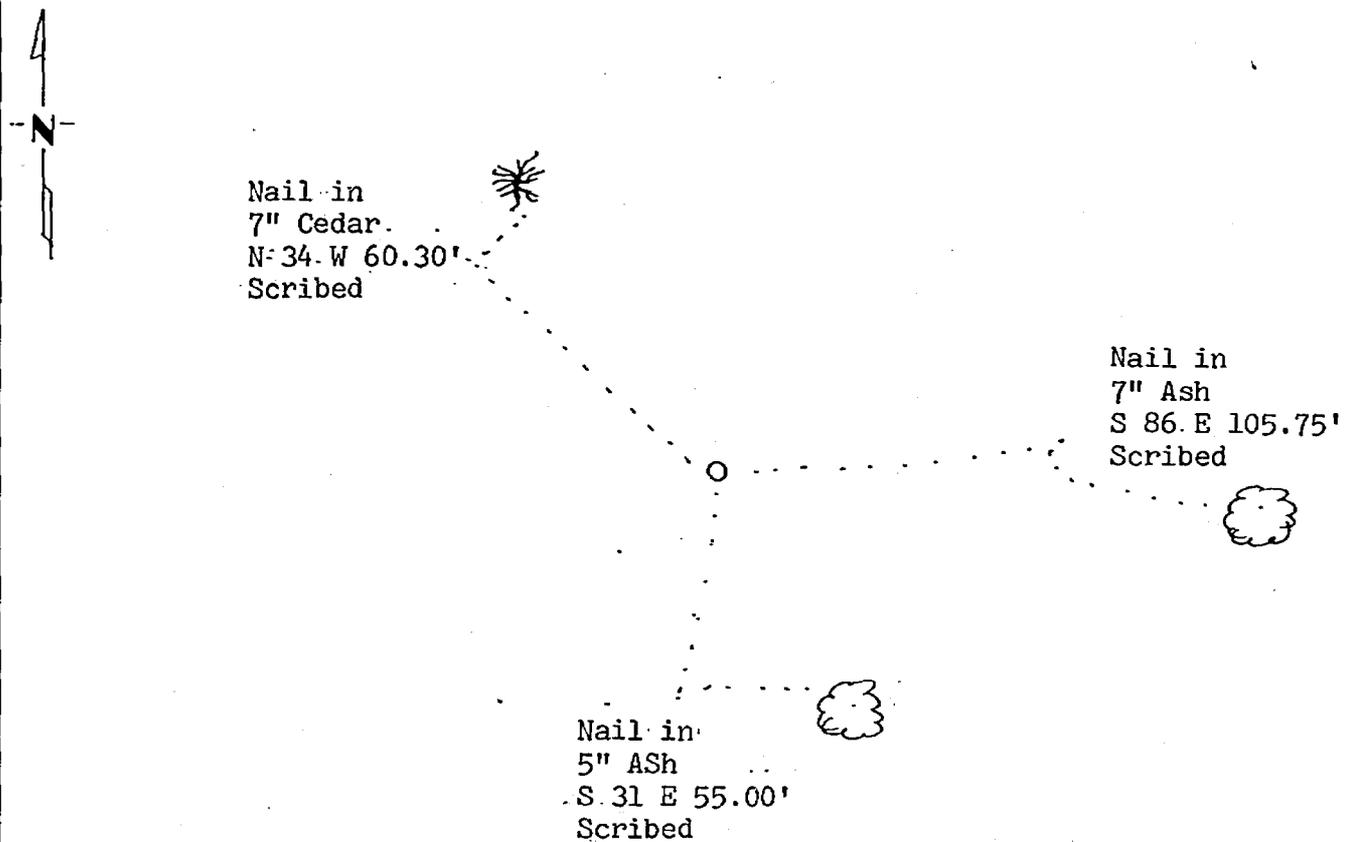

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Sam H. Stevenson 9-13-82
SIGNATURE DATE

Registration No. 12684

- Land Surveyor, Professional Engineer
- County Surveyor, County Engineer

264936
 OFFICE OF THE COUNTY RECORDER

County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 9:45 A. .M. on the 14 day of Sept. A.D., 1982

County Recorder Bendah Herdiche

By MS, Deputy

DOCUMENT NO. 264936

Statement of Evidence:

- 1873 U.S. General Land Office survey set wood post for this corner and marked the following bearing trees: 10" Cedar N 36 W 24 links and 14" Cedar N 80 E 25 links.
- 1916 County Surveyor's Record Book B pages 220 to 242 show survey by Baldwin. The survey notes show old burned post found marking corner. Evidence of GLO bearing trees were found: A 2½" iron pipe with cap was set for the corner.
- 1928 U.S. General Land Office dependent resurvey found the corner marked by a 2½" capped iron pipe up 24". Evidence was found of the original bearing trees as follows: Cedar stump (rotted to ground) N 80 E 19 links and 16" Cedar stump 2' high N 35 W 24 links with some old blaze marks. Pipe was accepted as corner. No new bearing trees were taken.
- 1982 U.S. Forest Service technician C. Krause found the corner monumented with a 2½" capped galvanized iron pipe up 24". The following bearing trees were found: Cedar stub, burned and down, N 35 W 15.8' and rotten remains of Cedar N 80 E 12.5'. Three new bearing trees were marked and are shown on this Certificate. Capped pipe was found to be 48" long and was lowered so that it is 16" above the ground. Placed rocks around the pipe. Corner is approximately 250' west of C.S.A.H. No. 8 and is line with C.S.A.H. No. 4 running east. A 4" x 4" x 7' Cedar post was set 235' east of the corner. Cap was stamped on top with section and township numbers. Steel sign posts were set 3.95' east and 3.95' north of the corner.
- 1982 On Sept. 10 I visited the corner and found items as per the 1982 USFS reports. I accepted the monument as marking the perpetuated position of the original corner based on the bearing tree evidence and the record surveys in 1916 and 1928.