

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


EAST QUARTER Corner of Section 3, Township 142, Range 26, 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 1/30/87 placed a 2" x 48" Galv. iron pipe with 3" marked brass cap.
DATE

SKETCH OF REFERENCE TIES

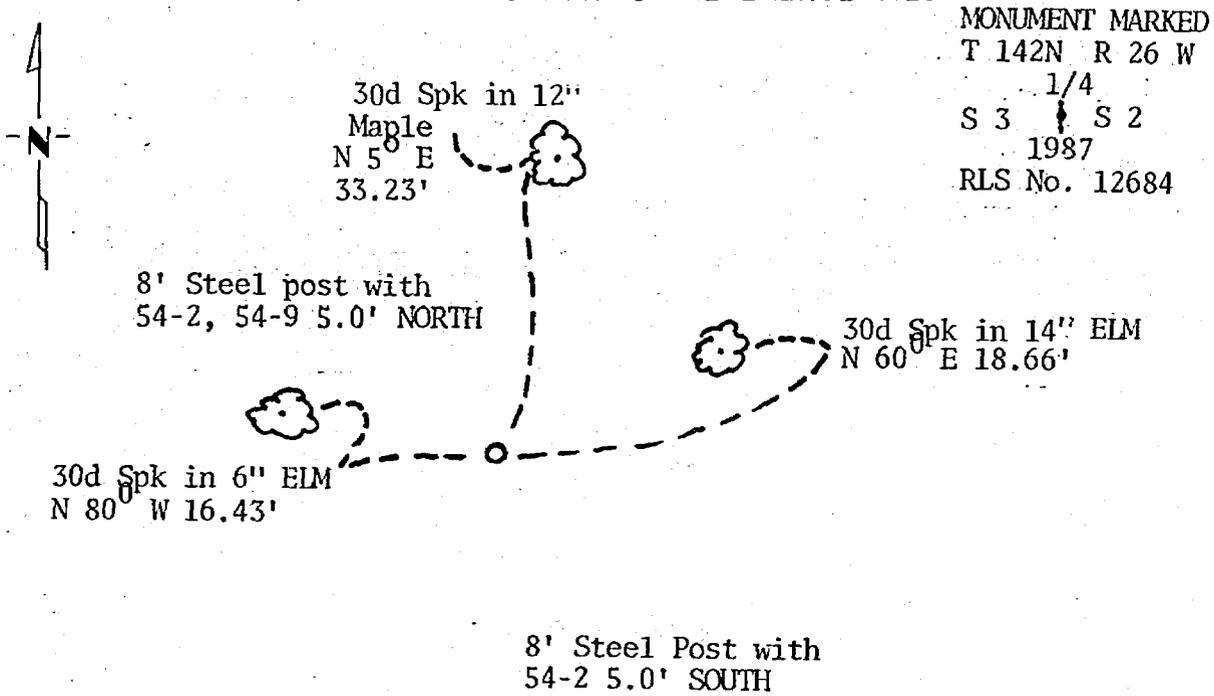

ALL TREES ARE DOUBLE BLAZED, SCRIBED & PAINTED RED WITH 54-3 TAG ATTACHED.

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page.

295276

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Ray H. Stever 2/21/87
SIGNATURE DATE

Registration No. 12684

- Land Surveyor, Professional Engineer
- County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER
County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 2:10 P.M. on the 25 day of February A.D., 1987

County Recorder *Claudia Kayler*
By *ms* Deputy

DOCUMENT NO. 295276

Statement of Evidence:

- 1872 - U.S. General Land Office survey (set wood post) for this corner and marked the following bearing trees: 8" N. Pine N 10⁰ E 5 links and 8" N. Pine S 60⁰ E 10 links.
- 1963 -
1979 - U.S. Forest Service technicians had searched for area and found no evidence of the corner.
- 1986 - County Surveyor's Records in the Recorder's Office were checked and no resurvey information was found on this corner.
- 1986 - We traversed the east line of Sec. 3. After several different computed locations for the SE corner of Sec. 3, we computed several different locations for this corner. All positions were checked for how it fit with meander corner positions to the south. A thorough search for evidence of the corner and bearing trees was conducted. No positive evidence of either was found. It was determined that the corner was lost and was set proportionately between the NE corner of Sec. 3 (found) and the SE corner of Sec. 3 (lost). Corner positions for Meander Numbers 25 and 26 were also determined lost and these positions fit the lake bank of Lower Milton Lake very well. We set a U.S. Forest Service monument 2½" x 48" with a marked brass cap and took ties as shown on this Certificate. Steel sign posts were set 5.0' SOUTH & 5.0' NORTH. See filed Certificate of Survey for distance information.