

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SOUTH 1/16TH LINE


SPECIAL MEANDER Corner of Section 30, Township 142, Range 28, 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On \_\_\_\_\_ found a \_\_\_\_\_  
DATE
- left monument as found,  lowered monument,  removed monument (explain)
- On 4/5/88 placed a 2"x2"x36" steel post with marked aluminum cap on  
DATE  
1/16th line for reference to SMC set in 1928.

## SKETCH OF REFERENCE TIES

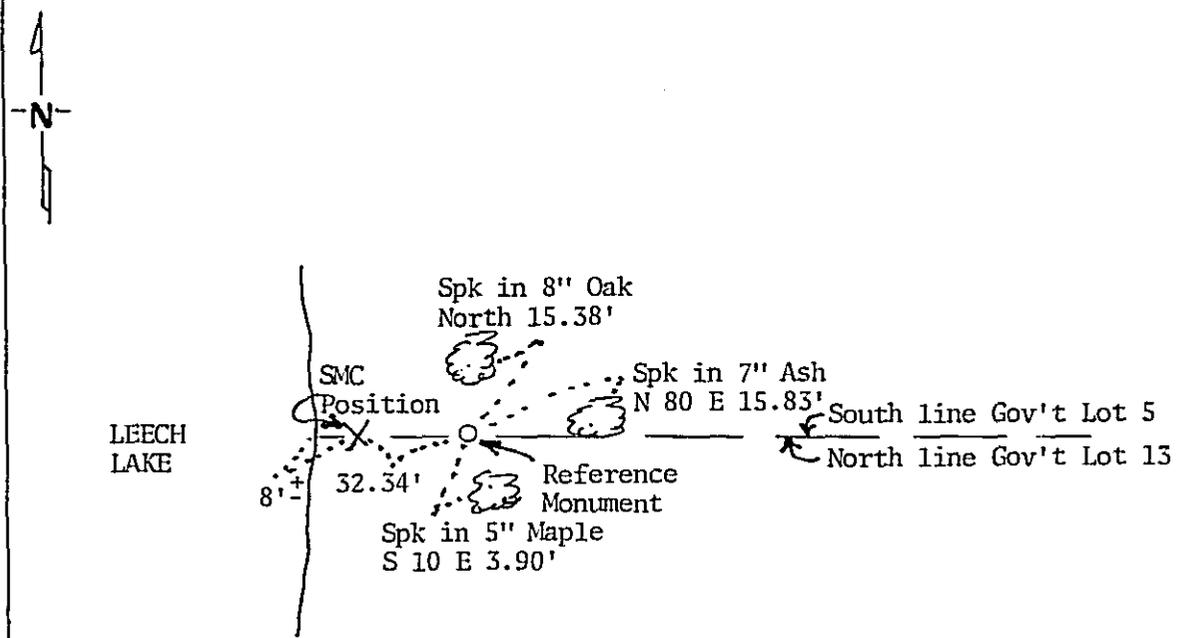

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page. 304198

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Mary H. Stevan 4/16/88  
SIGNATURE DATE

Registration No. 12684

- Land Surveyor,  Professional Engineer
- County Surveyor,  County Engineer

OFFICE OF THE REGISTER OF DEEDS  
County of Cass

I hereby certify that this document was filed in the Reg. of Deeds office at 11:20 A.M. on the 6 day of May A.D., 19 88

Register of Deeds Clara Jane Kayler  
By ms, Deputy

DOCUMENT NO. 304198

Statement of Evidence:

- 1928 U.S. General Land Office dependent resurvey established this corner and an iron pipe with a marked brass cap was set to mark the corner. The following bearing trees were marked: 12" Poplar N 53° E 109 links and 6" Elm S 52° 30' E 61 links.
- 1987 County Surveyor's Records in the Recorder's Office were checked and no resurvey information was found on this corner.
- 1987 U.S. Forest Service office in Cass Lake was contacted for information and no resurvey information was found on this corner.
- 1987 Traversed to the corner area from SW 1/16th corner of Section 30. No evidence of GLO monument was found. Found 14" Elm with scar for 1928 bearing tree. No evidence found of the Poplar. Determined the corner position from the Elm bearing tree using 1928 bearing and distance. Distance and bearing to SW 1/16th corner checked good with 1928 notes. Measured 1128.92 feet compared to 1127.28 feet on 1928 survey. The position for the corner fell near the shore of Leech Lake in an unstable area. Therefore we set a reference monument on the south 1/16th line 32.34 feet east of the 1928 SMC position. The monument is a 2" x 2" x 36" steel post with a marked aluminum cap. New ties were taken to the reference monument as shown on this certificate.