

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

East Quarter _____ Corner of Section 34, Township 141 N, Range 30 W, 5th P.M.

STATE OF MINNESOTA, County of Cass

At the corner location shown on the sketch:

Latitude: $46^{\circ} 59' 13.696''$

Longitude: $94^{\circ} 26' 58.419''$

On _____ found a _____
DATE


left monument as found, lowered monument, removed monument (explain)

On 10/3/88 placed a 5 foot aluminum rod with an aluminum cap.
DATE
Aluminum rod is $3/4''$ in diameter.

Magnetic Decl: 5° East
Not to Scale

SKETCH OF REFERENCE TIES

All distances are horizontal to nail in side of tree.

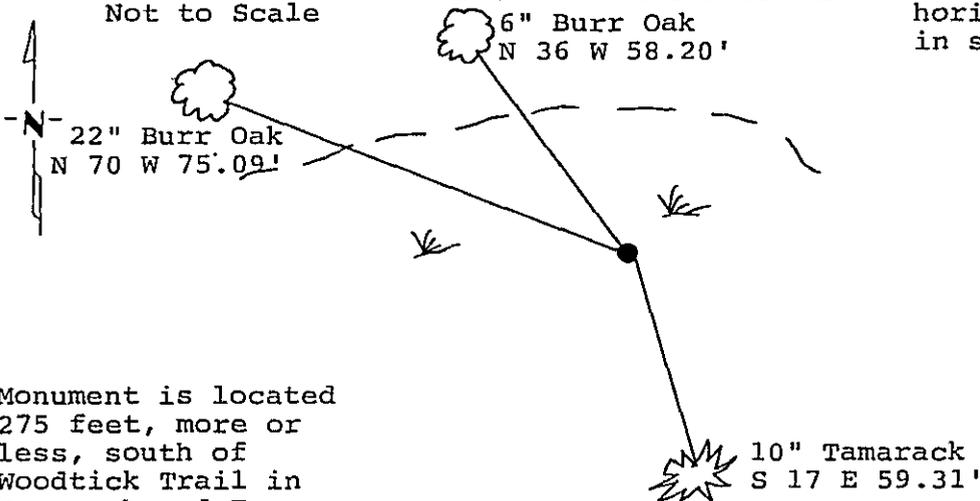

Monument is located 275 feet, more or less, south of Woodtick Trail in Tamarack and Tag Elder Swamp, 55 feet, more or less, south of north edge of swamp.

8' Sign post North 4.0'

8' Sign post East 4.0'

Monument Stamped
T 141 N R 30 W

$\frac{1}{4}$
S34+S35
1988

RLS 17008

All trees are painted with red enamel and marked with a 54-3 (bearing tree) tag.

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this survey, plan or report was prepared by me or under my direct supervision and that I am a duly Registered Land Surveyor under the laws of the State of Minnesota.

David S. Landecker
David S. Landecker

Date 3/31/89 Registration No. 17008

311183
OFFICE OF THE COUNTY RECORDER
County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 1:05 P.M. on the 3rd day of April A.D., 1989

County Recorder Claudine Kaylor
By BJK, Deputy

DOCUMENT NO. 311183

Statement of Evidence:

East Quarter Corner Section 34, Township 141
North, Range 30 West, Cass County, Minnesota

X-17 141-30
Bk.5 Pg.61

1873 P. H. Conger, U.S. Deputy Surveyor, originally established this corner position while subdividing Township 141 North, Range 30 West. The notes indicate a wood post was set to mark the corner position and the following witnesses: a 5 inch Tamarack North 88 degrees East a distance of 22 links; and a 5 inch Tamarack North 60 and 1/2 degrees West a distance of 32 links.

1986 U.S. Forest Service records show the following: chained in search area found several Tamarack stubs. Trees show signs of being chopped into years ago. No evidence found of original bearing trees. Put Forest Service Location Poster on Tamarack South 81 degrees West a distance of 47 feet.

1986 U.S. Forest Service crews set an aerial target in the vicinity of this corner for the search and establishment of the true corner position. The target having coordinate values through the use of GPS on the Chippewa South Boundary Project Cadastral Survey U.S. Project Number 53-6392-8-219. This target allowed for the search and location of this corner.

1988 on August 8 a Landecker-Stevenson & Associates crew searched for the corner. The following information was found and noted: several Tamarack stumps, none fit together. No evidence of blazing or scribing or original wood post.

1988 on October 3 a Landecker-Stevenson & Associates crew set a 5 foot aluminum rod with aluminum cap at the lost, single proportionate position between the Northeast and Southeast corners of Section 34. New bearing trees were marked as shown and two 8 foot steel sign posts set as noted on front of this certificate.