

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

N 1/4 Corner of Section 28, Township 143, Range 25, 5th P.M.


STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On 1990 found a 2 1/2" DIA. ALUM. BLM MONUMENT 1' ABOVE GROUND IN TAM AND CEDAR SWAMP
DATE
- left monument as found, lowered monument, removed monument (explain)
- On _____ placed a _____
DATE

NOT TO SCALE

SKETCH OF REFERENCE TIES

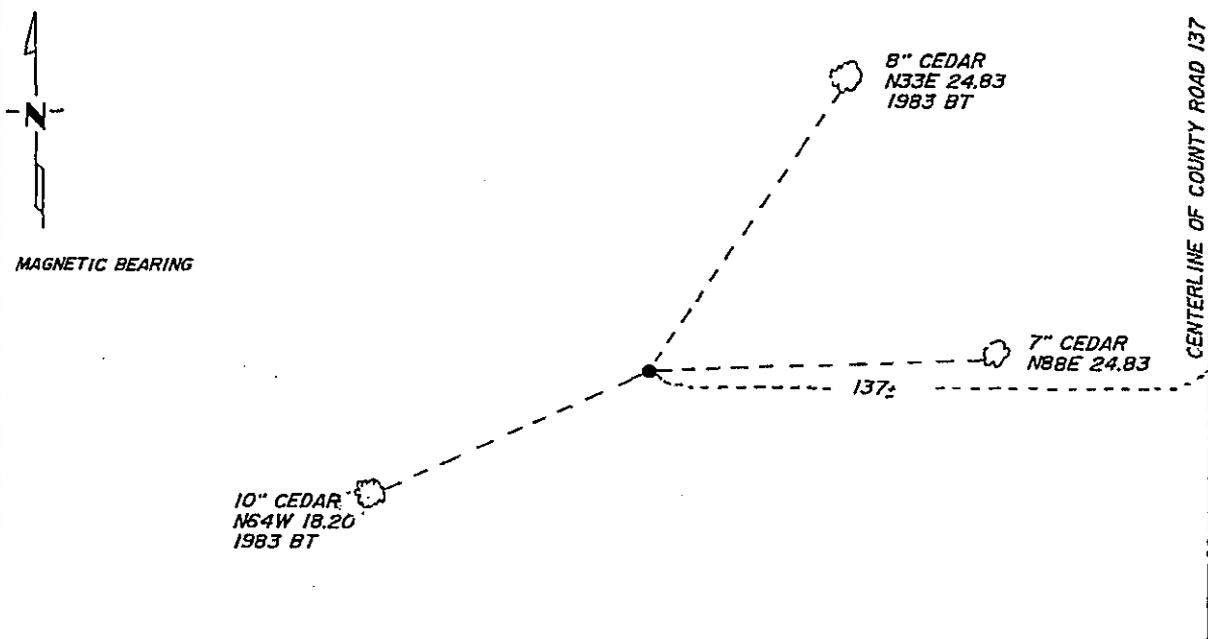

8" STEEL SIGN POST SOUTH 3.0
8' ALUM. SIGN POST EAST 3.85

NOTE: ALL BT'S ARE BLAZED, SCRIBED AND PAINTED WITH RED ENAMEL PAINT WITH BT SIGNS, AND ALL MEASUREMENTS ARE HORIZONTAL TO SPIKE IN SIDE OF TREE

US DEPT. OF INTERIOR
DO NOT DISTURB
T.143N. R.25W.

S21 1/4

S28
CADASTRAL SURVEY
BUR. OF LAND MANAGEMENT

Statement of evidence relative to this corner location is on back of page. 326340

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Walter E. Am 1-22-91
SIGNATURE DATE

Registration No. 11395

- Land Surveyor
- County Surveyor

OFFICE OF THE COUNTY RECORDER
County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 9:25 A.M. on the 25 day of January A.D., 1991

County Recorder Claudia Kayler
By ms, Deputy

DOCUMENT NO. 326340

Statement of Evidence:

R 11 N 1/4 Corner to Sec. 28, T.143N.. R.25W.

1872 Original survey by Hayward and Griffin, set a wood post and marked bt's as follows: 6" Spruce N 8E 101ks.
8" Spruce S42E 51kws

1900 The Corp. of Engineers ran a open-ended stadia traverse to this corner. Their notes state that they found the stumps of the original bearing trees.

1914 F.A. Donner, while making a road survey, found the North Quarter corner of Section 21. He then ran a line south to the area of the North Quarter of Section 28, and made a search for it, but didn't find anything. He then ran south to the North Quarter corner of Section 33, where he found original evidence. He then went back and erroneously set a wood post for the North Quarter corner to Section 28 at the midpoint, and on line between the two recovered Quarter corners. This was not the proper method to restore a lost Quarter corner. Curo book 94, page 42.

1966 USFS personal made a search for this corner and failed to find any evidence. Filed in USFS book 2, page 23.

1976 B.L.M. making a dependent resurvey of part of the township was shown and accepted the wood post set by Donner for the North Quarter to Section 28, and replaced the wood post with a 2-1/2" aluminum pipe with aluminum cap.

1979-1983 B.L.M. was made aware of the 1900 survey by the Corp. and in 1983 they made a corrective dependent resurvey of part of the township, and reset this corner. Their field notes state that they found the stumps of both original bearing trees and set their corner from them.

1989 The USFS used this corner as part of a traverse around section 28.

1989 Walt Curo and Curt Krause, USFS, visited this corner and made a search for the stumps that B.L.M. stated that they found in 1983. We could not find any remains of either stump. In corresponding with B.L.M. they stated that the stump calls were from the Corp. notes, and that they computed a position for this corner, and found a spruce stump with axe marks from which they actually set the corner.

1990 Walt Curo made another search for the original evidence that B.L.M. stated that they found, and failed to find any trace of the spruce stump. I accept the B.L.M. monument for the corner as this position was monumented and accepted by B.L.M. as the true position for this corner and no other evidence remains.