


T. 136 R. 29 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
N 1/4 18 Corner common to sections 7, 18

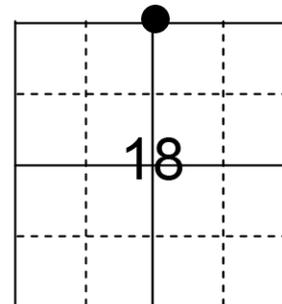

EXISTING SURVEYS

Original Government Survey

Year surveyed 1870  
Original monument Post

Original Evidence Found

Year of search 1916 by Horst  
Monument found \_\_\_\_\_  
Surv Rec #306, Book B, pg. 337

Bearing Trees

Species White Pine Black Pine  
Diameter 28" 7"  
Bearing S 32° W N 59° E  
Distance 103 links 110 links

Original Bearing Trees Found

Species White Pine  
Diameter 18" stump  
Bearing S 33° W  
Distance 67.98'

Subsequent Corner Restoration

Year surveyed 11/1916 By E.B. Horst, LS 376  
Location filed: Survey Record #306, Book B, page 337 and Curo Monument: set a 2 x 48 in. I.M. Curo Book 84, page 9, set I.M. and remark old stump, corner in center of E. to W. graded road, witnesses as follows.

Evidence of Subsequent Corner Restoration

Year of search 1/1917 By E.B. Horst, LS 376  
Location filed: Curo Book 64, pages 75 and 77  
Monument: I.M. sent a man to 1/4 cor. I.M. between secs 7 & 18.

Bearing Trees, Reference Objects

Species W. Pine(GLO) Fence Post  
Diameter 18" high stump  
Bearing S 33 W North  
Distance 67.98' 21.60'

Bearing Trees, Reference Objects

Species \_\_\_\_\_  
Diameter \_\_\_\_\_  
Bearing \_\_\_\_\_  
Distance \_\_\_\_\_

Subsequent Corner Restoration

Year surveyed 3/1917 By E.B. Horst, LS 376  
Location filed: Survey Record #338, Book B, page 503 and Curo Monument: Indicates an iron pipe Curo Book 62, image 214, states at 2645.7 quarter corner between sections 7 and 18.

Evidence of Subsequent Corner Restoration Found

Year of search 9/2019 By CCHD/SO  
Location filed: #2014.003  
Monument: Found 2" ODIP flush, 10'+/-, N. of centerline CSAH #17, on fence lines, N. & S. north and south. Lowered pipe, 1.2' and witnessed as follows. 12" Tamarack, S 68° E, 192.35' duplex nail, up 1.0', S. side 10" White Pine, S 28° E, 85.11' duplex nail, up 1.0', E. side Power Pole, North, 54.60' duplex nail, up 1.0', E. side

7/1940, J.W. Curo, LS 1428  
Curo file 110, worksheet  
Indicates a crook at corner and a distance of 2524.5' W. to NW of section 18 and 2645.7' E. to NE of section 18.

4/2020, CCHD/SO  
#2018.019  
After reconstruction of CSAH #17, set a 1"x 16" alum. Co. mon. over the recovered iron pipe, down 0.05', 10', N. of new centerline of CSAH #17.

3/1951, D. Cole, Cass County Engineer  
Project S.P. 11-509-01  
Indicates corner assumed at PI station 131+16.9, witnesses PI Chinese Elm, NW, 61.6' Nail and disc  
Fence Post, NE, 70.4' Nail and disc

3/2014, CCHD/SO  
#2014.003  
Found 2" ODIP, flush, 10'+/-, N. of centerline CSAH #17, on fence lines, N. and S.

