


T. 138 R. 30 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
N 1/4 25 Corner common to sections 24, 25

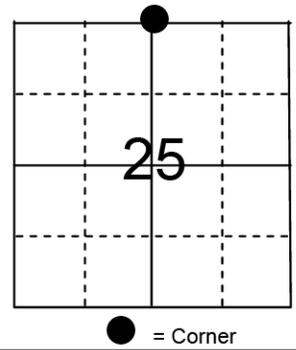

EXISTING SURVEYS

Original Government Survey	Original Evidence Found
Year surveyed <u>1865</u>	Year of search <u>Unkn</u> by <u>Usher</u>
Original monument <u>Post</u>	Monument found _____
	<u>Curo Book 95, pgs 106 and 107</u>

Bearing Trees	
Species	<u>Black Pine</u> <u>Black Pine</u>
Diameter	<u>5"</u> <u>6"</u>
Bearing	<u>N 5 1/2° W</u> <u>S 2° W</u>
Distance	<u>8 links</u> <u>17 links</u>

Original Bearing Trees Found	
Species	<u>Black Pine</u> <u>Black Pine</u>
Diameter	<u>Stump</u> <u>stump</u>
Bearing	<u>N 5 1/2° W</u> <u>S 2° W</u>
Distance	<u>8 links</u> <u>17 links</u>

Subsequent Corner Restoration

Year surveyed 6/1908 By J.W.Curo, RLS 1428  
 Location filed: Pine River Township Road Order #6 and Curo Monument: Set Stake  
Curo Book 95, pages 106 and 107, Cor. in cen of Robideau Rd., Set from BT.s. post formerly set by Usher is 15" too far E. By measuring from heart of trees the B.T. stumps stand right for course. Usher, measured from the outside of the B.Ts.

Evidence of Subsequent Corner Restoration

Year of search 11/1941 By J.W. Curo, LS 1428, Co. Surv.  
 Location filed: Survey Record #584, Book D, page 269 and Curo Monument: 2 x 48" pipe-capped  
Curo Book 420, image 34,  
Indicates pipe and witnesses as follows

Bearing Trees, Reference Objects

Species	_____	_____
Diameter	_____	_____
Bearing	_____	_____
Distance	_____	_____

Bearing Trees, Reference Objects

Species	<u>Jack Pine</u>	<u>Jack Pine</u>
Diameter	<u>8"</u>	<u>10"</u>
Bearing	<u>N 9°20' E</u>	<u>S 45°50' E</u>
Distance	<u>28.60'</u>	<u>50.10'</u>

Subsequent Corner Restoration

Year surveyed 7/1990 By W.E. Curo, LS 11395, Co. Surv.  
 Location filed: Field Book 1, page 58  
 Monument: Found 2.5" capped monument indicates monument 2" above surface at centerline intersection of old roads, set in conc. And bent, we straighten it out and pack dirt up around it so it is flush and witnesses.  
8" Norway Pine, N 85° E, 51.05'  
7" Jack Pine, S 30° E, 38.38'  
4" Jack Pine, N 10° W, 27.74'  
4" Norway Pine, S 80° W, 37.54'

7/2007, C.M. Hidde, LS 44881  
Certificate of Survey for Bristow, #8418  
Indicates a monument found at the corner.

10/2018, CCHD/SO  
#2018.026  
Found 2" ODIP with cap, down 0.1', at edge of driveway clearing and the following witnesses.  
14" Red Pine, N 70° E, 51.05'(1990) 20d nail, up 0.5', N. side  
10" Jack Pine, N 10° W, 27.74'(1990) 20d nail, up 1.4', W. side  
8" Red Pine, S 62° W, 37.54'(1990) 20d nail, up 1.0', S. side


Evidence of Subsequent Corner Restoration Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
 Location filed: \_\_\_\_\_  
 Monument: \_\_\_\_\_

Index No. R 23

CASS COUNTY LAND CORNER RECORD

T. 138 R. 30 M. 5TH Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
N 1/4 25 Corner common to sections 24, 25

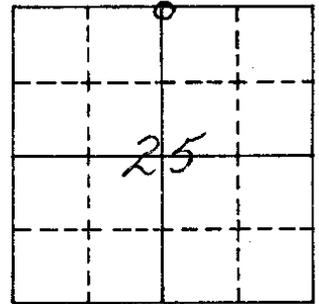

EXISTING SURVEYS

Original Government Survey

Year surveyed 1865  
Original monument POST

Original Evidence Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
Monument found \_\_\_\_\_

Bearing Trees

Species	<u>BL. PINE</u>	<u>BL. PINE</u>	_____
Diameter	<u>5"</u>	<u>6"</u>	_____
Bearing	<u>N 5/4 W</u>	<u>SR W</u>	_____
Distance	<u>8 LKS.</u>	<u>17 LKS</u>	_____

Original Bearing Trees Found

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1941 By JOHN CURD  
Location filed COUNTY BOOK "D" P 269  
Monument FIND 2x4 " CAPED L.P.

Evidence of Subsequent Corner Restoration

Year of search 1990 July By WALT CURD  
FIND 2 1/2" CAPED PIPE BENT OVER, WE  
STRAIGHTEN IT OUT - MARK NEW DOTS

Bearing Trees, Reference Objects

Species	<u>J. PINE</u>	<u>J. PINE</u>	_____
Diameter	<u>8"</u>	<u>10"</u>	_____
Bearing	<u>N 9-20E</u>	<u>S 45-50E</u>	_____
Distance	<u>28.00'</u>	<u>50.10'</u>	_____

Bearing Trees, Reference Objects

<u>ZACK PINE</u>	<u>N. PINE</u>	<u>J. PINE</u>	<u>N. PINE</u>
<u>4"</u>	<u>8"</u>	<u>7"</u>	<u>4"</u>
<u>N 10 W</u>	<u>N 85 E</u>	<u>S 30 E</u>	<u>S 80 W</u>
<u>27.74</u>	<u>51.05</u>	<u>38.38</u>	<u>37.54</u>

Subsequent Corner Restoration

Year surveyed \_\_\_\_\_ By \_\_\_\_\_  
Location filed \_\_\_\_\_  
Monument \_\_\_\_\_

Evidence of Subsequent Corner Restoration Found

Year of search June 1908 By John W. Curd  
Twp rd order indicates corner

Remonumentation certificate prepared \_\_\_\_\_ By \_\_\_\_\_  
Filed at \_\_\_\_\_ Date \_\_\_\_\_