

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SOUTH 1/16th Corner of Section 8 & 9, Township 141, Range 29, 5th P.M.

STATE OF MINNESOTA, County of CASS


At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 6-16-81 placed a 2" x 24" concrete filled galvanized iron pipe with
DATE marked brass cap down 1 foot.

SKETCH OF REFERENCE TIES

Monument Marked:

T141N R29W
S 1/16
S8 | S9
1981.
RLS. No. 12684

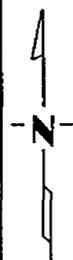

Nail in
6" W. Oak.
S 44. W 87.58'
Scribed



D
O
O
R

Nail in
12" W. Oak.
N 41 E 118.76'
Scribed



Nail in
7" W. Oak.
S 55. E 89.69'
Scribed

G
R
A
V
E
L

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page.

260985

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Mary H. Stevenson
SIGNATURE

12-23-81
DATE

Registration No. 12684

- Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER

County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 9:19 A.M. on the 31 day of Dec A.D., 1981

County Recorder Bessie Hendricks

By M.S., Deputy

DOCUMENT NO. 260985

Statement of Evidence:

- 1918 U.S. General Land Office dependent resurvey established this corner and an iron pipe with a marked brass cap was set to mark the corner. The following bearing trees were marked: 10" Basswood S 46 E 136 links and 8" Maple S 49 W 124 links.
- 1981 County Surveyor's Records in the Recorder's Office were checked and no resurvey information was found on this corner.
- 1981 USFS technician C. Krause searched for this corner and found the GLO iron pipe monument badly bent with brass cap smashed laying along side of the road. No evidence was found of the GLO bearing trees. The original location of the monument location could not be determined.

Under my supervision a traverse was run by C. Krause and the SE corner of Section 8 was reestablished. The position for this corner was then determined midway and on line between the SE corner and East $\frac{1}{4}$ corner of Sec. 8. A distance of 2643.27 feet was measured between these corners which compared well with the 1918 GLO distance of 40.06 chains (2643.96). A 2" x 24" concrete filled galvanized iron pipe with a marked brass cap was set for the corner. The GLO monument in 3 pieces was placed on the north side of the monument. Three new bearing trees were marked and are shown on this certificate. Corner falls 1 foot west of center of north-south road.

