

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTH QUARTER Corner of Section 17, Township 141, Range 28, 5th P.M.

STATE OF MINNESOTA, County of CASS


At the corner location shown on the sketch:

On Jan. 1980 found a GLO brass cap monument as set in 1917 from  
original bearing trees.

left monument as found,  lowered monument,  removed monument (explain)

On \_\_\_\_\_ placed a \_\_\_\_\_  
DATE

### SKETCH OF REFERENCE TIES

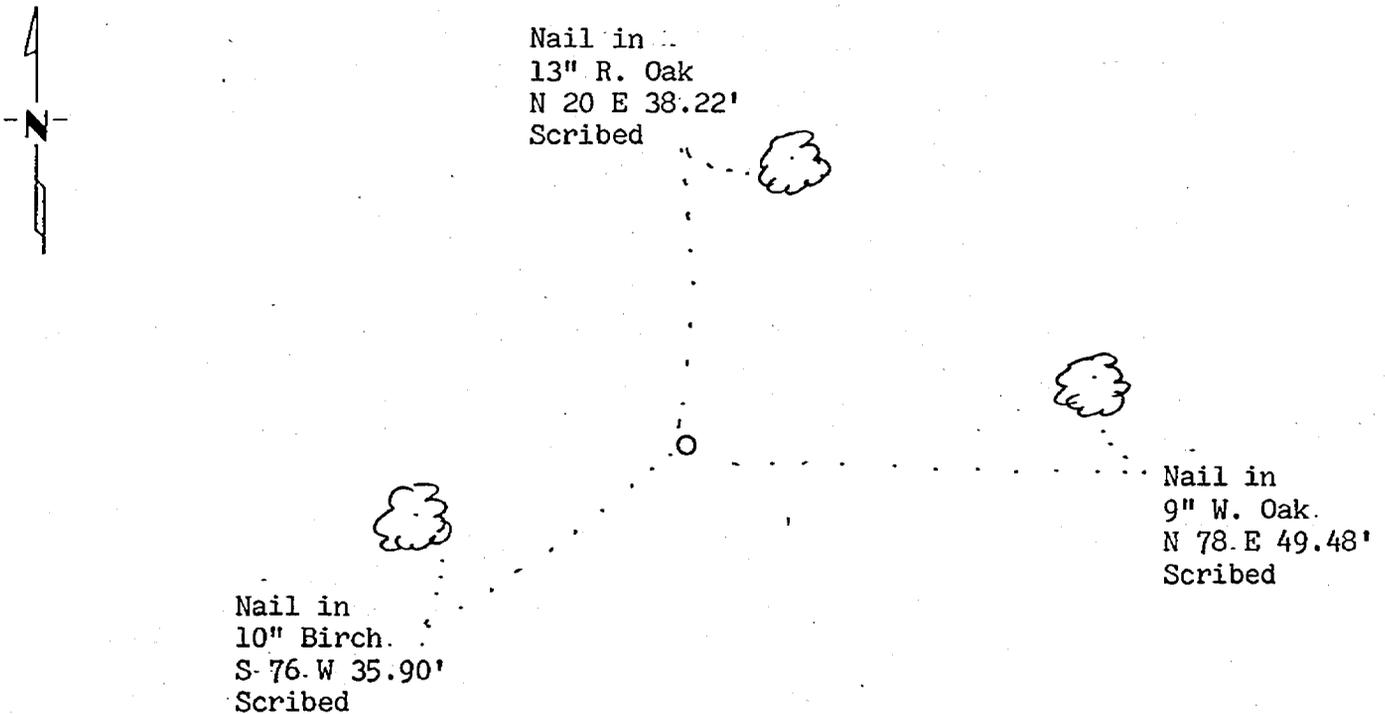

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Mary H. Stevenson 9-15-82  
SIGNATURE DATE

Registration No. 12684

- Land Surveyor,  Professional Engineer
- County Surveyor,  County Engineer

279374  
OFFICE OF THE COUNTY RECORDER  
County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 3:40 P.M. on the 10 day of Dec A.D., 1984

County Recorder Cloudine Kayler

By MS, Deputy

DOCUMENT NO. 279374

Statement of Evidence:

- 1874 U.S. General Land Office survey set wood post for this corner and marked the following bearing trees: 20" N. Pine N 2 E 32 links and 24" N. Pine S 33 E 35 links.
- 1918 U.S. General Land Office dependent resurvey found the corner marked by wood stake and witnessed by original bearing trees: Burned Pine stump N 2 E 37 links and Burned Pine stump S 33 E 40 links. An iron pipe with a marked brass cap was set to mark the corner. The following bearing trees were marked: 8" J. Pine S 11 3/4 E 460 links and SE Corner House N 30 1/4 E about 10 chains.
- 1971 U.S. Forest Service records show the following: J. Ekstrom found no evidence of corner. Local resident says that corner was destroyed years ago.
- 1980 U.S. Forest Service technician W. Olson found the corner monumented with a GLO brass cap monument down 1 1/2' under old trail. The following bearing trees were found: 20" J. Pine stump at record bearing and distance with scribe marks plain. Three new trees were marked and are shown on this certificate. Steel sign posts were set north and west of the corner.
- 1982 County Surveyor's Records in the Recorder's Office were checked and no resurvey information was found on the corner.
- 1982 On Sept. 15 I visited the corner and found items as per the 1980 USFS reports. GLO brass cap is down 1.3' and also found remains of original pine stump N 2 E 24.4'. Accepted monument as marking the perpetuated position of the original corner.