

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


MEANDER NO. 7 Corner of Section 22 & 27, Township 139, Range 29, 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On 6-17-87 found a Tamarack snag with upper & lower blazes and
DATE
accepted it as GLO hearing tree
 left monument as found, lowered monument, removed monument (explain)
- On 7-8-87 placed a 2" x 2" x 36" steel post with aluminum cap using
DATE
GLO bearing and distance

SKETCH OF REFERENCE TIES

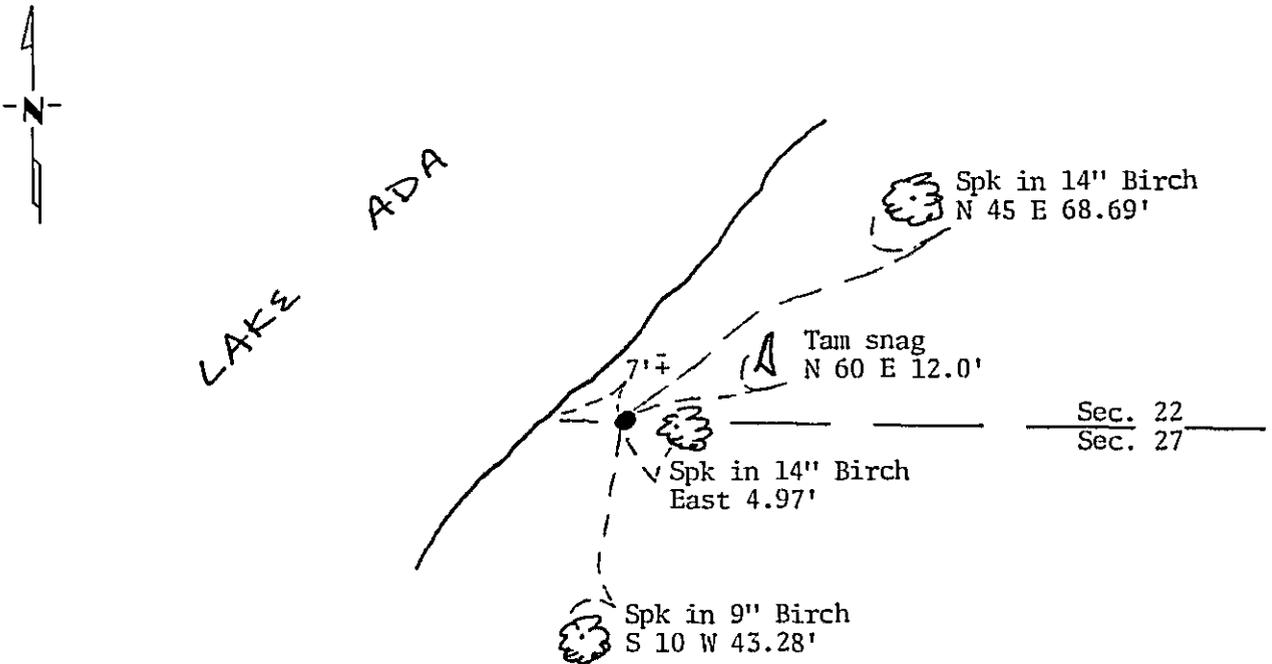

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page. 300482

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Maup H. Atkinson 7/11/87
SIGNATURE DATE

Registration No. 12684
 Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER
County of Pearl

I hereby certify that this document was filed in the Co. Recorders office at 3:50 P.M. on the 20 day of Oct. A.D., 1987

County Recorder Claudine K. Taylor
By AS, Deputy

DOCUMENT NO. 300482

Statement of Evidence:

- 1865 U.S. General Land Office survey set wood post for this corner and marked the following bearing trees: 4" Tamarack N 59 E 18 links and 6" Tamarack S 3 W 13 links.
- 1920 County Surveyor's Record Book C pages 348 show survey by E.B. Horst. Survey shows corner used to set NE corner Sec. 27, but no information given.
- 1972 RCM, Inc. did survey in Sec. 22, but give no information on this corner.
- 1973 R.F. Schneider did survey in Sec. 22, but gives no information on this corner.
- 1987 Ran traverse around Sec. 22 and computed search area for this corner. Area of this corner is on narrow sand ridge. Found very old tamarack snag with bottom blaze and partial upper blaze. Snag is leaning east, probably a result of ice action. Blazes face southwesterly and I accepted the snag as being the NE GLO BT. Determine the position for the base of the snag and set corner position from base using bearing and distance. This position checks very close to being midway between the north line of Sec. 22 and the south line of Sec. 27. Set a County monument for the corner and found remains of old stump mound at correct bearing and distance for GLO BT to the south. Set steel sign post 1 foot East of monument. I searched through field books in County Surveyor's Office, but found no record of this corner. I did find where John Curo had started running line to this corner from the east in 1918, but could not find anything showing he completed survey or found corner. Horst's notes show he tied into Curo's random line in 1920 and gives distance to MC. This indicates that Curo had completed the survey, but I was unable to find the information.