

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Number 21 Meander Corner of Sections 28/33, Township 141 N, Range 29 W, 5th P.M.


STATE OF MINNESOTA, County of Cass

At the corner location shown on the sketch: Latitude: 46° 59' 35.966"
 Longitude: 94° 21' 51.225"

- On _____ found a _____
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 3/30/89 placed a 2 inch by 48 inch iron pipe with brass cap
DATE and plastic base with magnet.

Magnetic Decl: 5° East SKETCH OF REFERENCE TIES
 Not to Scale

All distances are horizontal to nail in side of tree.

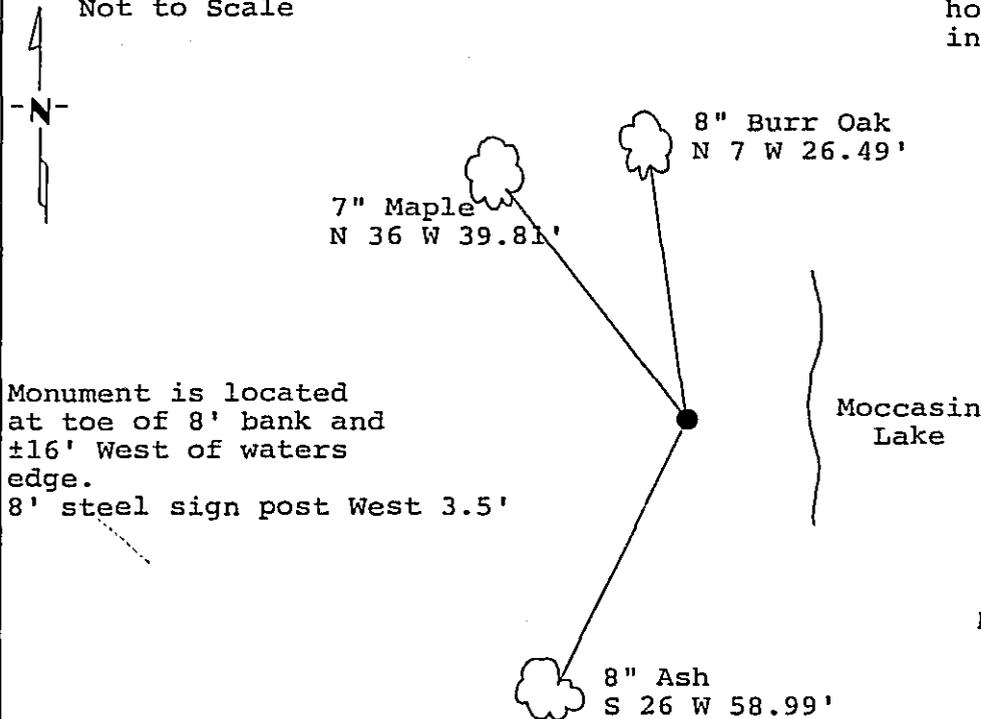

Monument is located at toe of 8' bank and ±16' West of waters edge.
 8' steel sign post West 3.5'

Monument Stamped
 T 141 N R 29 W
S 28
S 33 MC
 1989
 RLS 17008

All trees are painted with red enamel and marked with a 54-3 (bearing tree) tag.

Statement of evidence relative to this corner location is on back of page. 312151

I hereby certify that this survey, plan or report was prepared by me or under my direct supervision and that I am a duly Registered Land Surveyor under the laws of the State of Minnesota.

David S. Landecker
 David S. Landecker
 Date 5-12-89 Registration No. 17008

OFFICE OF THE COUNTY RECORDER
 County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 4:01 P. M. on the 15 day of May A.D., 1989
 County Recorder Claudine Kayler
 By ms, Deputy
 DOCUMENT NO. 312151

Statement of Evidence:

Meander Corner Number 21, Sections 28 and 33,
Township 141 North, Range 29 West, Cass County,
Minnesota

V9-10 141-29
Bk.4 Pg.63

1873 P. H. Conger, U.S. Deputy Surveyor, originally established this corner position while subdividing Township 141 North, Range 29 West. The notes indicate a wood post was set to mark the corner position and the following witnesses: a 4 inch Oak South 74 degrees West a distance of 34 links; and a 7 inch Oak North 87 degrees West a distance of 24 links.

1988 on July 7 a Landecker-Stevenson & Associates crew searched for the corner. The following information was found and noted: position falls 5 feet, more or less, West of high lake bank; 2 large Oak stubs to North, no blazes; no evidence of original post or accessories. Corner determined lost.

1989 on March 30 a Landecker-Stevenson & Associates crew set a 2 inch by 48 inch iron pipe with brass cap and plastic base with magnet. This position was determined lost and reestablished by honoring the original survey plat and notes record angle and distance as measured from the Southwest corner of said Section 28 in relation to the common line between Sections 32 and 33 said township. New bearing trees were marked as shown and a steel sign post set as noted on front of this certificate.