

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Standard

South Quarter Corner of Section 36, Township 141 N, Range 28 W, 5th P.M.

STATE OF MINNESOTA, County of Cass

At the corner location shown on the sketch: Latitude: 46° 58' 39.470"
 Longitude: 94° 09' 56.287"


On _____ found a _____
DATE

left monument as found, lowered monument, removed monument (explain)

On 5/4/89 placed a 2 inch by 24 inch iron pipe with brass cap
DATE

Magnetic Decl: 5° East SKETCH OF REFERENCE TIES
 Not to Scale

All distances are horizontal to nail in side of tree.

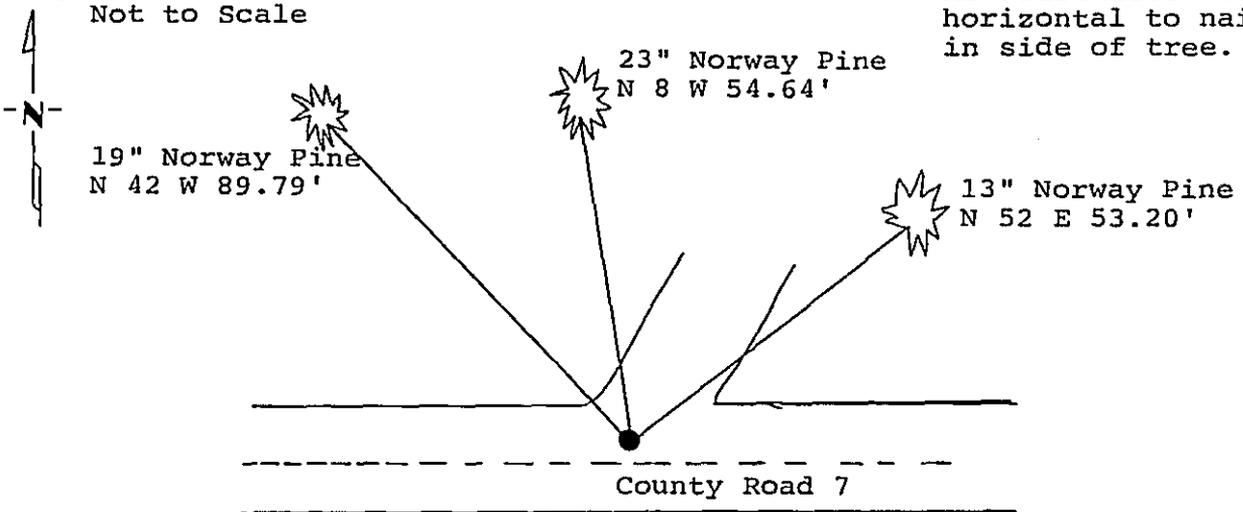

Monument is located in bituminous 8.5'± Northerly of center line of County Road Number 7 Driveway northerly.

Monument Stamped
 R28W
 SC
 S 1/4 S 36 T141N
 T140N
 1989
 RLS 17008

1" Below road surface with bituminous patch cover.

Bearing Trees are in yard, spike and tag set only.

Statement of evidence relative to this corner location is on back of page.

312362

I hereby certify that this survey, plan or report was prepared by me or under my direct supervision and that I am a duly Registered Land Surveyor under the laws of the State of Minnesota.

David S. Landecker
 David S. Landecker
 Date 5-24-89 Registration No. 17008

OFFICE OF THE COUNTY RECORDER
 County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 10:10 A.M. on the 25 day of May A.D., 1989
 County Recorder Claudia Kayler
 By MS Deputy
 DOCUMENT NO. 312362

Statement of Evidence:

Standard South Quarter Corner Section 36, Township
141 North, Range 28 West, Cass County, Minnesota

Z-23 141-28
Bk.7 Pg.13

1863 Johnson and Thornton, U.S. Deputy Surveyors, originally established this corner position while running the 10th Standard Parallel. The notes indicate a wood post was set to mark the corner position and the following witnesses: an 8 inch White Birch North 60 degrees West a distance of 27 links; and a 12 inch Aspen North 40 degrees East a distance of 50 links.

1912 County Survey Record Book B pages 265-269 shows survey by John Curo and Harry S. Todd, whereby Todd reestablished the section corners and monumented same along the 10th Standard Parallel for the entire South line of this township. These corner positions were determined proportionally between the Southeast and Southwest township corners.

1917 J.H. Flynn, Deputy County Surveyor, County Survey Record 367, Book B page 592-593 shows Flynn measuring same distances as reported by Todd. Finding the Southeast corner of Section 35 monumented and that he monumented the Southwest corner of Section 34 this township.

1918 the U.S. General Land Office resurveyed portions of this township and in the process did not recover this corner. They used the Southwest and Southeast corners of the township to proportion along the South line of the township.

1920's John Curo performed numerous surveys along the South line of this township in which he also proportioned in the Section and Quarter corners as noted by Todd. The Curo and Todd surveys differed slightly in overall dimensions. However, their theory and principles were the same.

1982 Walt Curo, RLS Number 11395, surveys in Section 36. He set and certifies to a point on the North-South Quarter line and the IRB. No other information on this corner was received.

1986 U.S. Forest Service crews set an aerial target in the vicinity of this corner for the search and establishment of the true corner position. The target having coordinate values through the use of GPS on the Chippewa South Boundary Project Cadastral Survey U.S. Project Number 53-6392-8-219. This target allowed for the search and location of this corner.

1988 on October 14 a Landecker-Stevenson & Associates crew visited the corner and found the following evidence: iron pipe in road, of unknown origin, no evidence of bearing trees. Corner position determined lost.

1989 on May 4 a Landecker-Stevenson & Associates crew set a 2 inch by 24 inch iron pipe with brass cap at the lost, single proportion position between the monumented South Quarter corner of Section 34 and the monumented Southeast corner of Section 36 of said township along the arc of the 10th Standard Parallel. New bearing trees were marked as shown on front of this certificate. It was determined that this position resembles the single proportionate position on the standard parallel as determined by previous

surveys from Curo, Todd and Flynn noted above.