


T. 140 R. 25 M. 5th Coordinates: X _____ Y _____
N 1/4 14 Corner common to sections 11, 14

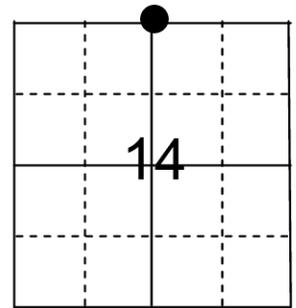

EXISTING SURVEYS

Original Government Survey

Year surveyed 1867
Original monument Post

Original Evidence Found

Year of search 1920 by Horst
Monument found stake fallen
Surv Rec. #481, Book A, pg 533

Bearing Trees

Species	<u>Fir</u>	<u>White Pine</u>
Diameter	<u>4"</u>	<u>5"</u>
Bearing	<u>N 44° W</u>	<u>S 76 3/4° W</u>
Distance	<u>20 links</u>	<u>21 links</u>

Original Bearing Trees Found

Species	<u>White Pine</u>	<u>Aspen</u>
Diameter	<u>Stump</u>	<u>Stump</u>
Bearing	<u>S 88° E</u>	<u>N 81 1/2° W</u>
Distance	<u>37 links</u>	<u>10 links</u>

Subsequent Corner Restoration

Year surveyed 12/1915 By E.B. Horst, LS 376, Dep Co.
Location filed: Survey Record #482, Book C, page 535 and Curo Monument:
Curo Book 68, page 2, states go W. to 1/4 cor. bet. Sec. 11-14 where I find W. Pine B.T. still standing. I take new B.T.s as follows.

Bearing Trees, Reference Objects

Species	<u>Fir</u>	<u>Balsam</u>
Diameter		<u>5"</u>
Bearing	<u>N 5° E</u>	<u>S 32°30' E</u>
Distance	<u>33.5'</u>	<u>6.6'</u>

Evidence of Subsequent Corner Restoration

Year of search _____ By _____
Location filed:
Monument:

Bearing Trees, Reference Objects

Species	_____	_____
Diameter	_____	_____
Bearing	_____	_____
Distance	_____	_____

Subsequent Corner Restoration

Year surveyed 4/2004 By CCHD/SO
Location filed: #2004.011
Monument: Set 7/8" ODIP down 0.3' at the PI of Mejdrich Road to N. and E., witnessed. 11" Balsam, N 77° E, 97.91' duplex nail, up 1.0', N. side 12" Tamarack, S 34° E, 83.51' duplex nail, up 1.0', W. side 8" Maple, S 77° W, 51.72' duplex nail, up 1.0', N. side

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
Location filed:
Monument:

