

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


North Quarter Corner of Section 34, Township 142, Range 27, 5th P.M.

STATE OF MINNESOTA, County of Cass

At the corner location shown on the sketch:

- On \_\_\_\_\_ found a \_\_\_\_\_  
DATE
- left monument as found,  lowered monument,  removed monument (explain)
- On 10/16/81 placed a cast iron monument at the lost position 5"  
DATE  
below road surface.

### SKETCH OF REFERENCE TIES

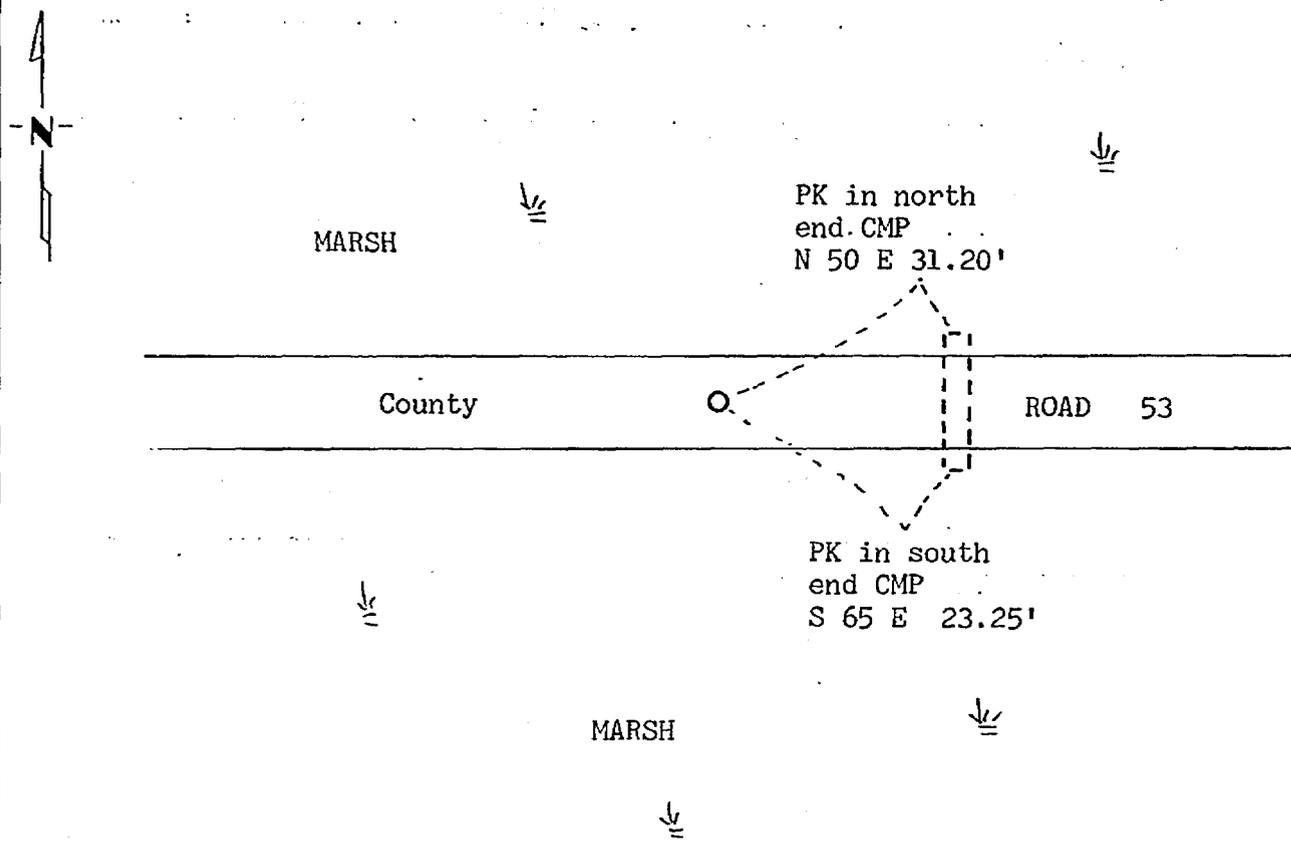

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page.

260591

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Mary A. Stevenson 12-2-81  
SIGNATURE DATE

Registration No. 12684

- Land Surveyor,  Professional Engineer
- County Surveyor,  County Engineer

### OFFICE OF THE COUNTY RECORDER

County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 10:35 A.M. on the 3 day of Dec. A.D., 1981

County Recorder Burlak Hendrick  
By MS, Deputy

DOCUMENT NO. 260591

Statement of Evidence:

- 1873 U.S. General Land Office survey set wood post for this corner. The notes show corner in a swamp and no bearing trees were marked.
- 1922 County Surveyor's Record Book D pages 108 & 109 show survey by E.B. Horst. The survey was for the location of a road on the section line. The survey calls for this corner, but nothing is given as to type of monument found or if the corner was set. Ties are given: 7" Tam S44° W 32 ft. and 5" Spruce N 28° W 42 ft. A distance of 2594.0 ft. is given to the NE corner of Sec. 34.
- 1980 U.S. Forest Service office in Cass Lake was contacted for information and no resurvey information was found on this corner.
- 1980 Walter Curo, RLS, was contacted to see if he had any information on this corner or the notes from the 1922 survey by Horst. He had no information concerning this corner.
- 1981 After the reestablishment of the NW and NE corners of Sec. 34 we found the distance between them to be 5197.62 feet. The split would be 2598.81 feet. This distance agreed reasonably well with the distance given by Horst. A straight line between the section corners also fit the approximate center line of the east-west road. We were unable to find any positive evidence of the tie trees taken by Horst. Evidence of some small stumps were found, but could not be positively identified as Horst's ties.

From analysis of the information, I believe that Horst set this corner by lost method. The survey shows finding the NE corner of Sec. 34. Although he does not mention the NW corner, this corner was remonumented by the GLO in 1919. Therefor, I feel it is very likely that he also had found this corner. I feel this is supported by the fact that his distance is close to our split and that the straight line fits the approximate center of the road. Therefor, I set a county cast iron monument at the lost position between the two section corners.