

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTHEAST Corner of Section 4, Township 133 N., Range 32 W., 5th P.M.

STATE OF MINNESOTA, County of CASS


At the corner location shown on the sketch:

On 8/29/89 found a 1/2" IRON REBAR
DATE

left monument as found, lowered monument, removed monument (explain)

On _____ placed a _____
DATE

SKETCH OF REFERENCE TIES

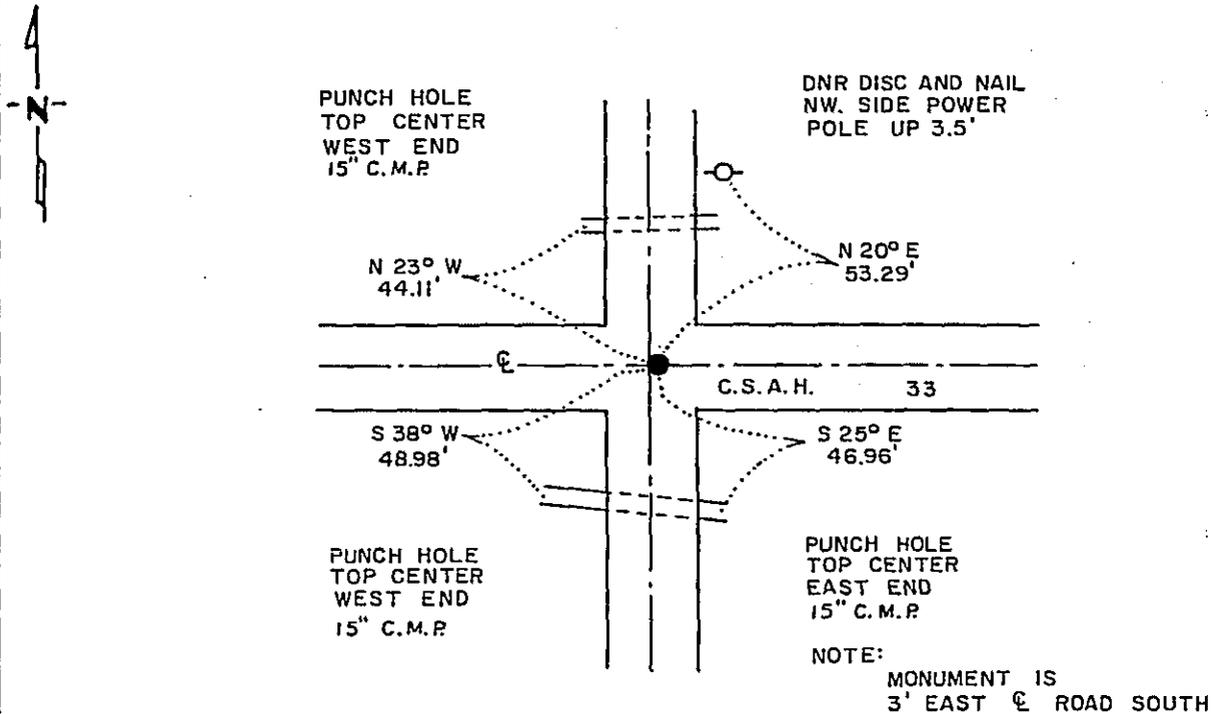

BEARINGS OBSERVED WITH COMPASS

Statement of evidence relative to this corner location is on back of page.

DDS 10-27-89
FILE: A-49196

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

John D. Walker 12-28-90
SIGNATURE DATE

Registration No. 16098

- Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER

County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 3:40 P. .M. on the 2 day of January A.D., 19 91

County Recorder Claudia Kayler
 By ms Deputy

DOCUMENT NO. 325960

Northeast Corner Section 4, Township 133 North, Range 32 West, 5th P.M.

The following offices were contacted for information on this corner:

Secretary of State
Wadena County Highway Department
Cass County Surveyor
Cass County Highway Department
Landecker and Associates, Inc., Pequot Lakes, MN
Roy A. Smith and Associates, Inc., Detroit Lakes, MN
Comstock and Davis, Little Falls, MN
Richard Howe, Alexandria, MN

1858 This corner was established by the U.S. General Land Office and monumented with a post and witnessed by the following bearing trees:

14" Sp. Pine, South 42° East, 42 links
8" Sp. Pine, South 66° West, 1.32 chains
18" Y. Pine, North 15° East, 1.51 chains
18" Y. Pine, North 52° West, 3.39 chains

No resurvey information was found.

1988 In August, the DNR Bureau of Engineering found a 1/2" rebar in centerline of east-west Cass County road 33, 3 feet east of centerline of a gravel road south, and 13 feet west of edge of woods north. From said rebar it is 2722.77 feet to the quarter corner north and 2622.23 feet to the quarter corner west.

The DNR Bureau of Engineering accepted the rebar as the section corner.

Traverse information is available from the DNR Bureau of Engineering.