

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTHEAST Corner of Section 35, Township 141N, Range 29W, 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch: Latitude: 46° 59' 42.355"
Longitude: 94° 18' 13.516"


On 5-25-88 found a 2" Iron Monument with brass cap (USFS)
DATE

left monument as found, lowered monument, removed monument (explain)

On _____ placed a _____
DATE

Magnetic Decl: 5° East SKETCH OF REFERENCE TIES
Not to Scale

All distances are horizontal to nail in side of tree.

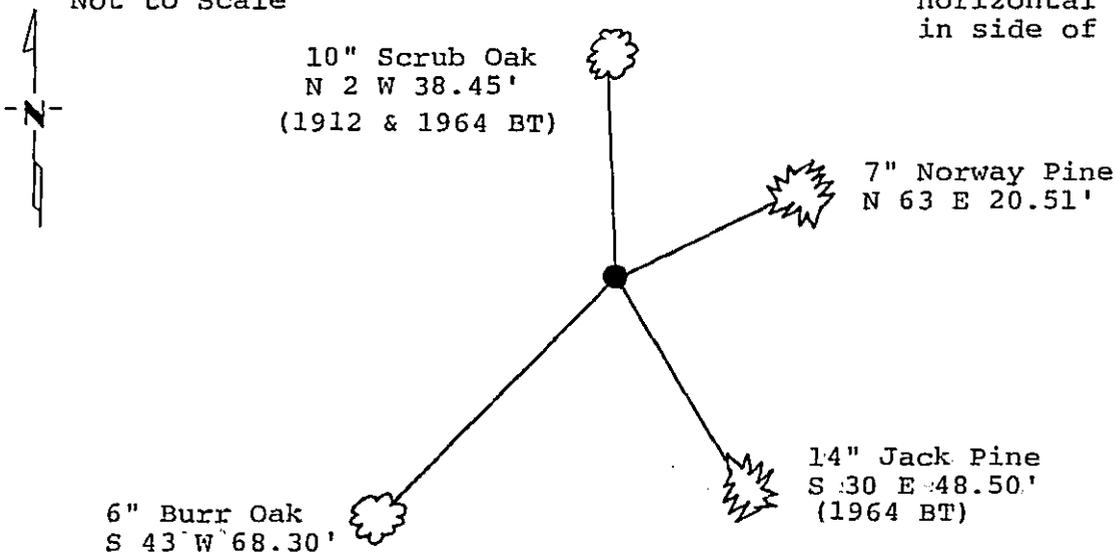

Monument is located approx.
60' northwesterly of swamp,
plantation westerly
8' signpost south 2.56'
6' signpost east 5.3'

All trees are painted with red enamel and marked with a 54-3 (bearing tree) tag.

Monument Stamped

T141N R29W

S 26 S 25

S 35 S 36

1964
RLS No. 6807

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this survey, plan or report was prepared by me or under my direct supervision and that I am a duly Registered Land Surveyor under the laws of the State of Minnesota.

David S. Landecker
David S. Landecker
Date 3/31/89 Registration No. 17008

311174
OFFICE OF THE COUNTY RECORDER
County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 12:20 P.M. on the 3rd day of April A.D., 1989

County Recorder Claudine Kaylor
By Dgk, Deputy

DOCUMENT NO. 311174

Statement of Evidence:

Northeast Corner Section 35, Township 141 North,
Range 29 West, Cass County, Minnesota

V-21 141-29
Bk.4 Pg.25

1873 P. H. Conger, U.S. Deputy Surveyor, originally established this corner position while subdividing Township 141 North, Range 29 West. The notes indicate a wood post was set to mark the corner position and the following witnesses: a 20 inch Norway Pine North 50 degrees East a distance of 8 links; an 18 inch Norway Pine South 10 degrees East a distance of 10 links; and a 12 inch White Pine North 30 degrees West a distance of 33 links.

1912 County Surveyor's Record Book A pages 538-539 show survey by John Curo. He found the stumps of the Northeast and Southeast original bearing trees and set a 2 inch by 4 inch by 16 inch stake and marked the following bearing trees: a 3 inch Oak North 1 degree East a distance of 38.20 feet; a 3 inch Jack Pine North 2 degrees East a distance of 114.80 feet; a 30 inch White Pine stump North 48 degrees East a distance of 32.90 feet; a 5 inch Norway Pine South 63 degrees 45 minutes West a distance of 203.75 feet; and a 24 inch Pine stump North 84 degrees 30 minutes West a distance of 65.66 feet.

1918 U.S. General Land Office dependant resurvey found the corner marked by 3 original bearing tree stumps. Set a 3 inch wood stake 30 inches above ground to mark the corner.

1964 U.S. Forest Service records show the following: technician James Ekstrom found the corner monumented with remains of wood post and rotted stumps of two original bearing trees. The following 1912 bearing trees were found: a 10 inch Oak North 2 degrees West a distance of 38.5 feet; a Jack Pine snag North 2 degrees East a distance of 114.8 feet; a White Pine stump North 48 degrees East a distance of 32.8 feet; and a Pine stump North 84 degrees West a distance of 65.66 feet. He set a 2 inch by 5 foot iron pipe with brass cap. New bearing trees were marked as follows: a 10 inch Red Oak North 2 degrees West a distance of 38.5 feet; a 13 inch Jack Pine North 79 degrees East a distance of 92.5 feet; a 13 inch Jack Pine South 30 degrees East a distance of 43.6 feet; and a 7 inch Norway Pine South 8 degrees West a distance of 85.8 feet.

1968 U.S. Forest Service Surveyor Bill Okerman, Licensed Land Surveyor Number 6807, filed corner certificate on June 28, with the Cass County Recorder as certificate Number 485, using 1964 information.

1986 U.S. Forest Service crews set an aerial target over this corner position for determination of coordinate values through the use of GPS on the Chippewa South Boundary Project Cadastral Survey U.S. Project Number 53-6392-8-219. This target allowed for the search and location of this corner.

1988 on May 25 a Landecker-Stevenson & Associates crew visited the corner and found the following evidence: a 2 inch brass cap monument in good condition, 1912 and 1964 Oak bearing tree North 2 degrees West and 1964 Jack Pine bearing tree Southeast as shown on front of this certificate and stubs of the 1964 Pine bearing trees South 8 degrees West and North 79 degrees East. Two new bearing trees were marked as shown and steel sign posts in place as noted on front of this certificate.