

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 6

Township 145 N, Range 27 W, 5th P.M.

STATE OF MINNESOTA, COUNTY OF CASS.

A000581289
OFFICE OF COUNTY RECORDER
CASS COUNTY MINNESOTA
CERTIFIED, FILED, AND/OR
RECORDED ON
06/12/2012 11:25:27 AM
AS DOC #: A000581289
PAGES: 2 REC FEES: 0.00
KATHRYN M. NORBY
COUNTY RECORDER

037285
 Tx: 4026798

On 1-24-2011, found a(n): brass capped monument
 in good condition.


- left monument as found
- removed monument (explain)
- lowered monument
- raised monument

On _____, set a(n): _____

(reserved for recording data)

See "Statement of Evidence" for further details (on back)

GPS I.D.: _____ Co. Proj. No.: _____

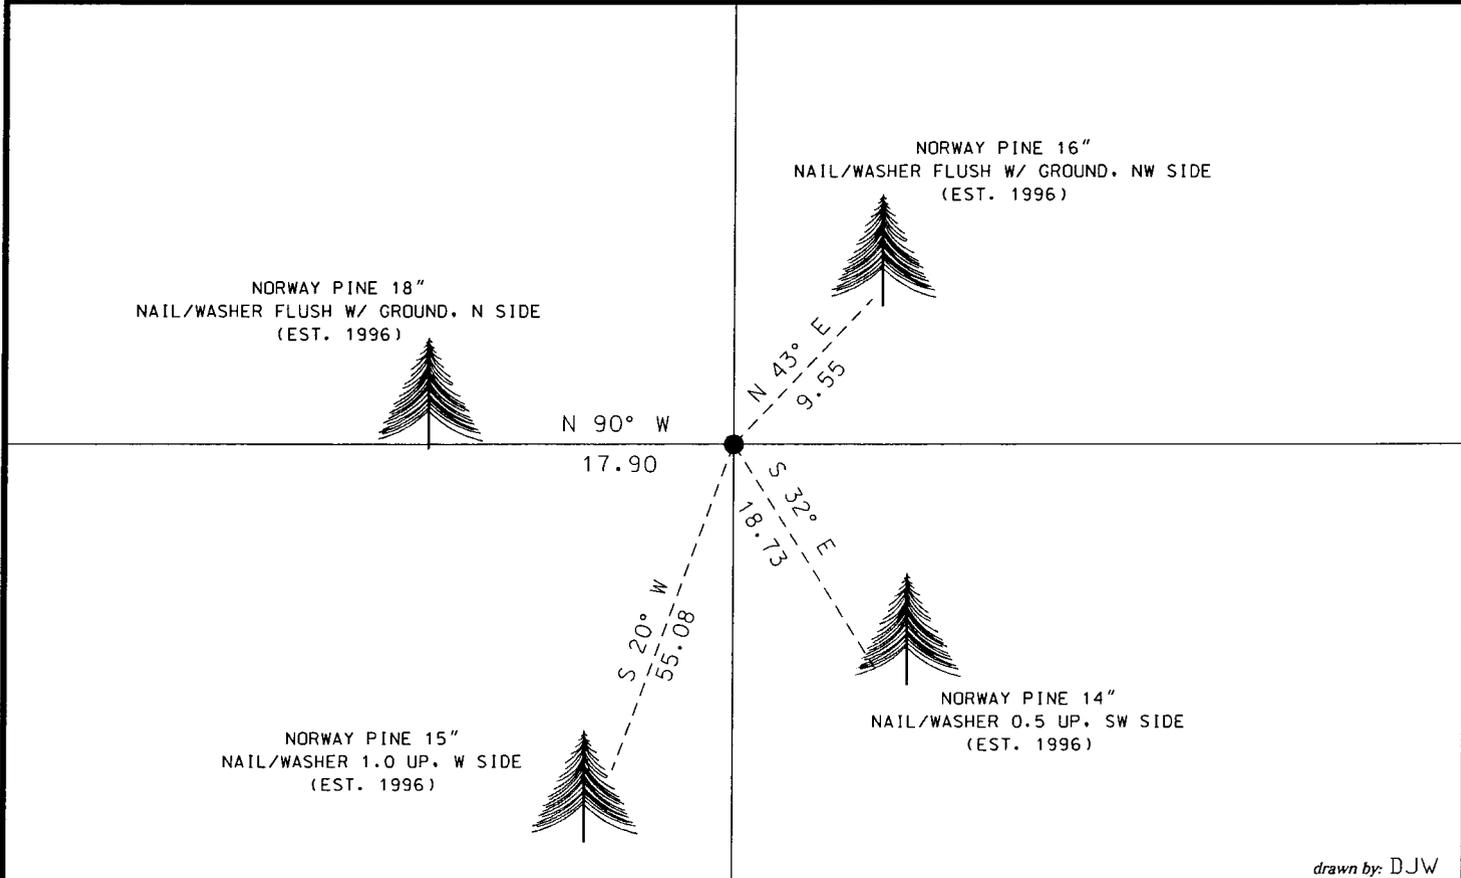

drawn by: DJW

"SKETCH OF REFERENCE TIES"

(not to scale - bearings are magnetic)

Ties are measured to center of monument unless otherwise noted.

UNITS = Metric English

NAD 83 Latitude (N):	47° 24' 46.382"
Longitude (W):	94° 08' 30.567"
CCNZC 83 Northing:	322249.69
Easting:	518532.21
NAD 83 S.P. Northing:	1208035.62
(CENTRAL) Easting:	2651453.43

Dennis J. Warner
 signature

Printed Name: Dennis J. Warner

5/10/2012
 date

License No. 42656

County Surveyor Land Surveyor

STATEMENT OF EVIDENCE: Northeast corner of Section 6, T145, R27 West of the 5th Principal Meridian.

1873 This corner was established by P.H. Conger, Deputy Surveyor, in the township boundary survey. His notes indicate a post was placed at the corner and established witnesses as follows:

Norway Pine	14"	S63 W	61 links	(40.26 feet)
Norway Pine	16"	S28E	44 links	(29.04 feet)
Jack Pine	8"	N76E	70 links	(46.20 feet)
Jack Pine	8"	N35W	37 links	(24.42 feet)

1900 US Army Corps of Engineers map of the Lake Winnibigoshish Reservoir shows the corner as a know section corner. Map on file with the USFS office in Cass Lake.

1986 The corner was visited by USFS personnel and state that a spike was set at a point where they could trace staining and wood fibers to a depth of 14" at the corner. At the 1873 witness locations they found evidence of the trees in the form of stumps and stump holes at record bearings and distances. Information on file with the USFS office in Cass Lake, Page 8, Book 2, 145-27.

1996 USFS personnel found an old rusted tag on a 19" N. Pine on the east side, dated by Handy 1934 & E.J.B. 1954. Information on file with the USFS office in Cass Lake, Page 8, Book 2, 145-27.

USFS personnel went back and placed a 2"x 48" iron pipe with a brass cap in place of the spike and established witnesses as follows:

N. Pine	15"	N43E	9.55 feet	scribed
N. Pine	12.5"	S32E	18.73 feet	scribed
N. Pine	12.5"	S20W	55.08 feet	scribed
N. Pine	17"	West	17.90 feet	scribed
SFP		East	4.1 feet	

They state that the corner falls at the base of a 10" N. Pine on the south side. They also placed a tag on a 15" N. Pine on the north side of FR 3001A approximately 330' north of corner.

Information on file with the USFS office in Cass Lake, Page 8, Book 2, 145-27.

2011 Personnel from Short Elliott Hendrickson found the 1996 brass capped monument and witnesses were found and made as shown on the face of this certificate. An analysis of the record information and field evidence supports this monument as the best evidence of the corner position.