

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Southeast Corner of Section 1

Township 145 N, Range 27 W, 5th P.M.

STATE OF MINNESOTA, COUNTY OF ITASCA.

A000581378
OFFICE OF COUNTY RECORDER
CASS COUNTY MINNESOTA
CERTIFIED, FILED, AND/OR
RECORDED ON
06/13/2012 2:16:15 PM
AS DOC #: A000581378
PAGES: 2 REC FEES: 0.00
KATHRYN M. NORBY
COUNTY RECORDER

(reserved for recording data)


On 6-02-2011, found a(n): Itasca County
DATE
Aluminum Capped Pipe.

- left monument as found lowered monument
 removed monument (explain) raised monument

On _____, set a(n): _____
DATE

See "Statement of Evidence" for further details (on back)

GPS I.D.: _____ Co. Proj. No.: _____

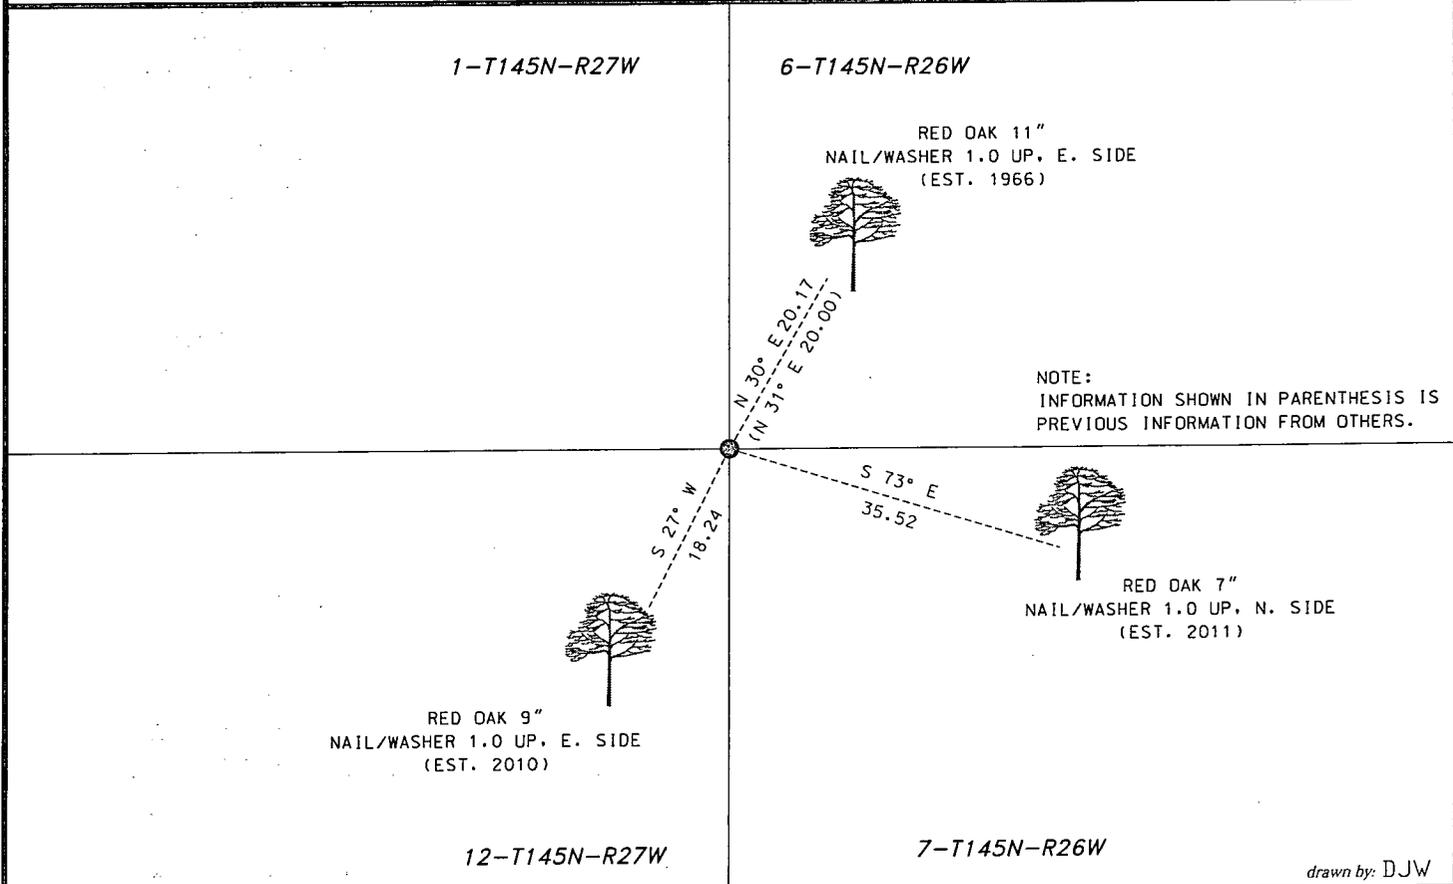

"SKETCH OF REFERENCE TIES"

(not to scale - bearings are magnetic)

Ties are measured to center of monument unless otherwise noted.

UNITS = Metric English

NAD 83 Latitude (N):	<u>47° 23' 52.644"</u>
Longitude (W):	<u>94° 02' 02.220"</u>
ITCSZC 83 Northing:	<u>235680.516</u>
Easting:	<u>425541.928</u>
NAD 83 S.P. Northing:	<u>657002.42</u>
(NORTH) Easting:	<u>2393378.29</u>

Dennis J. Warner
signature

Printed Name: Dennis J. Warner

5/10/2012
date

License No. 42656

County Surveyor Land Surveyor

STATEMENT OF EVIDENCE: Southeast Corner of Section 1, T145N, R27 West of the 5th Principal Meridian.

1873 This corner was established by P.H. Conger, Deputy Surveyor, in the township boundary survey. His notes indicate a post was placed at the meander corner and established witnesses as follows:

Jack Pine	7"	N33E	88 links	(58.08 feet)
Jack Pine	5"	N41W	140 links	(92.4 feet)
Jack Pine	8"	S84W	150 links	(99.0 feet)
Jack Pine	8"	S49E	279 links	(184.14 feet)

1900 The U.S. Army Corps of Engineers Lake Winnibigoshish Reservoir Map indicates this corner to be a known section corner. Map on file with the USFS in Cass Lake.

1940 USFS personnel recovered a Government bearing tree in Section 6, that tree being a 16" Jack Pine. This Information is shown on a U.S.D.A. form 874-9. They also indicate a metal location poster was set on a Aspen. They do not indicate the corner is in place.

1959 USFS personnel recovered a 24" x 4" x 4" wood post in poor condition and unscribed at the corner (U.S.D.A. form 874-9). They state they do not believe the post to be a genuine land office corner. They also placed a location poster on a 16" white pine, on the top side of a down snag at west 20 feet. They also state there is a blue paint line running north from corner.

1966 Itasca County Department of Surveying and Mapping personnel set a County monument from Government witnesses (no Government witnesses listed) at the corner and set witnesses as follows:

N. Pine	16"	N85W	51.25 feet
R. Oak	4"	N31E	20.00 feet
R. Oak	4"	S23E	26.82 feet

Information on file with the Itasca County Department of Surveying and Mapping in loose leaf file notes.

2010 Itasca County Department of Surveying and Mapping personnel found the County monument up 12" above the ground and in good condition. The monument was pounded flush with the ground. They also set a SFP on the north side of the monument and collected a fast static observation. Witnesses were found and set as follows:

R. Oak	10"	N34E	20.14 feet	set nail/washer, has old scribe	1966
R. Pine	22"	N85W	51.25 feet	scribed "BT"	1966
R. Oak	7.5"	S27W	18.24 feet	set nail/washer/tag	2010

Information on file with Itasca County Department of Surveying and Mapping, Book 1, Page 52.

2011 Personnel from Short Elliott Hendrickson found the 1966 County monument and witnesses were found and made as shown on the face of this certificate. An analysis of the record information and field evidence supports this monument as the best evidence of the corner position.