



A000673070

OFFICE OF THE COUNTY RECORDER
CASS COUNTY, MINNESOTA
CERTIFIED, FILED, AND/OR
RECORDED ON

6/2/2021 10:46:57 AM

AS DOC #: A000673070

PAGES: 2

REC FEES: 0.00

KATHRYN M. NORBY
CASS COUNTY RECORDER

BY SF Dep TX#: 172261

Index No. P.O-17.0


CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER Corner of Section 22, Township 136, Range 31

5TH Principal Meridian, State of Minnesota, County of CASS

At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 10/9/19 CORNER NOT ABLE TO BE SET
DATE

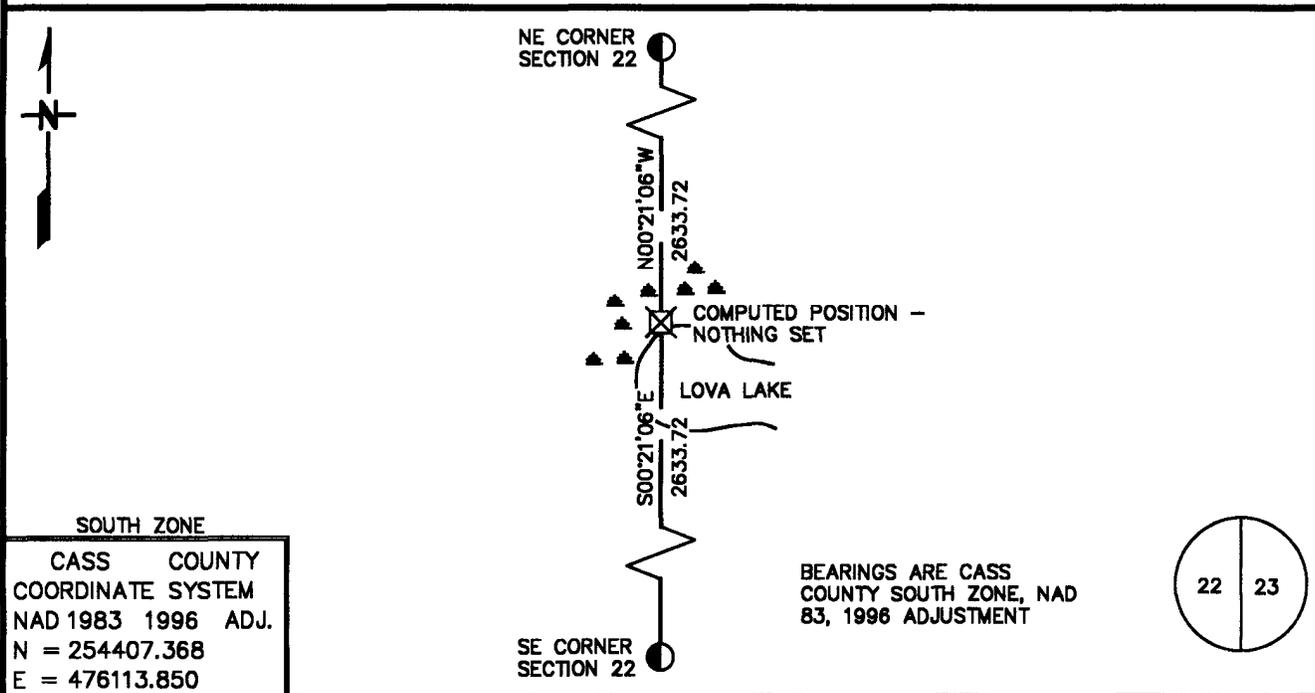

Statement of evidence for this corner location is on back of this page.

JANUARY 2020
FOM01871.00.00.01

I hereby certify that this plan, specification, or report was prepared by me or under my direct supervision and that I am a duly Licensed Land Surveyor under the laws of the State of Minnesota.

SIGNATURE Joseph L. Fleisher
JOSEPH L. FLEISHER

DATE 5/27/2020

License Number 44974

Page 1 of 2 A000673070



P.0 – 17.0

East Quarter Corner Section 22, Township 136 North, Range 31 West

The Department of Natural Resources, Division of Lands and Minerals, contacted the following offices for information regarding this corner:

- Minnesota Historical Society
- Cass County Surveyor’s Office
- Land Surveyor Ross Wamre, Survey Mapping Solutions, Inc.

1870 The US General Land Office field notes, on file in the Minnesota Historical Society, as surveyed by Richard Cronk, show this corner not to be marked as it fell on the edge of a small lake. A witness corner was set 2.00 chains north of the quarter corner position and the following bearing trees were marked:

6” Tamarack	N 35 W	72 links	47.52’
5” Tamarack	N 36 E	55 links	36.3’

1912 Information on file in the Cass County Highway Department Surveyors Office. In September, Cass County Survey Record No. 240 in Book B, page 18, field notes for a large survey in the township, state they traversed beginning at the southeast corner of Section 22 and found the stump of the northwest bearing tree to the witness corner and the rotted stump of the other bearing tree. They set a hub and tack for the true witness corner. The survey crew traversed to this corner and set a 5 X 5 X 20 inch oak stake for the true corner and marked new bearing trees. This true corner is presumed to be set at 40.00 chains north of the southeast corner of Section 22.

1913 Information on file in the Cass County Highway Department Surveyors Office. In October, the survey crew pulled up the oak post and set a 2 1/2 X 48 inch galvanized iron pipe with anchor rod through the bottom full length in the ground in a bed of concrete for the true corner.

3” Tamarack	N45-48E	71.90
4” Tamarack	N30-58W	103.40

2019 In October the Department of Natural Resources made several attempts to locate this corner but was not able to get close because of high water. I believe this corner was set at the true corner per the 1912 survey and because the survey crew was not able to locate this corner, I computed the position for the corner as lost.

Northeast corner Section 22 bears	N00-21-06E	2633.72
Southeast corner Section 22 bears	S00-21-06W	2633.72