

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

East Quarter Corner of Section 4, Township 141N, Range 26W, 5th P.M.


STATE OF MINNESOTA, County of Cass

At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 12-23-86 placed a 2" U.S.F.S. Iron Pipe with Brass Cap,
DATE
stamped to identify corner.


*Magnetic: $4\frac{1}{2}^{\circ}$ E. decl. SKETCH OF REFERENCE TIES

Based on Solar observation 12-20-86

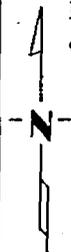

N $14\frac{1}{2}^{\circ}$ W 56.32' to a 16d double headed nail in the west base of a 8" diameter blazed and scribed Maple.

S $52\frac{1}{2}^{\circ}$ W 19.75 to a 16d double headed nail in the southeasterly base of a 9" diameter blazed and scribed Balsam.

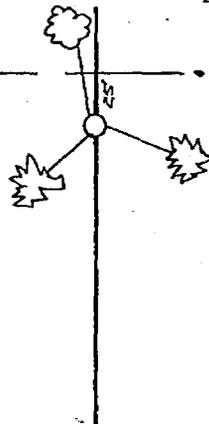

S $60\frac{1}{2}^{\circ}$ E 25.67' to a 16d double headed nail in the northeasterly base of a 11" diameter blazed and scribed Balsam.

Monument is stamped

T141N R26W
 $\frac{1}{4}$
S4 \downarrow S3
1986
RLS 11946

Monument is located

25' south of a east-west powerline, 5' easterly of a north-south woods trail, and at the edge of the powerline clearing. Post and sign 54-2 and 54-9 north 4.0'.

Statement of evidence relative to this corner location is on back of page.

295216

I hereby certify that this survey, plan or report was prepared by me or under my direct supervision and that I am a duly Registered Land Surveyor under the laws of the State of Minnesota.

Roger A. Mustonen

Date 2-23-87 Registration No. 11946

OFFICE OF THE COUNTY RECORDER

County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 1:25 P.M. on the 23 day of February A.D., 1987

County Recorder Clouline Kayh

By MS, Deputy

DOCUMENT NO. 295216

Statement of Evidence:

During April of 1871, Walker, Allen and Putnam, under contract with the U.S.G.L.O. surveyed and marked the East, North and West lines of Township 141 North, Range 26 West of the 5th Principal Meridian.

From May 1, to May 10, 1871, Walker, Allen and Putnam, surveyed and marked the interior lines of the Township.

During the 1960's, according to local landowners, surveys were made in part of Section 4 by surveyors unknown, for the purpose of laying out lots and marking boundary lines.

In December of 1986, Roger A. Mustonen, RLS #11946, under contract with the USDA Forest Service re-establishes the east quarter corner of Section 4 by single proportionate measurement on line between the southeast corner of Section 4 and Meander Corner # 11. (see other side for ties, etc.)

Original G.L.O. survey set a wood post, from which:
Norway Pine 8" S75W 21 lks
Spruce 10" S42E 13 lks.

No evidence of G.L.O. bearing trees found.

When we set the USDA Forest Service monument, we found a 1½ inch by 48 inch iron pipe bent near the top third, lying at the southerly edge of the power line cut, within ½ foot of the corner position.