



# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Meander Corner No. 1 of Section 36, Township 141 N., Range 31 W., 5th P.M.

State of Minnesota, County of Cass, 10th Standard Parallel, east shore Ten Mile Lake


At the corner location shown on the sketch:

On 18 July 2003 found a 2 inch outside diameter, capped iron pipe, up 1.5 feet,

On \_\_\_\_\_ placed \_\_\_\_\_

left monument as found     lowered monument     removed monument (explain)

SKETCH OF REFERENCE TIES  
NOT TO SCALE

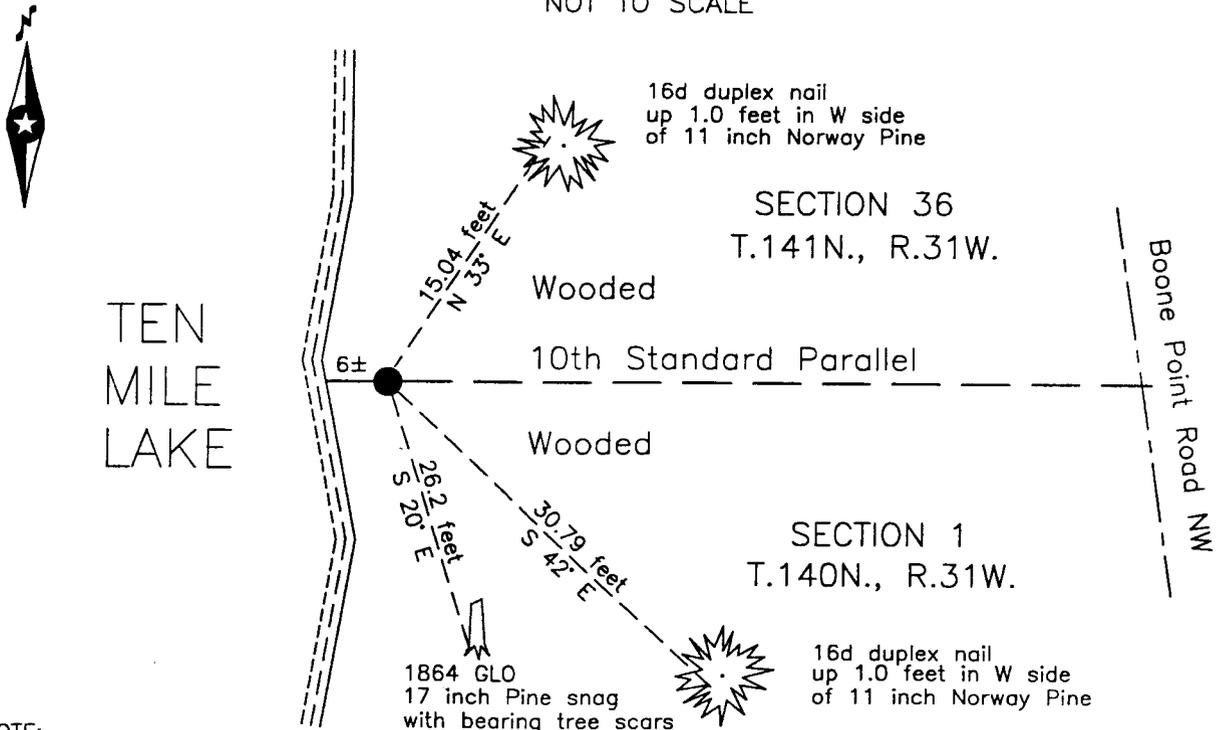


NOTE:  
All bearings are true

Statement of evidence relative to this corner location is on the back of this page.

I hereby certify that this survey, plan or report was prepared by me or under my direct supervision and that I am a duly Licensed Land Surveyor under the laws of the State of Minnesota.

I further certify that this United States public land survey monument record is correct and complete to the best of my knowledge and belief.

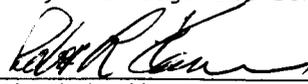  
Robert L. Kovanen, Cass County Surveyor  
Date 7/15/10 MN License No. 16459

**A000561971**  
**OFFICE OF COUNTY RECORDER**  
**CASS COUNTY MINNESOTA**  
**CERTIFIED, FILED, AND/OR**  
**RECORDED ON**  
**07/20/2010 12:31:03 PM**  
**AS DOC #: A000561971**  
**PAGES: 2 REC FEES: 0.00**  
**KATHRYN M. NORBY**  
**COUNTY RECORDER**

**T141N R31W 5th PM \* Index No. Z.0-22.7**

Statement of Evidence

**Z-22.7, Meander corner Number 1, south line of Section 36, on the 10<sup>th</sup> Standard Parallel, Township 141 North, Range 31 West, 5th Principal Meridian, east shore of Ten Mile Lake.**

May 4, 1864 Johnson & Thornton, General Land Office (GLO) Deputy Surveyors set the original meander corner on the east side of the lake in the survey of the 10<sup>th</sup> Standard Parallel and referenced it as follows:  
16" Y. Pine N 20°E 14 links (9.24 feet) 15" Y. Pine S 21°E 39 links (25.74 feet)  
Said records are on file with the Secretary of State, St. Paul, Minnesota, copies are filed with the Cass County Surveyor's Office (CCSO).

March 25, 1915 D.Gorman, assistant under J.Curo, LS 1428, County Surveyor, Record Book of Survey B, page 66 and Curo Field Book 63, Page 10 in a survey to subdivide Section 36, Twp. 142 N., Rge. 31 W. on file at the CCSO states "We find S.E tree standing green and plainly marked also stump of N.E. tree from which we set the true M.C. by flat chain from "B.T." marks set 80d spike". In Book B, Gorman further states "April 14, 1915....set 2/48 inch capped galvanized iron pipes at all corners and meander corners". This survey was recorded in the office of the Cass County Recorder on May 11, 1915 as Survey Number 71.

Dec. 1956 H.Curo, LS 3417, in a survey of Government Lot 4 and 5 and the NE ¼ of the SW ¼ of Section 1 for C.W.Loufek in Curo Field Book 298, Page 19 on file at the CCSO states "from M.C. N. side Sec. 1 I run random line East"

July 1978 W.Curo, LS 11395 on the plat of HILLAWAY EAST, recorded in the office of the Cass County Recorder on July 24, 1978 as Document Number 240021 indicates the meander corner was found.

July 18, 2003 B.Hippen, CCSO technician, this corner was visited based on the concern of the adjoining land owner who felt that the monument was in danger of eroding into the lake. A 2 inch outside diameter iron pipe with a plumbers cap was recovered, up 1.5 feet, 6 feet from the waters edge at the top of the bank. The following 1864 GLO witness was recovered:

17" Norway Pine snag S 20°E 26.2 feet

The following accessories were added:

11" Norway (red) Pine S 42°E 30.79 feet 11" Norway (red) Pine N 33°E 15.04 feet

The monument together with the recovered and established references for the position are shown graphically on the face of this document.

**Analysis of the recovered record data and field evidence indicates that the monument recovered in 2003 by the CCSO is the 1915 placement and is a direct perpetuation of the original corner.**