



A000668743

OFFICE OF THE COUNTY RECORDER
CASS COUNTY, MINNESOTA
CERTIFIED, FILED, AND/OR
RECORDED ON

1/28/2021 10:33:24 AM

AS DOC #: A000668743

PAGES: 2

REC FEES: 0.00

KATHRYN M. NORBY
CASS COUNTY RECORDER

BY SF Dep TX#: 168663


CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 4, Township 145 N, Range 29 W, 5th P.M.
County of Cass, State of Minnesota

At the corner location shown on the sketch :

- On 04/13/2020 found 6" concrete cylinder with brass cap, marked as described in 1934 GLO field notes, 4" above ground and in good condition.
- left monument as found lowered monument removed monument (explain)
- On _____ set _____

SKETCH OF REFERENCE TIES (NOT TO SCALE)

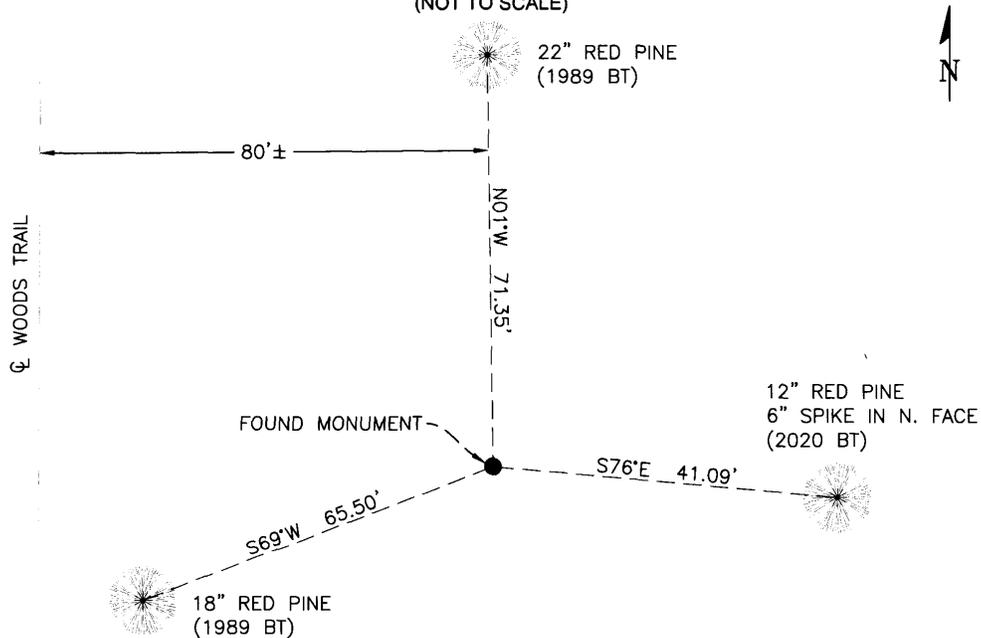

Note:
Distances shown are horizontal
Bearings shown are geodetic

Sheet 1 of 2

Statement of evidence relative to this corner location is on the back of this page

I hereby certify that this survey, plan, or report was prepared by me or under my direct supervision and that I am a duly Licensed Land Surveyor under the laws of the state of Minnesota.

Aaron J. Skattum
Aaron J. Skattum
MN License No. 54139

12-28-2020
Date

Corner Index No. A.0-13.0
GCDB ID No. 400700

Cass County Coordinates
North Zone, NAD83(2011)
N: 322,555.720
E: 466,592.693





Corner Index No. A.0-13.0

STATEMENT OF EVIDENCE**Northeast Corner of Sec. 4, T.145N., R.29W., 5th P.M., Cass County, MN**

1873 P.H. Conger, US General Land Office, originally established this corner while surveying the north line of the township, and set wood post to mark the corner position with the following witnesses:

12" Jack pine	N20°E	9 links (5.94')
8" Jack pine	N05°W	35 links (23.10')
12" Jack pine	S84°W	53 links (34.98')
8" Jack pine	S79°E	19 links (12.54')

Information on file at the MN Historical Society, St. Paul, MN. Copies filed with the Cass County Highway Department/Surveyor's Office (CCHD/SO).

1934 H.D. Craig, US General Land Office, during a dependent resurvey of the north line of this township, reestablished this corner from the remains of the original bearing tree, set a 6"x24" cylindrical concrete monument with brass cap and noted the following ties:

14" Jack pine	S84°W	8 links (5.28')	1873 BT, found fallen charred snag
No evidence of other bearing trees.			
No new trees available for marking.			

Information on file at the CCHD/SO.

1989 K. Krause, US Forest Service, (Corner Book 1, page 10, USFS Records) found the GLO concrete monument and noted the following ties:

14" Pine snag	S84°W	5.28'	1934 BT, now decayed log
14" Red pine	N01°W	71.35'	New BT
11" Red pine	S85°E	60.59'	New BT
12" Red pine	S39°E	39.04'	New BT
7" Red pine	S69°W	65.50'	New BT
Steel signpost	East	4.0'	New 8' long steel signpost set
Steel signpost	North	4.0'	New 8' long steel signpost set
11" Jack pine	N89°W	74.0'	Set FSLP on tree

2003 R. Main, US Forest Service, (Corner Book 1, page 10, USFS Records) found the GLO concrete monument and noted the following ties:

17" Red pine	N01°W	71.35'	1989 BT
13" Red pine	S85°E	60.59'	1989 BT
16" Red pine	S39°E	39.04'	1989 BT
9" Red pine	S69°W	65.50'	1989 BT, standing dead

2020 A. Skattum, US Forest Service, (Land Lines Book 31, page 74, USFS Records) found the GLO concrete monument in good condition and noted the following ties:

22" Red pine	N01°W	71.35'	1989 BT, good condition
13" Red pine	S85°E	60.59'	1989 BT, now rotted stump w/ scribe
16" Red pine	S39°E	39.04'	1989 BT, now rotted stump w/ scribe
18" Red pine	S69°W	65.50'	1989 BT, good condition (not dead as previously noted)
Signpost	East	4.0'	1989 signpost in place
Signpost	North	4.0'	1989 signpost in place
11" Jack pine	N89°W	74.0'	1989 FSLP tree, now stump
12" Red pine	S76°E	41.09'	New BT

US Forest Service records cited above are on file at the Chippewa National Forest Supervisor's Office, Cass Lake, MN.