



A000668753

OFFICE OF THE COUNTY RECORDER
CASS COUNTY, MINNESOTA
CERTIFIED, FILED, AND/OR
RECORDED ON

1/28/2021 10:33:34 AM

AS DOC #: A000668753

PAGES: 3

REC FEES: 0.00

KATHRYN M. NORBY
CASS COUNTY RECORDER

BY SF Dep TX#: 168663


CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 6, Township 145 N, Range 29 W, 5th P.M.
County of Cass, State of Minnesota

At the corner location shown on the sketch :

- On 05/05/2020 found 6" concrete cylinder with brass cap, marked as shown
in 1934 GLO notes, its top 2" above the ground and in good condition
- left monument as found lowered monument removed monument (explain)
- On _____ set _____

SKETCH OF REFERENCE TIES (NOT TO SCALE)

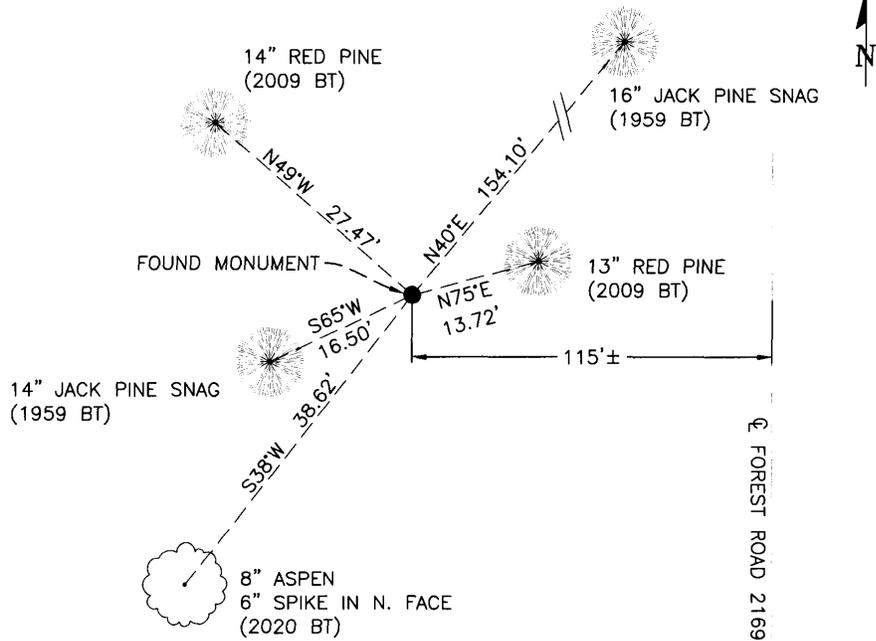

Note:
Distances shown are horizontal
Bearings shown are geodetic

Sheet 1 of 3

Statement of evidence relative to this corner location is on the back of this page

I hereby certify that this survey, plan, or report was prepared by me or under my direct supervision and that I am a duly Licensed Land Surveyor under the laws of the state of Minnesota.

Aaron J. Skattum
Aaron J. Skattum
MN License No. 54139

12-28-2020
Date

Corner Index No. A.0-5.0
GCDB ID No. 200700

Cass County Coordinates
North Zone, NAD83(2011)
N: 322,655.182
E: 456,038.629



Corner Index No. A.0-5.0

STATEMENT OF EVIDENCE

Northeast Corner of Sec. 6, T.145N., R.29W., 5th P.M., Cass County, MN

1873 P.H. Conger, US General Land Office, originally established this corner while surveying the north line of the township, and set wood post to mark the corner position with the following witnesses:

4" Jack pine	N41°E	18 links (11.88')
4" Jack pine	N65°W	77 links (50.82')
12" Jack pine	S76°W	67 links (44.22')
3" Jack pine	S28°E	5 links (3.30')

Information on file at the MN Historical Society, St. Paul, MN. Copies filed with the Cass County Highway Department/Surveyor's Office (CCHD/SO).

1900 T.M. Fowble, U.S. Corps of Engineers, indicates known corner at this location as shown on map of Lake Winnibigoshish Reservoirs.

1934 H.D. Craig, US General Land Office, during a dependent resurvey of the north line of this township, found a rotted pine stake with illegible scribe marks. Craig replaced the stake with a 6"x24" cylindrical concrete monument with brass cap and noted the following ties:

8" Jack pine	N34°E	18 links (11.88')	1873 BT, fallen
15" Jack pine	S68°W	67 links (44.22')	1873 BT, fallen
6" Jack pine	N22°E	12 links (7.92')	New BT
7" Jack pine	S17°E	11 links (7.26')	New BT
8" Jack pine	S57.5°W	48 links (31.68')	New BT
6" Jack pine	N16°W	35 links (23.10')	New BT

Information on file at the CCHD/SO.

1959 Unnamed US Forest Service personnel, (Corner Book 1, page 3, USFS Records) marked the following bearing trees:

10" Jack pine	S65°W	16.5'	New BT
12" Jack pine	N40°E	154.1'	New BT

1964 W. Okerman, US Forest Service, (Corner Book 1, page 3, USFS Records) found the GLO concrete monument and noted the following ties:

6" Jack pine	N22°E	7.92'	1934 BT, not found
7" Jack pine	S17°E	7.26'	1934 BT, found scribed stump
8" Jack pine	S57.5°W	31.68'	1934 BT, found scribed stump
6" Jack pine	N16°W	23.10'	1934 BT, not found
10" Jack pine	S65°W	16.5'	1959 BT, found
12" Jack pine	N40°E	154.1'	1959 BT, found
Steel signpost	N78°W	3.2'	New 6' long steel signpost set

1981 T. Kerick, private surveyor under contract with USFS (145-29 Project Files, USFS Records) found the GLO monument and noted the following ties:

12" Jack pine	S65°W	16.5'	1959 BT, added BT tag
14" Jack pine	N40°E	154.1'	1959 BT, added BT tag
Steel signpost	N78°W	3.2'	1964 signpost, added sign to post

2009 R. Main and J. Schoonover, US Forest Service, (Corner Book 1, page 3, USFS Records) found the GLO concrete monument, flush with the ground, and noted the following ties:

20" Jack pine	S65°W	16.5'	1959 BT, dead top
17" Jack pine	N40°E	154.1'	1959 BT, good health
12" Red pine	N75°E	13.72'	New BT
12" Red pine	N49°W	27.47'	New BT
8" Red pine	East	90'±	Location poster on tree, west side of road
Steel signpost	N78°W	3.2'	1964 signpost



Corner Index No. A.0-5.0

STATEMENT OF EVIDENCE

Northeast Corner of Sec. 6, T.145N., R.29W., 5th P.M., Cass County, MN

2020 A. Skattum, US Forest Service, (Land Lines Book 31, page 78, USFS Records) found the GLO concrete monument, 2" above ground, in good condition, and noted the following ties:

6" Jack pine	N22°E	7.92'	1934 BT, found faint stump hole
7" Jack pine	S17°E	7.26'	1934 BT, found faint stump hole
8" Jack pine	S57.5°W	31.68'	1934 BT, found badly decayed stump
20" Jack pine	S65°W	16.5'	1959 BT, standing, dead
17" Jack pine	N40°E	154.1'	1959 BT, standing, dead
13" Red pine	N75°E	13.72'	2009 BT, standing, live
14" Red pine	N49°W	27.47'	2009 BT, standing, live
8" Aspen	S38°W	38.62'	New BT, spike in north face
Steel signpost	N78°W	3.2'	1964 signpost inplace

US Forest Service records cited above are on file at the Chippewa National Forest Supervisor's Office, Cass Lake, MN.