


T. 138 R. 30 M. 5th Coordinates: X _____ Y _____
E 1/4 26 Corner common to sections 25, 26

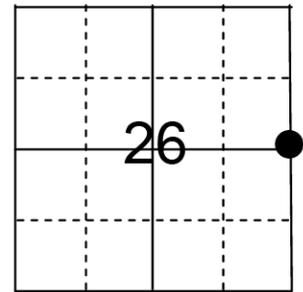

26

● = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1865
Original monument Post

Original Evidence Found

Year of search 1906 by Curo
Monument found _____
Survey Rec #309, Bk B, pg 350

Bearing Trees

Species Black Pine Black Pine
Diameter 7" 6"
Bearing N 3° W S 12° E
Distance 20 links 17 links

Original Bearing Trees Found

Species Black Pine Black Pine
Diameter _____
Bearing N 3° W S 12° E
Distance 20 links 17 links

Subsequent Corner Restoration

Year surveyed 8/1906 By J.W. Curo, LS 1428, Co. Surv.
Location filed: Survey Record #309, Book B, page 350
Monument: Set stake
Found both old bearing trees plainly marked from which we set a stake for the true 1/4 cor. new witnesses as follows

Evidence of Subsequent Corner Restoration

Year of search 1/1909 By J.W. Curo, LS 1428, Co. Surv.
Location filed: Curo Book 85, page 291
Monument: Found 2" pipe measured N. from the W. 1/4 corner of section 36 and found the W. 1/4 corner of section 25 at 1 mile plus 56.80'.

Bearing Trees, Reference Objects

Species Jack Pine Jack Pine
Diameter 8" 10"
Bearing N 16°15' E S 7°40' E
Distance 68.70' 64.30'

Bearing Trees, Reference Objects

Species _____
Diameter _____
Bearing _____
Distance _____

Subsequent Corner Restoration

Year surveyed 6/1967 By R.F. Schneider, LS 5740
Location filed: Certificate of Location of Government Corner
Monument: found corner
Indicates he found corner from remains of old bearing trees from County Surveyor records, at intersection of fences E., W. and S., which fits County Survey record distance from corner to S. He set a Cass County cast iron monument and witnesses
10" Jack Pine, SSW, 122.90'
8" Jack Pine, WSW, 154.70'

Evidence of Subsequent Corner Restoration Found

Year of search 2/2002 By D.S. Landecker, LS 17008
Location filed: Certificate of Survey for Bresnahan, #1558
Monument: Indicates a monument found
6/2005, J.D. Walker, LS 16098, DNR
Certificate of Survey for the PAUL BUNYAN TRAIL, #3115
Indicates a cast iron monument found at the corner.

6/1974, W.J. Spain, LS 2003
Spain Book 1972, page 61 and Certificate for O'Bryan, #4407
Indicates he found Cass County cast iron monument.

10/2018, CCHD/SO
#2018.026
Found a cast iron monument, up 0.1', on berm at the S. edge of a field and the following witnesses.
15" Red Pine, S 54 E, 47.97'(1978) duplex nail, up 1.0', N. side
13" Red Pine, S 28 E, 67.46'(1978) duplex nail, up 1.0', W. side
12" Burr Oak, S 45 W, 68.48' duplex nail, up 1.0', N. side

6/1978, A.P. Welle, LS 11873, MN/DOT
Certificate of Location of Government Corner, #240561
Indicates he found the Cass County cast iron monument at corner of fences, E. and S. and witnessed as follows.
8" Jack Pine, S 80° W, 154.70'(1967)
Fence Post, East, 6.35' copper nail and disc, up 1.0', N. side
6" Norway Pine, SE, 47.77' nail and washer, in face
8" Norway Pine, SSE, 67.88' copper nail and disc, SW side

11/2018, T.L. Freeman, LS 21367
Certificate of Location of Government Corner, A000646248
Filed on the above information.

5/1992, R.M. Morton, LS 21401
Certificate of Survey for Cass Co. Environmental Serv., #608
Indicates monument found at corner.

