


T. 139 R. 28 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
NE 16 Corner common to sections 9, 10, 15, 16

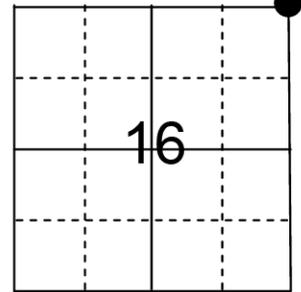

EXISTING SURVEYS

Original Government Survey

Year surveyed 1864  
Original monument Post

Original Evidence Found

Year of search 1911 by J. Curo  
Monument found \_\_\_\_\_  
County Book A, page 365

Bearing Trees

Species	W. Pine	Y. Pine	W. Pine
Diameter	<u>20"</u>	<u>18"</u>	<u>28"</u>
Bearing	<u>N 85° E</u>	<u>N 75° W</u>	<u>S 70° E</u>
Distance	<u>40 links</u>	<u>10 links</u>	<u>47 links</u>

Original Bearing Trees Found

Species	W. Pine	Y. Pine	W. Pine
Diameter	<u>stump</u>	<u>stump</u>	<u>stump</u>
Bearing	<u>N 85° E</u>	<u>N 75° W</u>	<u>S 70° E</u>
Distance	<u>40 links</u>	<u>10 links</u>	<u>47 links</u>

Subsequent Corner Restoration

Year surveyed 6/1911 By H.S. Todd, Deputy Co Surveyor  
Location filed: Survey Record #165, Book A, pg 365 and Curo  
Monument: 8"x8"x36" cement post  
Curo Book 73, page 28, Curo wood hub stands perfect for  
position, pull up and put in cement post.

Evidence of Subsequent Corner Restoration

Year of search 9/1919 By B.F. Clark, LS 231  
Location filed: Survey Record #434, Book C, page 320  
Monument: Found concrete post  
begin at the established cor. S. 9-10-15-16. A concrete post in  
the township road.

Bearing Trees, Reference Objects

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Bearing Trees, Reference Objects

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 12/1921 By B.F. Clark, LS 231  
Location filed: Resurvey E-9 Doc. #69799 and E-10 Doc #69798  
Monument: Iron Monument

Evidence of Subsequent Corner Restoration Found

Year of search 5/2018 By CCHD/SO  
Location filed: #2003.007  
Monument: Found 8" x 8" concrete monument  
down 1.0' with R/R spike on S. side and witness as follows:  
P. Pole, N 75° E, 35.96'(2005) duplex nail, up 1.0', S. side  
8" Twin R. Oak, N 35° W, 95.95'(2005)duplex nail, up 1.0', N.  
6" R. Oak, S 70° E, 38.93' duplex nail, up 1.0', N. side

1938, CCC  
Washburn Lake Book #13, page 17  
Start east from corner.


1982, G.H. Stevenson, LS 12684, Cass County Surveyor  
Cass County Land Corner Record  
Found concrete post at P.I. Road N and W, up 0.5' and  
witness as follows:  
8" R. Oak, N 60° E, 30.25'  
7" R. Oak, N 85° E, 25.25'

9/2005, CCHD/SO  
#2003.007  
Found 8" x 8" concrete monument, down 1.0' place R/R spike  
on South side and witness as follows:  
P. Pole, N 75° E, 35.96' duplex nail, up 1.0', S. side  
12" R. Oak, N 35° E, 97.47' duplex nail, up 1.0', W. side  
8" Twin R. Oak, N 35° W, 95.95' duplex nail, up 1.0', N. side

Index No. J 13

CASS COUNTY LAND CORNER RECORD

T. 139 R. 28 M. 5TH Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
NE 16 Corner common to sections 9, 10, 15, 16

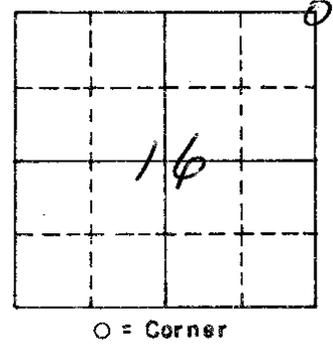

EXISTING SURVEYS

Original Government Survey  
 Year surveyed 1864  
 Original monument POST

Original Evidence Found  
 Year of search \_\_\_\_\_ By \_\_\_\_\_  
 Monument found \_\_\_\_\_

Species	Bearing Trees		
	W. PINE	Y. PINE	W. PINE
Diameter	<u>20"</u>	<u>18"</u>	<u>28"</u>
Bearing	<u>N85E</u>	<u>N75W</u>	<u>S70E</u>
Distance	<u>40 LKS</u>	<u>10 LKS</u>	<u>47 LKS</u>

Original Bearing Trees Found  
 Species \_\_\_\_\_  
 Diameter \_\_\_\_\_  
 Bearing \_\_\_\_\_  
 Distance \_\_\_\_\_

Subsequent Corner Restoration  
 Year surveyed 1911 By JOHN CROD  
 Location filed COUNTY SURVEY RECORD BOOK "A" P. 364-368  
 Monument FIND STUMPS OF ALL 4 OLD COT. B.T.S. ALSO  
CROD'S STAKE JUNE 17, 1911 SET 8X8X36" CONCRETE  
POST  
1922, BEN CLARK, COUNTY RESURVEY "E-9, E-10"

Evidence of Subsequent Corner Restoration  
 Year of search 1919 By BEN CLARK  
COUNTY BOOK "C" P. 370 FIND CONCRETE MONUMENT  
1938 - CCG Washburn Lake - BK # 13 P. 17 Start east from Cor.  
1982 - Co. SURVEYOR FIND CONCRETE POST A.P.L.  
Read N 1/4 W. UP 0.5'

Bearing Trees, Reference Objects  
 Species \_\_\_\_\_  
 Diameter \_\_\_\_\_  
 Bearing \_\_\_\_\_  
 Distance \_\_\_\_\_

Bearing Trees, Reference Objects  
R.OAK R.OAK  
8" 7"  
N60E N85E  
30.25' 25.25'  
1982 Ties

Subsequent Corner Restoration  
 Year surveyed 1911 By HARRY TODD  
 Location filed microfilm - roll 115 BK 73 P. 28  
 Monument End stumps of all B.T.S. and  
CROD'S corner. P. 35 set 8X8X36"  
concrete post

Evidence of Subsequent Corner Restoration Found  
 Year of search Dec. 1918 By \_\_\_\_\_  
Trap rd order shows no survey

Remonumentation certificate prepared \_\_\_\_\_ By \_\_\_\_\_  
 Filed at \_\_\_\_\_ Date \_\_\_\_\_