

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 33, Township 142, Range 27, 5th P.M.


STATE OF MINNESOTA, County of Cass

At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 10/16/81 placed a cast iron monument down 10" below road surface
DATE
from survey data based on the 1919 USGLO resurvey.

SKETCH OF REFERENCE TIES

Monument 2' north of approx. center line

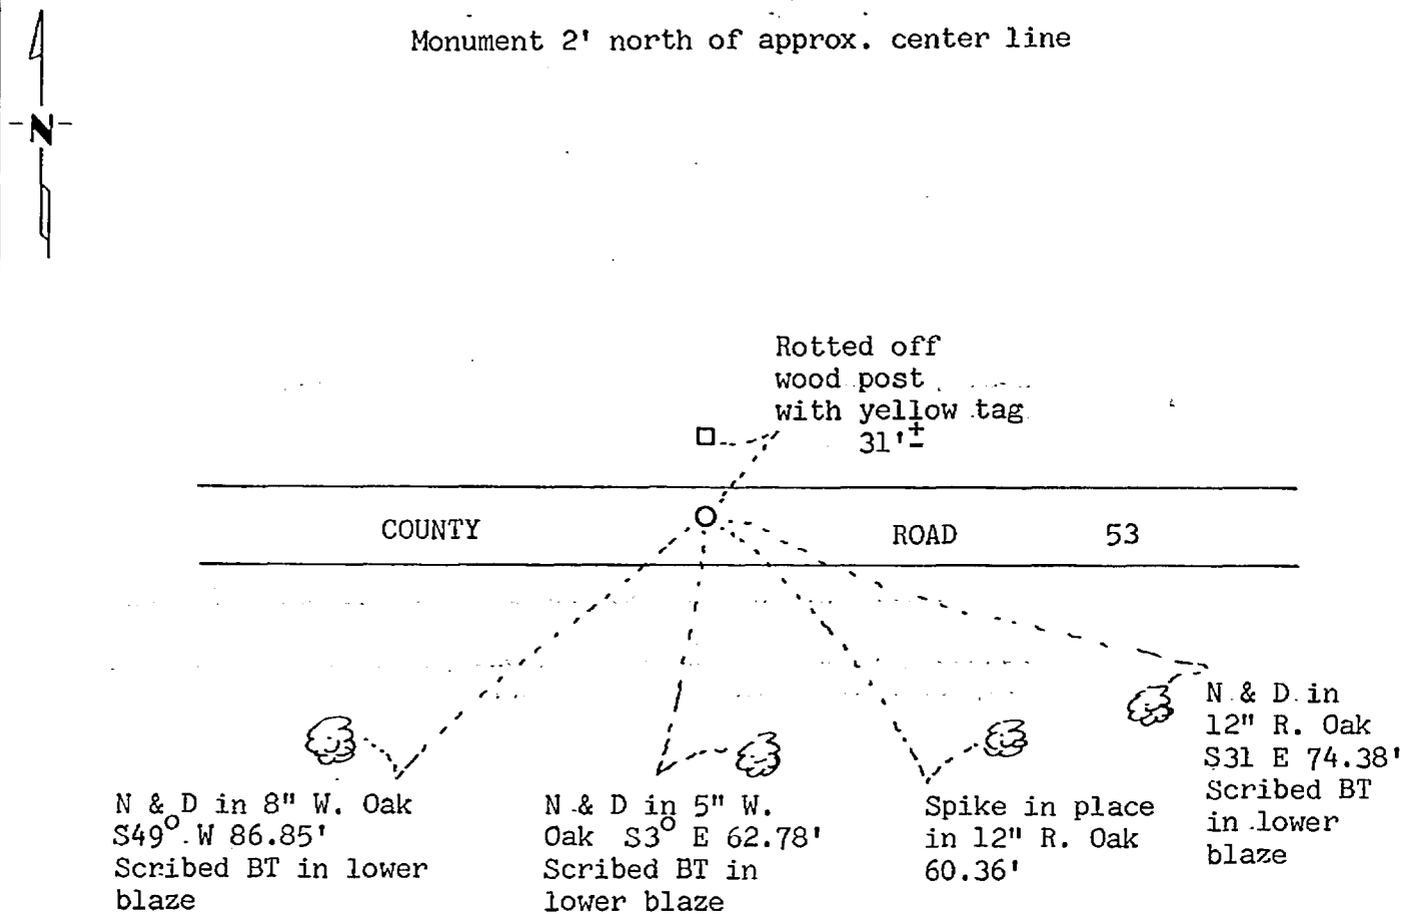

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page.

260594

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Mary H. Stenerson 12-2-81
SIGNATURE DATE

Registration No. 12684

- Land Surveyor, Professional Engineer
- County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER

County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 10:50 A.M. on the 3 day of Dec. A.D., 1981

County Recorder Bessie Hardin

By MS, Deputy

DOCUMENT NO. 260594

Statement of Evidence:

- 1873 U.S. General Land Office survey set wood post for this corner and marked the following bearing trees: 5" Poplar S 25° E 42 links.
- 1919 U.S. General Land Office dependent resurvey found the corner marked by a wooden post in the center of an east-west road. An iron pipe with a marked brass cap was set to mark the corner. The following bearing trees were marked: 6" Poplar N $42\frac{1}{4}^{\circ}$ E 49 links, 8" Jack Pine S 48° E 146 links, 5" Birch S $64\frac{1}{2}^{\circ}$ W 107 links, and 6" W. Oak N $33\frac{1}{2}^{\circ}$ W 35 links.
- 1980 County Surveyor's Records in the Recorder's Office were checked and no resurvey information was found on this corner.
- 1940 U.S. Forest Service office in Cass Lake was contacted for information. A corner card dated 6/17/40 by R.T. Defant under the CCC program shows a wooden stake was found 50 links north of the center line of the road.
- 1981 We ran a traverse from the NE corner of Sec. 28 south to the East $\frac{1}{4}$ corner of Sec. 28 and thence south to the area of the NE corner of Sec. 33. We searched the area and found no evidence of the iron set by the GLO in 1919. Bill Olson, a technician with the U.S. Forest Service helped in a search for the bearing trees. A possible Aspen to the NE was found and cut open, but no marks or evidence was found that it was a bearing tree. No other evidence of the bearing trees were found. Since the East $\frac{1}{4}$ corner of Sec. 28 was set midway and on line between the NE corner of Sec. 33 and the NE corner of Sec. 28, we computed a temporary position for the NE corner by extending the line and doubling the distance from the NE corner of Sec. 28 to the East $\frac{1}{4}$ corner of Sec. 28. From this temporary position a traverse was run south to the East $\frac{1}{4}$ corner of Sec. 33 and west to the approximate position for the meander corner on the west side of the Boy River as determined from one bearing tree. The bearings and distances to these corners agreed reasonably well with the 1919 resurvey. Our temporary point also fell in the approximate center of the east-west road. I concluded that our temporary position was the best evidence available and accepted this position as the obliterated location of the original corner. A county cast iron monument was then set at this position and ties taken. A rotted off wooden post with an old yellow forest tag was found approximately 31 feet north of the corner.