

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTHEAST Corner of Section 22, Township 142, Range 27, 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On 1-19-81 found a 23" R.Oak tie tree from 1921 County survey
DATE
records.
 - left monument as found, lowered monument, removed monument (explain)
- On 5-3-82 placed a County Cast Iron Monument using the bearing
DATE
and distance from 1921 County survey records.

SKETCH OF REFERENCE TIES

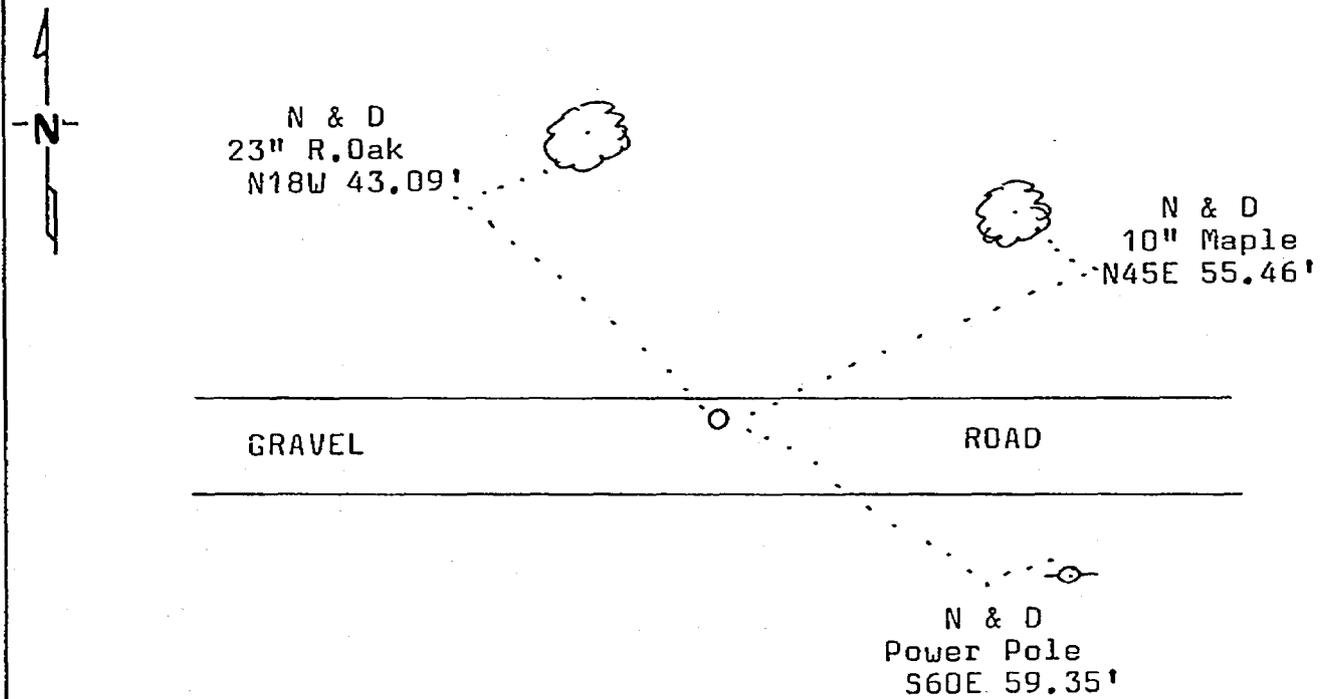

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Nancy A. Stevan 3/14/83
SIGNATURE DATE

Registration No. 12684

- Land Surveyor, Professional Engineer
- County Surveyor, County Engineer

267663
 OFFICE OF THE REGISTER OF DEEDS
 County of Cass

I hereby certify that this document was filed in the Reg. of Deeds office at 11:30 A.M. on the 14 day of March A.D., 1983

Register of Deeds Clouline Koyler
 By MS County Recorder, Deputy

DOCUMENT NO. 267663

Statement of Evidence:

- 1873 - U.S. General Land Office survey set wood post for this corner and marked the following bearing trees: 5" Fir S16E 13 links, 4" Maple N74E 14 links, 9" Birch S35W 38 links, and 7" Birch N55W 36 links.
- 1921 - County Surveyor's Record Book C, pages 432-434: Survey shows original Maple BT found standing and marked and both Birch BT's found down at correct bearing and distance. A 2½"x30" iron pipe was set for the corner from the BT's. Two new ties were taken: 16" R.Oak N18W 42.8' and 12" Basswood N18E 45.2'. Distance west to the North Quarter corner of Sec. 22 given as 2676.0'.
- 1981 - Found 23" R.Oak with upper and lower blazes that appeared to be the 1921 tie. Did not find any type of monument for the corner. It appeared iron set in 1921 had been removed by road construction. Set temporary corner from R.Oak using 1921 bearing and distance. Measured 2676.75' west to the North Quarter corner of Sec. 22 from this temporary point. Found no evidence of the other bearing trees. Accepted the found R.Oak as the 1921 tie tree and set a Cast Iron Monument to mark the obliterated position of the corner based on the 1921 record of finding the original bearing trees. Corner falls approximately 4 feet north of the center of an east-west road.