

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTH QUARTER Corner of Section 36, Township 141, Range 29, 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 10/28/82 placed a 2" x 60" galvanized iron pipe with a marked 3"
DATE brass cap at the lost position

SKETCH OF REFERENCE TIES

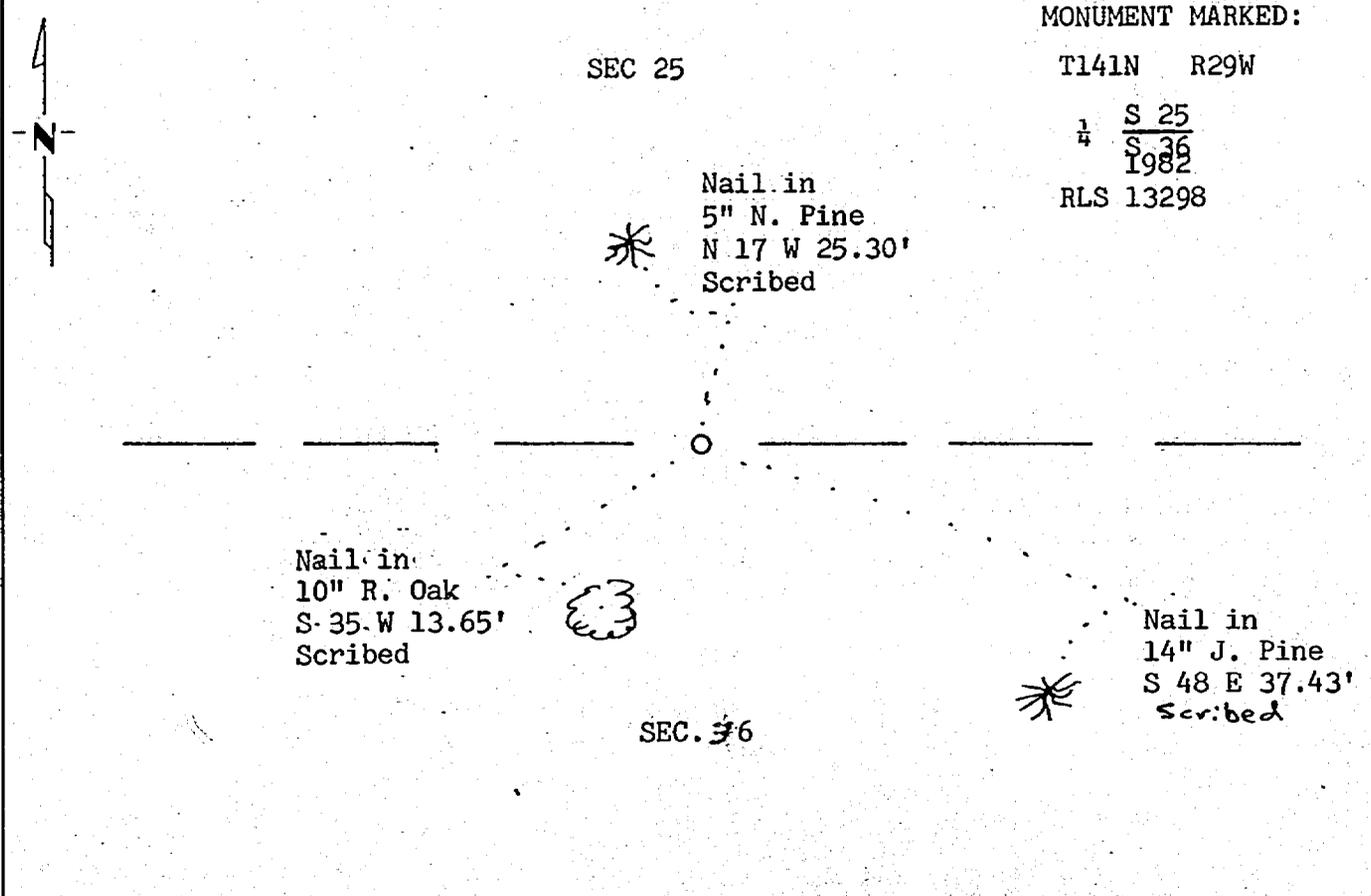

BEARINGS ARE APPROXIMATE MAGNETIC

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

David P. Claypool 7/7/83
SIGNATURE DATE

Registration No. 13298
 Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

²⁷⁹¹⁵⁵
OFFICE OF THE COUNTY RECORDER
County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 9:15 A .M. on the 3 day of Dec. A.D., 1984

County Recorder Claudia Kayler
By MS, Deputy

DOCUMENT NO. 279155

Statement of Evidence:

- 1873 U.S. General Land Office survey set wood post for this corner and marked the following bearing trees: 20" W. Pine N 40 E 13 links and 24" W. Pine N 55 W 39 links.
- 1982 County Surveyor's Records in the Recorder's Office were checked and no resurvey information was found on this corner.
- 1982 U.S. Forest Service office in Cass Lake was contacted for information. Their records show technician J. Ekstrom searched for the corner in 1964. No evidence was found of a corner monument or of the original bearing trees. An old tree tag, probably from the CCC's, was found on a J. Pine that stated corner was N 29 W 73 links. Information in their files lists tree tags on a J. Pine N 64 E 42.24 feet and J. Pine S 29 E 48.18 feet. No date is known on this information and the source or on what it is based is not known.
- 1982 A traverse was run between the NW and NE corners of Sec. 36. No evidence was found of the corner or original bearing trees. The metal tag on the J. Pine showing corner to be N 29 W 73 links was found. No evidence was found of the J. Pine to the NE which now falls in Pine plantation. Distance measured between section corners was 5100.23 feet. The corner was considered lost and reestablished by single proportion method (straight line and midway between the section corners.) From this lost position the J. Pine with the old metal tag was found to be S 48 E 37'. This was not considered adequate evidence by reestablishing the corner. At the lost position a 2" x 60" galvanized iron pipe with a 3" marked brass cap was set. Steel sign posts were set 3.8 feet south and 4.0 feet west. Three new bearing trees were taken as shown on this certificate.