

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTH QUARTER Corner of Section 10, Township 134 N, Range 30 W, 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

On 6-28-93 found a 1/2" IRON ROD, DOWN 0.2'
DATE

left monument as found, lowered monument, removed monument (explain)

On _____ Placed a _____
DATE

SKETCH OF REFERENCE TIES




NOTE:
MONUMENT IS
ON CL E-W ROAD



FOUND NAIL & DISC
EAST SIDE 14" RED PINE
UP 4.0'

N 06° E

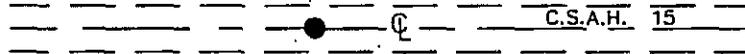

S 13° W
83.19'

FOUND NAIL & DISC
NW SIDE 6" RED PINE
UP 2.0'



S 27° E
69.78'

FOUND NAIL & DISC
NE SIDE 8" WHITE PINE
UP 1.0'



BEARINGS OBSERVED WITH COMPASS

Statement of evidence relative to this corner location is on back of page.

SFT00039.04.00.01
J.B.M. AUG. 1993

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Donald R. Rasmussen 8-25-93
SIGNATURE DATE

Registration No. 17005

- Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER
County of CASS

351912

I hereby certify that this document was filed in the Co. recorders office at 4:14 P .M. on the 14th day of October A.D., 1993

County Recorder Claudine Kaylan
By N-B, Deputy

DOCUMENT NO. 351912

North Quarter Corner Section 10, Township 134 North, Range 30 West

The DNR Bureau of Engineering contacted the following offices for information regarding this corner:

MN Secretary of State
Cass County Surveyor
Cass County Highway Engineer

- 1868 The U.S. General Land Office field notes, on file in the Secretary of State's Office, show this corner to be marked with a post and marked the following bearing trees:
N. Pine 22" N 43° E 44 lks., W. Pine 6" S 43° W 10 lks.
- 1911 Cass County Land Corner Record Card, on file in the County Surveyor's Office, shows in County Survey Record Book A, on Pages 465 to 472, A.W. Moulstor found a 1 1/4" iron pipe set from both old bearing trees. One new tie is shown for the iron pipe. This information is also on microfilm - Roll 105 Book 49 Page 59.
- 1914 Cass County Land Corner Record Card, on file in the County Surveyor's Office, shows in County Survey Record Book B, on Pages 32 to 34, John Curo set a 4" x 36" Bl. iron pipe showing that old bearing tree stumps check with this position.
- No Date The right-of-way map for County State Aid Highway 15 shows an inplace monument at this corner. Corner is shown on the centerline of an east-west road.
- 1990 Cass County Land Corner Record Card, on file in the County Surveyor's Office, shows W. Curo set a pin and temporary ties with a county highway crew.
- 1993 June, the DNR Bureau of Engineering conducted a search for the corner and found a 1/2" iron rod down 0.2 ft. Government bearing tree location is now in County State Aid Highway 15. Searched for and found the 1990 ties which agree with the found iron rod. Iron rod was found to be:
2624.05 ft. from the northeast corner Section 10
on centerline of east-west road

Analysis of the available information led the DNR Bureau of Engineering to conclude that the found iron pipe marks the location of the corner. It is unknown if the iron rod was set inplace of the 1914 monument, but the east-west road probably destroyed alot of corner evidence at this corner.