



8 0 3 7 2 7 9

Tx:4026798

A000581283

**OFFICE OF COUNTY RECORDER
CASS COUNTY MINNESOTA
CERTIFIED, FILED, AND/OR
RECORDED ON
06/12/2012 11:25:21 AM
AS DOC #: A000581283
PAGES: 2 REC FEES: 0.00
KATHRYN M. NORBY
COUNTY RECORDER**


Index No. J-3

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTH QUARTER Corner of Section 18, Township 135, Range 32
5TH Principal Meridian, State of Minnesota, County of CASS

At the corner location shown on the sketch:

- On _____ found a _____
DATE _____
- left monument as found, lowered monument, removed monument (explain)
- On 4/10/12 Placed a 1" X 48" IRON PIPE WITH PLASTIC CAP STAMPED "MN DNR LS 47461"
DATE _____
UP 1' ON DOWNED NORTH-SOUTH FENCE LINE

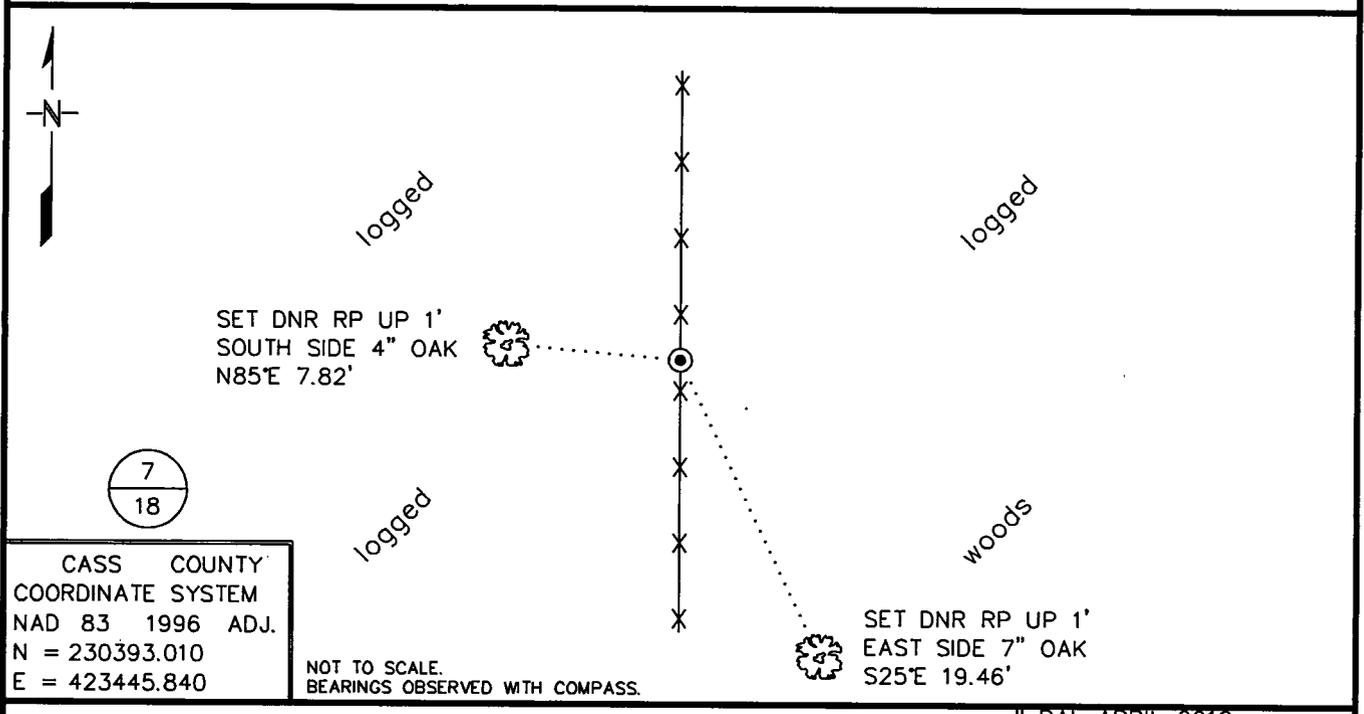

Statement of evidence for this corner location is on back of this page.

RAL APRIL 2012
WMA01870.00.00.01

I certify that this document was researched and prepared by me or under my direct supervision.

SIGNATURE *Robert H. [Signature]* DATE 5/15/12 License Number 47461

Title: Land Surveyor County Surveyor

STATEMENT OF EVIDENCE

North Quarter Corner of Section 18, Township 135 North, Range 32 West, 5th P.M.

The Department of Natural Resources, Division of Lands and Minerals, contacted the following offices for information regarding this corner:

MN History Center
 Wadena County Highway Dept.
 Cass County Surveyor
 Wadena County Recorder
 Nyberg Surveying
 Roy Smith, Land Surveyor

1866 The US General Land Office field notes, on file in the History Center, show this corner to be marked with a post and the following bearing trees:

Black Pine	12"	N 48° E	125 links (82.5')
Black Pine	10"	S 58° W	95 links (62.7')

Circa

1900 Judicial Ditch No. 7 map found at the Cass County Surveyor's Office shows ditch running along the north-south quarter line of section 7.

1937 Air photos on file with the DNR show an occupation line along the north-south quarter line of section 18.

2012 In February, the DNR survey crew searched for evidence of the corner and located an old downed north-south fence line in the vicinity of the corner location. The ditch P.I. north of the corner was also located. No other evidence of the corner was recovered. After analysis, the fence line was determined to be the best available evidence of the corner location and the corner was computed on line between the northeast and northwest corners of the section on the north-south fence line. An iron monument was set at the corner location as shown on the face of this document.

Northeast Corner of Section 18 bears S89°01'26"E 2657.46'

Northwest Corner of Section 18 bears N89°01'26"W 2133.34'

For information on our survey in this area, please contact the MN DNR, Division of Lands and Minerals, Survey Section, 1601 Minnesota Drive, Brainerd, MN 56401